

Error Reference Manual 8.2

08.03.2001



NOTICE

Enterasys Networks and its licensors reserve the right to make changes in specifications and other information contained in this document without prior notice. The reader should in all cases consult Enterasys Networks to determine whether any such changes have been made.

The hardware, firmware, or software described in this manual is subject to change without notice.

IN NO EVENT SHALL ENTERASYS NETWORKS AND ITS LICENSORS BE LIABLE FOR ANY INCIDENTAL, INDIRECT, SPECIAL, OR CONSEQUENTIAL DAMAGES WHATSOEVER (INCLUDING BUT NOT LIMITED TO LOST PROFITS) ARISING OUT OF OR RELATED TO THIS MANUAL OR THE INFORMATION CONTAINED IN IT, EVEN IF ENTERASYS NETWORKS AND ITS LICENSORS HAVE BEEN ADVISED OF, KNOWN, OR SHOULD HAVE KNOWN, THE POSSIBILITY OF SUCH DAMAGES.

Enterasys Networks, Inc. 35 Industrial Way Rochester, NH 03866-5005

Enterasys Networks, Inc. is a subsidiary of Cabletron Systems, Inc.

© 2001 by Enterasys Networks, Inc. All Rights Reserved Printed in the United States of America

Order Number: 9032565-09 August 2001

LANVIEW is a registered trademark of Enterasys Networks or its licensors; SmartSwitch and Enterasys Networks are trademarks of Enterasys Networks or its licensors. SPECTRUM is a registered trademark of Aprisma Management Technologies or its licensors.

All other product names mentioned in this manual may be trademarks or registered trademarks of their respective companies.

ENTERASYS NETWORKS, INC. PROGRAM LICENSE AGREEMENT

BEFORE OPENING OR UTILIZING THE ENCLOSED PRODUCT, CAREFULLY READ THIS LICENSE AGREEMENT.

This document is an agreement ("Agreement") between You, the end user, and Enterasys Networks, Inc. ("Enterasys") that sets forth your rights and obligations with respect to the Enterasys software program ("Program") in the package. The Program may be contained in firmware, chips or other media. UTILIZING THE ENCLOSED PRODUCT, YOU ARE AGREEING TO BECOME BOUND BY THE TERMS OF THIS AGREEMENT, WHICH INCLUDES THE LICENSE AND THE LIMITATION OF WARRANTY AND DISCLAIMER OF LIABILITY. IF YOU DO NOT AGREE TO THE TERMS OF THIS AGREEMENT, RETURN THE UNOPENED PRODUCT TO ENTERASYS OR YOUR DEALER, IF ANY, WITHIN TEN (10) DAYS FOLLOWING THE DATE OF RECEIPT FOR A FULL REFUND.

IF YOU HAVE ANY QUESTIONS ABOUT THIS AGREEMENT, CONTACT ENTERASYS NETWORKS (603) 332-9400. Attn: Legal Department.

1. LICENSE. You have the right to use only the one (1) copy of the Program provided in this package subject to the terms and conditions of this License Agreement.

You may not copy, reproduce or transmit any part of the Program except as permitted by the Copyright Act of the United States or as authorized in writing by Enterasys.

- 2. OTHER RESTRICTIONS. You may not reverse engineer, decompile, or disassemble the Program.
- **3. APPLICABLE LAW**. This License Agreement shall be interpreted and governed under the laws and in the state and federal courts of New Hampshire. You accept the personal jurisdiction and venue of the New Hampshire courts.
- **4. EXPORT REQUIREMENTS.** You understand that Enterasys and its Affiliates are subject to regulation by agencies of the U.S. Government, including the U.S. Department of Commerce, which prohibit export or diversion of certain technical products to certain countries, unless a license to export the product is obtained from the U.S. Government or an exception from obtaining such license may be relied upon by the exporting party.

If the Program is exported from the United States pursuant to the License Exception CIV under the U.S. Export Administration Regulations, You agree that You are a civil end user of the Program and agree that You will use the Program for civil end uses only and not for military purposes.

If the Program is exported from the United States pursuant to the License Exception TSR under the U.S. Export Administration Regulations, in addition to the restriction on transfer set forth in Sections 1 or 2 of this Agreement, You agree not to (i) reexport or release the Program, the source code for the Program or technology to a national of a country in Country Groups D:1 or E:2 (Albania, Armenia, Azerbaijan, Belarus, Bulgaria, Cambodia, Cuba, Estonia, Georgia, Iraq, Kazakhstan, Kyrgyzstan, Laos, Latvia, Libya, Lithuania, Moldova, North Korea, the People's Republic of China, Romania, Russia, Rwanda, Tajikistan, Turkmenistan, Ukraine, Uzbekistan, Vietnam, or such other countries as may be designated by the United States Government), (ii) export to Country Groups D:1 or E:2 (as defined herein) the direct product of the Program or the technology, if such foreign produced direct product is subject to national security controls as identified on the U.S. Commerce Control List, or (iii) if the direct product of the technology is a complete plant or any major component of a plant, export to Country Groups D:1 or E:2 the direct product of the plant or a major component thereof, if such foreign produced direct product is subject to national security controls as identified on the U.S. Commerce Control List or is subject to State Department controls under the U.S. Munitions List.

- **5. UNITED STATES GOVERNMENT RESTRICTED RIGHTS**. The enclosed Product (i) was developed solely at private expense; (ii) contains "restricted computer software" submitted with restricted rights in accordance with section 52.227-19 (a) through (d) of the Commercial Computer Software-Restricted Rights Clause and its successors, and (iii) in all respects is proprietary data belonging to Enterasys and/or its suppliers. For Department of Defense units, the Product is considered commercial computer software in accordance with DFARS section 227.7202-3 and its successors, and use, duplication, or disclosure by the Government is subject to restrictions set forth herein.
- **6. EXCLUSION OF WARRANTY**. Except as may be specifically provided by Enterasys in writing, Enterasys makes no warranty, expressed or implied, concerning the Program (including its documentation and media).

ENTERASYS DISCLAIMS ALL WARRANTIES, OTHER THAN THOSE SUPPLIED TO YOU BY ENTERASYS IN WRITING, EITHER EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, WITH RESPECT TO THE PROGRAM, THE ACCOMPANYING WRITTEN MATERIALS, AND ANY ACCOMPANYING HARDWARE.

7. NO LIABILITY FOR CONSEQUENTIAL DAMAGES. IN NO EVENT SHALL ENTERASYS OR ITS SUPPLIERS BE LIABLE FOR ANY DAMAGES WHATSOEVER (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF BUSINESS, PROFITS, BUSINESS INTERRUPTION, LOSS OF BUSINESS INFORMATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR RELIANCE DAMAGES, OR OTHER LOSS) ARISING OUT OF THE USE OR INABILITY TO USE THIS ENTERASYS PRODUCT, EVEN IF ENTERASYS HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES. BECAUSE SOME STATES DO NOT ALLOW THE EXCLUSION OR LIMITATION OF LIABILITY FOR CONSEQUENTIAL OR INCIDENTAL DAMAGES, OR IN THE DURATION OR LIMITATION OF IMPLIED WARRANTIES IN SOME INSTANCES, THE ABOVE LIMITATION AND EXCLUSIONS MAY NOT APPLY TO YOU.

DECLARATION OF CONFORMITY

Application of Council Directive(s): 89/336/EEC

73/23/EEC

Manufacturer's Name: Enterasys Networks, Inc.

Manufacturer's Address: 35 Industrial Way

PO Box 5005

Rochester, NH 03867

European Representative Name: Mr. Jim Sims

European Representative Address: Enterasys Networks Ltd.

Nexus House, Newbury Business Park

London Road, Newbury Berkshire RG14 2PZ, England

Conformance to Directive(s)/Product Standards: EC Directive 89/336/EEC

EC Directive 73/23/EEC

EN 55022 EN 55024 EN 60950 EN 60825

Equipment Type/Environment: Networking Equipment, for use in a Commercial

or Light Industrial Environment.

Enterasys Networks, Inc. declares that the equipment packaged with this notice conforms to the above directives.

Contents

Preface	XV
What's New	
Reading Error Messages	
How To Use this Book	
Getting Help	
Chapter 1: Layer 3 Access Control List (ACL) Error Messages	1
Informational Messages	
Error Messages	
Chapter 2: AGGRGEN Error Messages	11
Error Messages	
Chapter 3: ARP Messages	15
Error Messages	
Chapter 4: ATM Error Messages	17
Informational Messages	
Warning Messages	
Error Messages	
Chapter 5: Authentication Error Messages	39
Error Messages	
Chapter 6: BGP Error Messages	43
Informational Messages	
Warning Messages	
Error Messages	

Chapter 7: Chassis-Related Error Messages	57
Informational Messages	
Warning Messages	
Fatal Messages	
Chapter 8: Native CLI Error Messages	61
Warning Messages	
Error Messages	
Chapter 9: Common CLI Error Messages	83
Warning Messages	
Error Messages	84
Chapter 10: Configuration Error Messages	99
Informational Messages	99
Warning Messages	101
Error Messages	103
Fatal Error Messages	
Chapter 11: Console Error Messages	109
Warning Messages	
Error Messages	110
Chapter 12: DDT Error Messages	113
Error Messages	
Chapter 13: DHCP Error Messages	117
Informational Messages	
C	
Chapter 14: DVMRP Error Messages	119
Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 15: ERR Error Messages	125
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	
Unknown Messages	
Chapter 16: FDDI Error Messages	129
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	

Chapter 17: 10Base-T Ethernet Driver Error Messages	141
Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 18: GARP Error Messages	147
Informational Messages	
Warning Messages	
Error Messages	
Chapter 19: GateD Global Error Messages	151
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	
Chapter 20: GVRP Error Messages	165
Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 21: HBT Error Messages	175
Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 22: IGMP Error Messages	183
Informational Messages	
Warning Messages	
Error Messages	
Chapter 23: Interface Configuration Error Messages	187
Informational Messages	
Warning Messages	
Error Messages	
Chanton 24: ID Stack Eman Massages	205
Chapter 24: IP Stack Error Messages	
Informational Messages	
Warning Messages	
Error Messages	208
Chapter 25: IP Helper and BOOTP Relay Agent Error Messages.	213
Informational Messages	213
Error Messages	216

Chapter 26: IPC (WAN) Error Messages	217
Warning Messages	
Error Messages	
Chapter 27: IPX Protocol Error Messages	219
Informational Messages	
Error Messages	
Chapter 28: Layer 2 Table Manager Error Maggages	220
Chapter 28: Layer 2 Table Manager Error Messages Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 29: Layer 3 Aging Error Messages	241
Error Messages	
Chapter 30: Load Balance Error Messages	243
Informational Messages	
Warning Messages	
Error Messages	
Chapter 31: Multicast Traceroute Error Messages	259
Error Messages	259
Chapter 32: Mirroring Error Messages	261
Informational Messages	
Warning Messages	
Error Messages	
Chapter 33: Multicast Error Messages	265
Error Messages	
Chapter 34: NAT Error Messages	269
Informational Messages	
Error Messages	
Chapter 35: NetFlow Error Messages	277
Informational Messages	
Warning Messages	
Error Messages	
Chapter 36: Netstat Error Messages	263
Error Messages	
Litot 1/1030ago3	

Chapter 37: Network Interface Driver Error Messages	285
Error Messages	
Warning Messages	
Fatal Messages	
Chapter 38: NoSuppress (WAN) Error Messages	289
Informational Messages	
Chapter 39: NTP Error Messages	293
Informational Messages	
Warning Messages	
Error Messages	
Chapter 40: OSPF Error Messages	297
Informational Messages	
Error Messages	
Chapter 41: IP Policy Error Messages	311
Informational Messages	
Error Messages	
Chapter 42: Ping Error Messages	317
Error Messages.	
Chapter 43: POLICY Error Messages	319
Warning Messages	
Error Messages	
Chapter 44: Phy_POLL Error Messages	333
Fatal Messages	
Chapter 45: PPP Messages	335
Informational Errors	
Error Messages	
Chapter 46: PTY Error Messages	339
Warning Messages	
Fatal Messages	
Chapter 47: QOS Error Messages	341
Informational Messages	
Warning Messages	
Error Massagas	3/13

Chapter 48: RARPD Error Messages	349
Informational Messages	
Warning Messages	
Error Messages	
Chapter 49: Rate Limit Error Messages	353
Informational Messages	
Warning Messages	
Error Messages	
Chapter 50: RCP Error Messages	371
Informational Messages	
Warning Messages	
Error Messages	
Chapter 51: RDISC Error Messages	379
Error Messages	
Chapter 52: Resolver Error Messages	383
Informational Messages	
Error Messages	
Chapter 53: RIP Error Messages	387
Error Messages	
Chapter 54: RMON Error Messages	391
Informational Messages	
Warning Messages	
Error Messages	
Chapter 55: Serial Input/Output Driver Error Messages	403
Fatal Messages	
Chapter 56: Serial (WAN) Error Messages	407
Informational Messages	
Warning Messages	
Error Messages	
Chapter 57: SmartTRUNK Error Messages	419
Informational Messages	
Warning Messages	
Error Messages	
	· · · · · · · · · · · · · · · · · · ·

Chapter 58: SNMP Error Messages	427
Information Messages	
Warning Messages	
Error Messages	
Chapter 59: Packet-Over-Sonet Error Messages	433
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	
Chapter 60: SR Error Messages	439
Informational Messages	439
Warning Messages	
Error Messages	
Fatal Messages	443
Chapter 61: STATIC Error Messages	445
Error Messages	
Chapter 62: STP Error Messages	451
Informational Messages	
Warning Messages	452
Error Messages	453
Chapter 63: SYS Error Messages	467
Informational Messages	467
Warning Messages	
Error Messages	
Fatal Messages	
Chapter 64: Syslog Error Messages	515
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	
Chapter 65: T1T3CLI Error Messages	519
Informational Messages	
Warning Messages	
Error Messages	
Chapter 66: Telnet Error Messages	523
Warning Messages	
Error Messages	

Chapter 67: TFTP Error Messages	525
Informational Messages	
Error Messages	
Chapter 68: Traceroute Error Messages	529
Error Messages	
Chapter 69: Unicast Error Messages	531
Informational Messages	
Warning Messages	
Error Messages	
Fatal Errors	
Chapter 70: VLAN Error Messages	535
Informational Messages	
Warning Messages	
Error Messages	
Chapter 71: IP Redundancy (VRRP) Error Me	ssages551
Informational Messages	
Warning Messages	
Error Messages	
Fatal Messages	
Chapter 72: Web Cache Error Messages	565
Informational Messages	
Error Messages	
Appendix A: Undocumented Error Messages	571
Appendix B: Technical Support	613
Getting Help	
Hardware Warranty	
Software Warranty	
Repair Services	
Indov	Z115

Preface

This guide lists and describes the system error messages for the Enterasys routers. The system software sends these messages to the console during operation. Some of the generated messages are for informational purposes only and do not require action. Other messages indicate a caution or error condition that may require action.

What's New

This manual contains updates to numerous error messages and the addition of many that were previously undocumented.

Reading Error Messages

Each error message begins with a percent sign and has the following format:

%<facility>-<severity>-<description> <message text>

where:

- < facility> is a code consisting of uppercase letters that indicates the facility to which the error message refers.
- <severity> is a single-letter code indicating the severity of the error condition. There are four severity levels:
 - I informational message (least severe)
 - W warning condition
 - E error condition
 - **F** fatal error (most severe)
- < description > is a code consisting of uppercase letters that identifies the error message.
- *<message text>* is a text string that briefly describes the error condition.

Note: You do not need to respond to informational messages.

How To Use this Book

Each chapter in this book lists and describes the messages generated by the different system facilities. There is one chapter for each system facility. Within each chapter, messages are grouped by severity and alphabetized.

Appendix A contains a list undocumented messages. It is unlikely that you will see one of these messages displayed within the syslogs. Most of the undocumented messages are for Enterasys internal use or are artifacts. If you have concerns about any of the undocumented messages, call Enterasys Technical Support.

Getting Help

For additional support related to the Common CLI syntax or this document, contact Enterasys Networks using one of the following methods:

World Wide Web	http://www.enterasys.com/
Phone	(603) 332-9400
Internet mail	support@enterasys.com
FTP	ftp://ftp.enterasys.com
Login	anonymous
Password	your email address

To send comments or suggestions concerning this document, contact the Technical Writing Department via the following email address: **TechWriting@enterasys.com** Please include the document Part Number in the email message.

Before contacting Enterasys Networks, have the following information ready:

- Your Enterasys Networks service contract number
- A description of the failure
- A description of any action(s) already taken to resolve the problem (e.g., changing mode switches, rebooting the unit, etc.)
- The serial and revision numbers of all involved Enterasys Networks products in the network
- A description of your network environment (layout, cable type, etc.)
- Network load and frame size at the time of trouble (if known)

Chapter 1

Layer 3 Access Control List (ACL) Error Messages

This chapter describes the error messages for the Layer 3 Access Control List (ACL) facility.

Informational Messages

%ACL-I-NOACL No ACL applied to interface <interface_name>

Explanation:

The user is trying to see if an ACL is applied to a specific interface. This message indicates that there are no ACLs applied to this interface.

Recommended Action:

Informational Message. No action necessary.

%ACL-I-NOALL No ACL applied to all IP interfaces.

Explanation:

There is no ACL that is applied to all IP interfaces.

Recommended Action:

Informational Message. No action necessary.

%ACL-I-NOALL No ACL applied to all IPX interfaces.

Explanation:

There is no ACL that is applied to all IPX interfaces.

Recommended Action:

Informational Message. No action necessary.

%ACL-I-NOCHANGE No change was made, exiting...

Explanation:

The user is attempting to use the **save** command in the ACL editor but no change has been made.

Recommended Action:

Informational Message. No action necessary.

%ACL-I-NONE No ACL applied to any services

Explanation:

There is no Service ACL applied to any services on the XP.

Recommended Action:

Informational Message. No action necessary

%ACL-LOG-I-DEFAULT [<acl_name>] on "<interface_name>"...

Explanation:

This ACL Logging message shows that a packet doesn't match any of the rules specified in this ACL. As a result, the packet is denied because of the implicit deny rule.

Recommended Action:

Informational Message. No action necessary.

%ACL_LOG-I-DENY ACL [<number>] on "<interface_name>"...

Explanation:

This ACL Logging message shows that a particular packet is denied because it matches a rule in the specified ACL.

Recommended Action:

Informational Message. No action necessary.

%ACL_LOG-I-PERMIT ACL [<number>] on "<interface_name>"...

Explanation:

This ACL Logging message shows that a particular packet is permitted because it matches a rule in the specified ACL.

Recommended Action:

Informational Message. No action necessary.

Error Messages

%ACL-E-ALREADY ACL <*ACL_name*> is already applied to interface <*interface_name*>.

Explanation:

The user is trying to apply an ACL to an interface where this ACL is already applied.

Recommended Action:

None. An ACL can only be applied to the same interface in the same direction once.

%ACL-E-BADACLNAME Unknown or invalid ACL name: <ACL_name>

Explanation:

The user is trying to apply a non-existent ACL to an interface.

Recommended Action:

Create the ACL first before applying it to the interface.

%ACL-E-DSTFLOWMODE Interface '%s' has a port in Destination Flow Mode.

Explanation:

The user is trying to attach an ACL to an interface which has one or more ports in Destination flow based routing mode. An inbound ACL cannot be applied to such interfaces because the ACL may have Source IP, Source Port, or Destination Port field in its parameters.

Recommended Action:

Either the ports associated with the interface should not be in Destination Flow based mode or the ACL should only contain Destination IP address in its parameters.

%ACL-E-GNSDIRECTION IPXGNS ACL can only be applied to output.

Explanation:

The user is trying to apply a GNS filter (IPX ACL) to the input direction. Since the Get Nearest Server (GNS) requests are sourced by the XP, it doesn't make sense to apply an IPX GNS ACL on the inbound side.

Recommended Action:

None. GNS filters cannot be applied to the input direction.

%ACL-E-HSTFLMODINCOM ACL %s has incompatible rules for Host Flow based routing.

Explanation:

The user is trying to set the port to Host Flow based routing mode which is not compatible with the ACL associated with the port. The ACL might be having rules on Scr Port or Destination Port, all of which in the packet will not be considered if the port is in Host Blow based mode.

Recommended Action:

Find out the ACL that is causing the conflict and detach it from the port and try again.

%ACL-E-HSTFLOWMODE Interface '%s' has a port in Host Flow Mode.

Explanation:

The user is trying to attach an ACL to an interface which has one or more ports in Host Flow based routing mode. An inbound ACL cannot be applied to such interfaces because the ACL may have Source Port or Destination Port fields in its parameters.

Recommended Action:

Either the ports associated with the interface should not be in Host Flow based mode or the ACL should only contain Destination IP address and Source IP address in its parameters.

%ACL-E-HSTFLOWSERVICEACL Service ACL has incompatible rules for Host Flow based routing.

Explanation:

The user is trying to change the port mode to Host Flow based, where there is a service ACL in the system. A service ACL requires that all ports not be in either Destination or Host Flow based modes because a service ACL requires to compare the Destination Port number in the packet and a port in Destination flow mode would produce a flow block with only the Destination and Source IP addresses.

Recommended Action:

Cannot change port mode to Host Flow based mode if a service ACL is present in the system. The ACL could be detached from the services if the port needs to be in Host Flow based mode.

%ACL-E-INCOMPATIBLE ACL %s has incompatible rules for Destination based routing.

Explanation:

The user is trying to set the port to Destination Based routing mode which is not compatible with the ACL associated with the port. The ACL might be having rules on Source IP Src Port, or Destination Port, all of which in the packet will not be considered if the port is in Destination based mode.

Recommended Action:

Find out the ACL that is causing the conflict ant detach it from the port and try again.

%ACL-E-IFNOTFOUND <interface_name>: no such interface.

Explanation:

The user is trying to apply an ACL to a non-existent interface.

Recommended Action:

Create the interface first before applying the ACL.

%ACL-E-INSERVICE <2> ACL %s is currently in use by service '%s'.

Explanation:

The ACL is used by the service.

Recommended Action:

None.

%ACL-E-NATCONFIGURED <2> ACL %s is currently in use by NAT as '%s' dynamic pool

Explanation:

The user is trying to delete an ACL which is being used by NAT in a dynamic pool.

Recommended Action:

None.

%ACL-E-NATINFO <2> ACL %s is currently in use by NAT as '%s' dynamic pool

Explanation:

The user is trying to delete an ACL and the ACL is not present in the system.

Recommended Action:

None.

%ACL-E-NOMODIFYPORT <2> ACL is currently in use by port. Please use the ACL Editor to edit this ACL.

Explanation:

The user is trying to create an ACL which is already present and is attached to a port.

Recommended Action:

None. You cannot create an ACL which is already present. Use a new name.

%ACL-E-NOMODIFYACL is currently in use at interface <interface_name>. Please use the ACL Editor to edit this ACL.

Explanation:

The user is trying to modify an ACL that is currently applied to an interface.

Recommended Action:

To modify an ACL that is currently applied to an interface, there are two ways you can do it. One way is to "detach" the ACL from the interface first before modifying the ACL. You can do so by negating the corresponding **acl apply** command. The second, simpler method is to use the ACL Editor. Using the ACL Editor, you can make changes to an ACL that is currently applied. When you exit and save the modified ACL, the changes take effect immediately.

%ACL-E-NOSUCHRULEUnable to find specified ACL rule; possibly deleted by another configuration task.

Explanation:

The ACL that you are trying to use does not exist. This message only occurs in the rare situation where someone deleted the ACL as you try to use it.

Recommended Action:

Re-create the ACL that you want to use.

%ACL-E-NOTINL4BDGVLAN ACL not applied - Port %s must belong to an L4-bridged Vlan.

Explanation:

The user is trying to apply an ACL to a port which does not belong to the L4 bridging VLAN.

Recommended Action:

An ACL cannot be applied to a port which does not belong to L4 bridging VLAN. The user needs to add the port to an L4 bridging VLAN.

%ACL-E-OPTMISMATCH The 'all-ip' option can not be used with an AppleTalk ACL.

Explanation:

The 'all-ip' option has no meaning with respect to the AppleTalk protocol.

Recommended Action:

Do not use the 'all-ip' option with AppleTalk ACLs.

%ACL-E-PORTFLOWMODE A port is in Destination Flow Mode; incompatible with Service ACL %s.

Explanation:

The user is trying to apply an ACL to a service and at least one port in the XP is in Destination Flow based mode. To apply an ACL to a service requires the Destination Port number in the packet. If any port is in Destination flow based ode then, only the Destination IP address is extracted from the packet and all other fields are ignored while constructing the flow block for flow lookup.

Recommended Action:

Only if none of the ports are in either Destination or Host Flow based mode, will the user be able to apply an ACL to a service.

%ACL-E-PORTHSTFLOWMODE A port is in Host Flow Mode; incompatible with Service ACL %s.

Explanation:

The user is trying to apply an ACL to a service and at least one port in the XP is in Host Flow based mode. To apply an ACL to a service requires the Destination Port number in the packet. If any port is in Destination Flow based ode then, only the Destination IP address is extracted from the packet and all other fields are ignored while constructing the flow block for the flow lookup.

Recommended Action:

Only if none of the ports are in either Destination or Host Flow based mode, will the user be able to apply an ACL to a service.

%ACL-E-PORTNOTFOUND %d: no such port.

Explanation:

The user is trying to look at all the attached ACLs for a port that doesn't exist.

Recommended Action:

Check the appropriate slot for the presence of the port.

%ACL-E-PROTMISMATCH There is a protocol mismatch between the ACL and the Interface.

Explanation:

This message is displayed if the user tries an ACL to an interface and the protocol type (IP, IPX, etc.) of the ACL and the interface are not the same.

Recommended Action:

Try to attach an ACL to an interface if and only if they both have the same protocol types.

%ACL-E-REFERENCE ACL '%s' is being referenced by other commands -- delete these references before deleting this ACL

Explanation:

The user is trying to delete the ACL which is still being used.

Recommended Action:

Detach the ACL from all its usages before deleting it.

%ACL-E-SAMEPROTOAnother ACL (<ACL_name>) for <interface_name> has already been applied to this interface.

Explanation:

Another ACL for the same protocol has already been applied to this interface in the same direction (input or output). You cannot apply a second ACL for the same protocol to the same interface in the same direction. For example, you can only apply one IP ACL to an IP interface in the inbound direction. You can apply a second IP ACL to the same IP interface if it is applied in the outbound direction but not if they apply to the same direction. This approach is chosen to avoid confusion as to which ACL should have precedence over other ACLs in the event that none of the rules in an ACL matches the packet.

Recommended Action:

If it is necessary to have the rules from two different ACLs applied to an interface, you need to combine the rules from the two ACLs into one ACL and apply that to the interface.

%ACL-E-SERVICEACL Service ACL has incompatible rules for Destination based routing.

Explanation:

The user is trying to change the port mode to Destination Flow based, when there is a service ACL in the system. A service ACL requires that all ports not be in either Destination or Host Flow based modes because a service ACL requires to compare the Destination Port number in the packet and a port in Destination Flow mode would produce a flow block with only the Destination IP address.

Recommended Action:

Cannot change port mode to Destination Flow based mode if a service ACL is present in the system. The ACLs could be detached from the services if the port needs to be in Destination Flow based mode.

%ACL-E-WRONGACLYou can only add rules to ACL '<ACL_name>' in this editing session.

Explanation:

Inside the ACL Editor, the user is attempting to add rules to a different ACL.

Recommended Action:

None. When you edit an ACL in the ACL Editor, you can only add rules to the ACL that you are editing. For example, you cannot add rules to ACL 110 when you are editing ACL 100.

%ACL-E-WRONGPROTOCOLACL <*ACL_name*> is currently defined for <*protocol_type*>.

Explanation:

The user is trying to specify an ACL rule that is of a different protocol family than the ones that are currently in this ACL. For example, this message can occur if the user is trying to add an IPX ACL rule to an IP ACL or vice versa.

Recommended Action:

None. The rules in an ACL must all belong to the same protocol family.

Chapter 2

AGGRGEN Error Messages

This chapter describes the error messages for the AGGRGEN facility.

Error Messages

%AGGRGEN-E-DSTIDEXIST Aggr-Gen destination < name > already exists.

Explanation:

This message appears when the identifier (tag) assigned to a new aggr-gen-dest CLI command is already being used.

Recommended Action:

Use a different (unique) identifier (number or string)

%AGGRGEN-E-DSTNOTFOUND Aggr-Gen destination *<name>* not found.

Explanation:

This message appears when the "destination" parameter in the aggr-gen CLI command is invalid.

Recommended Action:

Correct the destination parameter name.

%AGGRGEN-E-DSTOVFL No more free aggr-gen destination (max <number> cur <number>)

Explanation:

This message appears when the maximum number of "aggregate-generation destination" entries has been reached.

Recommended Action:

If possible, negate unused aggr-gen-dest commands.

%AGGRGEN-E-FILTRDSRCOVFL No more free sources for aggr-gen (max < number > current < number >).

Explanation:

This message appears when the maximum number of source entries associated with an aggr-gen command has been reached.

Recommended Action:

If possible, negate unused aggr-gen commands.

%AGGRGEN-E-FLTRDSRCNEX Sources with id < number > not found in aggr-gen route with destination < number >

Explanation:

This error message is displayed when the user attempts to specify a source or sources in the aggregate-generation route that could not be found.

Recommended Action:

Specify a different source or sources for the given aggregate-generation route.

%AGGRGEN-E-INVFLTRDSRCIDX Invalid filtered-source index (max < number > index < number >)

Explanation:

This error message is displayed when the user attempts to specify an invalid value for the filtered-source index.

Recommended Action:

Specify a different source index number that falls within the range of acceptable values.

%AGGRGEN-E-INVROUTEIDX Invalid route index (max < number > index < number >)

Explanation:

This error message is displayed when the user attempts to specify an invalid value for the route index.

Recommended Action:

Specify a different route index number that falls within the range of acceptable values.

%AGGRGEN-E-INVSRCFLTRIDX Invalid source-filter index (max <number> index <number>)

Explanation:

This error message is displayed when the user attempts to specify an invalid value for the source-filter index.

Recommended Action:

Specify a different source-filter index number that falls within the range of acceptable values.

%AGGRGEN-E-ROUTEOVFL No memory for creating aggr-gens.

Explanation:

This message appears when the maximum number of aggregate policies (aggr-gens) has been reached.

Recommended Action:

If possible, negate unused aggregate-generations and try again.

%AGGRGEN-E-RTEFLTNOTFOUND Aggr-gen (with destination <number> source <number> filter <number>) not found.

Explanation:

This error message is displayed when the user specifies an undefined aggregate-generation.

Recommended Action:

Ensure that you have not entered inappropriate information, or specify another aggregate-generation.

%AGGRGEN-E-SRCFLTROVFL No more free route filters for this aggrgen source max *<number>*

Explanation:

This message appears when the maximum number of filters/networks corresponding to an aggregate policy (aggr-gen) has been reached.

Recommended Action:

If possible, negate unused filters/networks.

%AGGRGEN-E-SRCIDEXIST Aggr-Gen source < name > already exists.

Explanation:

This message appears when the identifier (tag) assigned to a new aggr-gen-source CLI command is already being used.

Recommended Action:

Use a different (unique) identifier (number or string)

%AGGRGEN-E-SRCNOTFOUND Aggr-Gen source < name > not found.

Explanation:

This message appears when the "source" parameter in the aggr-gen CLI command is invalid.

Recommended Action:

Correct the source parameter name.

%AGGRGEN-E-SRCOVFLNo more free aggr-gen sources max < number > current < number >.

Explanation:

This message appears when the maximum number of "aggregate-generation source" entries has been reached.

Recommended Action:

If possible, negate unused aggr-gen-source commands.

Chapter 3

ARP Messages

This chapter describes the error messages for the ARP facility.

Error Messages

%ARP-E-HOSTUNREACH < ip address > no route to host. ARP entry not added

Explanation:

This message is displayed when an ARP entry was attempted to be added from the "Enabled" mode and the action failed.

Recommended Action:

The host may not be unreachable through a directly connected interface. Create and interface and then add the ARP entry.

Chapter 4

ATM Error Messages

This chapter describes the error messages for the ATM facility.

Informational Messages

%ATM-I-FIXINGSCROPTION <0> <0> SCR set, Service Category not VBR. Clearing SCR value.

Explanation:

The SCR value entered is not allowed for the type of service specified. The XP will clear this value.

Recommendation:

Informational message only, no action necessary.

%ATM-I-FIXINGMBSOPTION <0> <0> MBS set, Service Category not VBR. Clearing MBS value.

Explanation:

The MBS value entered is not allowed for the type of service specified. The XP will clear this value.

Recommendation:

Informational message only, no action necessary.

%ATM-I-VCLALREADYOPEN

Explanation:

The VCL specified was already created.

Recommendation:

Specify a new VCL.

Warning Messages

%ATM-W-FIXINGSCROPTION SCR set, Service Category not VBR. Clearing SCR value.

Explanation:

Specified SCR, and SCR is not permitted for specified service class.

Recommended Action:

None.

%ATM-W-FIXINGMBSOPTION MBS set, Service Category not VBR. Clearing MBS value. // ATM PVC message area.

Explanation:

Specified MBS, and MBS is not permitted for specified service class.

Recommended Action:

None.

%ATM-W-IARPNOTXMT Port at.%d.%d.%d.%d could not send an inverse ATM ARP packet.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%AMT-W-OAMNORSP Port at.%d.%d.%d.%d did not receive a response to %d OAM loopback requests.

Explanation:

Internal error.

Recommended Action:

Check that the other end of the link supports OAM cells.

%ATM-W-OAMNOTXMT OAM loopback cell could not be transmitted.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

Error Messages

%ATM-E-BADVC

Explanation:

Internal error.

Recommended Action:

Specify a different VC.

%ATM-E-BITSTREAMREADFAILED Channel %d, error during reading bit stream file, error=%ld.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-BOOTSOURCEISUNKNOWN Bootsource did not have a value.

Explanation:

Bootsource did not have a value.

Recommended Action:

Specify a value.

%ATM-E-CREATE_Q Could not create the Receive Control Queue.

Explanation:

Could not create the Receive Control Queue

Recommended Action:

Contact customer support.

%ATM-E-EXISTINGVCL VCL at.%d.%d.%d.%d already exists! Create failed.

Explanation:

You use an incorrect VCL value.

Recommended Action:

Use a different VCL value.

%ATM-E-EXISTINGVPL VPL at.%d.%d.%d already exists! Create failed.

Explanation:

You use an incorrect VPL value.

Recommended Action:

Use a different VPL value.

%ATM-E-FPGACRCERROR Channel %d, CRC error during FPGA Download.

Explanation:

Internal error.

Contact Enterasys Technical Support.

%ATM-E-FPGADNLOADFAILED Channel %d, FPGA bitstream download failed.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-FPGAFILENAMEUNKNOWN Channel %d, could not get FPGA filename to open.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-FPGAFILEOPENFAILED Channel %d, could not open the FPGA bitstream file, error = %ld

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-FPGAFILESIZEUNKNOWN Channel %d, could not determine the size of the FPGA bitstream file, error = %ld

Explanation:

Internal error.

Recommended Action:

%ATM-E-INITCSRBAD Port at.%d.%d, error while initializing data structures and CSRs.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-INVALIDDEFINEOBJECT Unexpected atm define object: %s

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-INVALIDSRVCATOPTION The service category **%s** is not supported

Explanation:

Internal Error

Recommended Action:

Use a different service type.

%ATM-E-INVALIDSRVDEFOPTION Unknown service definition option.

Explanation:

Internal Error

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-MAPTYPE Port at.%d.%d, tried to configure illegal map type %x.

Explanation:

Internal error.

Contact Enterasys Technical Support.

%ATM-E-NEEDPCR Service requires that a PCR value be specified.

Explanation:

Internal error.

Recommended Action:

Service requires that a PCR value be specified.

%ATM-E-NEEDSCR Service requires that an SCR value be specified.

Explanation:

Internal error.

Recommended Action:

Service requires that an SCR value be specified.

%ATM-E-NI_XMT_Q_FULL Could not transmit control packet, NI transmit queue is full.

Explanation:

Could not transmit control packet, NI transmit queue is full.

Recommended Action:

If problem persists, contact customer support.

%ATM-E-NOAVAILBW Insufficient Link Bandwidth, avail: %d cps

Explanation:

You are attempting to use more bandwidth than is available on the link. Note that CBR traffic cannot use 100% of the bandwidth, since some must be reserved for other critical traffic.

Recommended Action:

Use less bandwidth.

%ATM-E-NOPORTLISTAVAIL No portlist available in command options.

Explanation:

This message is displayed when no port list is available.

Recommended Action:

Call Enterasys Technical Support.

%ATM-E-NORESOURCESAVAIL Internal memory fault - low resources.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-NOVCLFOUND VCL at.%d.%d.%d.%d is not created.

Explanation:

You use an incorrect VCL value.

Recommended Action:

Specify a VCL that has already been created.

%ATM-E-NOVPLFOUND VPL at.%d.%d.%d is not created.

Explanation:

You use an incorrect VPL value.

Recommended Action:

Specify a VPL that has already been created.

%ATM-E-PEERADDRREQD

Explanation:

Internal error.

Recommended Action:

Peer IP required for VC-Multiplexed VCs.

%ATM-E-PORTBADMUX Cannot apply service with encap type vc-mux to PORT with multiple protocols associated.

Explanation:

An ATM VC with encap type vc-mux sends no protocol information over the wire. Because the protocol is determined from the VC, only IP or IPX can be configured over a VLAN or port that contains an ATM VC in vc-mux encap mode. This error is issued when applying a service definition with vc-mux encap type to a PORT with multiple protocols associated.

Recommended Action:

See that only one protocol is associated with this PORT.

%ATM-E-PORTDOESNOTEXIST Port at.%d.%d does not exist.

Explanation:

You specified a port that does not exist, or is not an atm. port.

Recommended Action:

Specify a different port.

%ATM-E-PORTHASINUSEVCLS Port has VCL at.%d.%d.%d.%d in use.

Explanation:

Internal Error

Recommended Action:

Remove VCLs before changing port settings.

%ATM-E-PORTHASSRVDEF Service %s still applied to at.%d.%d

Explanation:

Internal Error

Recommended Action:

Remove existing service definition before applying a new one.

%ATM-E-PORTHASVCLS Port at.%d.%d has %d VCLs still created.

Explanation:

Internal Error

Recommended Action:

Remove VCLs before removing a port.

%ATM-E-POSTFAILED Port at.%d.%d, POST failed - response = %08x.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-REGL2ADDR Port at.%d.%d, could not register this L2 address.

Explanation:

Internal Error

Recommended Action:

Contact customer support.

%ATM-E-SARACKERR Port at.%d.%d, neither the ACK bit or the ERR bit is set.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARCHKSUMERR Port at.%d.%d, bad checksum, found checksum %x, expected %x.

Explanation:

Internal error.

Contact Enterasys Technical Support.

%ATM-E-SARCHKSUMTIMEOUT Port at.%d.%d, SAR time-out while waiting for checksum!

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARDOWNLOAD Port at.%d.%d, error while maker firmware download.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR0 Port at.%d.%d, time-out or SAR error during cfg fmk cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR1 Port at.%d.%d, time-out or SAR error during ret fmk rev cmd.

Explanation:

Internal error.

Recommended Action:

%ATM-E-SARERR2 Port at.%d.%d, time-out or SAR error during add rx buff (pool0) cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR3 Port at.%d.%d, time-out or SAR error during add rx buff (pool1) cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR4 Port at.%d.%d, time-out or SAR error during ret cs rev cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR5 Port at.%d.%d, time-out or SAR error during add rx indQ entries cmd.

Explanation:

Internal error.

Recommended Action:

%ATM-E-SARERR6 Port at.%d.%d, time-out or SAR error during open Phy cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR7 Port at.%d.%d, time-out or SAR error during config CS-5 cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR8 Port at.%d.%d, time-out or SAR error during create SAR cmd.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARERR9 Port at.%d.%d, time-out or SAR error during attach phy cmd.

Explanation:

Internal error.

Recommended Action:

%ATM-E-SARERR10

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARFILENAMEUNKNOWN Port at.%d.%d, could not get SAR filename to open.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARFILEOPENFAILED Port at.%d.%d, could not open the SAR file, error = %ld

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARFILEREADFAILED Port at.%d.%d, couldn't read the SAR file, error = %ld.

Explanation:

Internal error.

Recommended Action:

%ATM-E-SARLOADFAILEDNOMEM Port at.%d.%d, had a malloc failure.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARPOSTTIMEOUT Port at.%d.%d, SAR time-out while waiting for POST results!

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARSIZEUNKNOWN Port at.%d.%d, could not determine the size, error code %d.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SARTIMEOUT Port at.%d.%d, SAR time-out while waiting for the response!

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-SCRGRTRPCR PCR must be greater than or equal to SCR. Explanation:

Internal error.

PCR must be greater than or equal to SCR.

%ATM-E-SMTIMERCREATEERR Event Queue timer could not be created.

Explanation:

Internal Error

Recommended Action:

Notify customer support.

%ATM-E-SRVDEFNAMENOTFOUND The service definition name %s was not found

Explanation:

Internal Error

Recommended Action:

Reference a service definition that you previously created.

%ATM-E-SRVDEFOPENREF Service definition %s is currently applied, cannot be removed.

Explanation:

Internal Error

Recommended Action:

Negate the application of the service before removing the service.

%ATM-E-TOOMANYVCS Port at.%d.%d, too many VCs have been opened.

Explanation:

Internal error.

Recommended Action:

Use fewer VCs.

%ATM-E-TRAFFICTYPEBAD Port at.%d.%d, error - an illegal traffic value, %d.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-UNKNOWNCMD ATM command not recognized

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

ATM-E-VCCLOSETIMEOUT Port at.%d.%d, time-out during close for uhi %d.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-VCCLOSEERR Port at.%d.%d, error in VC table entry reset!

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-VCDISCREPENCY Port at.%d.%d, discrepancy, user handle index %d VC does not exist!

Explanation:

Internal error.

Contact Enterasys Technical Support.

%ATM-E-VCIOUTOFRANGE VCI %d is beyond supported VCI max %d

Explanation:

You specified VCI is outside of the current range.

Recommended Action:

Either use a different VCI value, or use the port set vc-mode command to set a larger range of permissible VCI values.

%ATM-E-VCLHASSRVDEF Service %s still applied to at.%d,%d,%d,%d

Explanation:

Internal Error

Recommended Action:

Remove existing service definition before applying a new one.

%ATM-E-VCLMAXEXCEEDED Max VCLs exceeded on at.%d.%d, max = %d.

Explanation:

User specified VCL is outside of the current range.

Recommended Action:

Either use a different VCL value, or use the port set vc-mode command to set a larger range of permissible VCL values.

%ATM-E-VCLNOTINSERTED VPI %d VCI %d could not be added.

Explanation:

You use an incorrect VCL value.

Recommended Action:

Use a different VCL value.

%ATM-E-VCLOUTOFRANGE VPI %d VCI %d is not in range of port VC mode.

Explanation:

You specified VCL is outside of the current range.

Recommended Action:

Either use a different VCL value, or use the port set vc-mode command to set a larger range of permissible VCL values.

%ATM-E-VCMODIFYSARERR Port at.%d.%d, uhi = %04X - SAR processing error param_id = %04X.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%%ATM-E-VCOPENNOMEM Port at.%d.%d, memory could not be allocated in VC open.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-VCOPENTIMEOUT Port at for during open uhi %d.

Expla	anation:
-------	----------

Recommended Action:

%ATM-E-VCSTATEBAD Port at.%d.%d, fatal error - an illegal state value, %d.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ATM-E-VPIOUTOFRANGE VPI %d is beyond supported VPI max %d

Explanation:

You specified VPI is outside of the current range.

Recommended Action:

Recommended Action:

Either use a different VPL value, or use the port set vc-mode command to set a larger range of permissible VPL values.

%ATM-E-VCLBADMUX Cannot apply service with encap type vc-mux to VCL with multiple protocols associated.

Explanation:

An ATM VC with encap type vc-mux sends no protocol information over the wire. Because the protocol is determined from the VC, only IP or IPX can be configured over a VLAN or port that contains an ATM VC in vc-mux encap mode. This error is issued when applying a service definition with vc-mux encap type to a VCL with multiple protocols associated.

Recommended Action:

See that only one protocol is associated with this VCL.

%ATM-E-VPLBADMUX Cannot apply service with encap type vc-mux to VPL with multiple protocols associated.

Explanation:

An ATM VC with encap type vc-mux sends no protocol information over the wire. Because the protocol is determined from the VC, only IP or IPX can be configured over a VLAN or port that contains an ATM VC in vc-mux encap mode. This error is issued when applying a service definition with vc-mux encap type to a VPL with multiple protocols associated.

See that only one protocol is associated with this VPL.

%ATM-E-VPLHASSRVDEF Service %s still applied to at.%d.%d.%d

Explanation:

Internal Error

Recommended Action:

Remove existing service definition before applying a new one.

%ATM-E-VPLMAXEXCEEDED Max VPLs exceeded on at.%d.%d, max = %d.

Explanation:

You specified VPL is outside of the current range.

Recommended Action:

Either use a different VPL value, or use the port set vc-mode command to set a larger range of permissible VPL values.

%ATM-E-VPLNOTCLOSED VPL at.%d.%d.%d is open. Remove failure.

Explanation:

PL is still in use, referenced by an "interface create" command.

%ATM-E-WRONGPORTTYPE Port port-number> does not support this operation.

Explanation:

This message is displayed when the command being applied to a port that does not support this operation.

Recommended Action:

Enter a command that the port does support.

Chapter 5

Authentication Error Messages

This chapter describes the error messages for the Authentication facility.

Error Messages

%AUTH-E-CHAINIDEXIST Key-Chain < key-chain_name > already exists.

Explanation:

This message appears when a newly created key-chain has the same id as a previously configured key-chain.

Recommended Action:

Change the name/id of the new key-chain.

%AUTH-E-CHAINNOTFOUND Key-Chain with id <id_name> not found.

Explanation:

This message appears when the key-chain identifier specified is invalid.

Recommended Action:

Use a valid key-chain id while defining an authentication method.

%AUTH-E-CHAINNOTSPECAuthentication method requires key-chain identifier.

Explanation:

This message appears when authentication method requires key-chain identifier.

Recommended Action:

Create a key-chain and refer to it when defining an authentication method.

%AUTH-E-CHAINOVFL No more free key-chains max < number > current < number >

Explanation:

This message appears when the maximum number of unique key-chains has been reached.

Recommended Action:

If possible, negate some of the authentication create key-chain commands.

%AUTH-E-KEYEXISTS Key < key_name > exists in chain < key-chain_name >.

Explanation:

This message appears when a new key has been added to a previously created key-chain. The new key is a duplicate of another key.

Recommended Action:

Make sure that the new key is unique.

%AUTH-E-KEYNOTFOUND Key <key_name> not found in chain <key-chain_name>.

Explanation:

This message appears when the software entity responsible for managing the key-chain resources has detected an inconsistency.

Recommended Action:

If this error message appears repeatedly, contact Enterasys Technical Support.

%AUTH-E-KEYOVFL No more free keys max < number > current < number > in chain < key-chain_name >

Explanation:

This message appears when the maximum number of keys that can be attached to a key-chain has been reached.

Recommended Action:

If possible, remove some keys from the key-chain.

%AUTH-E-NUMOFCHAINERR Numof chains mismatch (max < number > cur < number >).

Explanation:

This message appears when the software entity responsible for managing the key-chain resources has detected an inconsistency.

Recommended Action:

If this error message appears repeatedly, contact Enterasys Technical Support.

%AUTH-E-NUMOFKEYERRNumof keys mismatch (max < number > cur < number >) in chain < key-chain_name >.

Explanation:

This message appears when the software entity responsible for managing the key-chain resources has detected an inconsistency.

Recommended Action:

If this error message appears repeatedly, contact Enterasys Technical Support.

Chapter 6

BGP Error Messages

This chapter describes the error messages for the Border Gateway Protocol (BGP) facility.

Informational Messages

%BGP-I-ASPATHIGN Entered AS path specification ignored. All AS paths would be displayed.

Explanation:

AS path specification is not entered correctly. Enter the correct AS path specification.

Recommended Action:

Informational message. No action required.

Warning Messages

%BGP-W-MAXFLAP max-flap metric must be greater than the larger of 1 and suppress-above metric

Explanation:

The *max-flap* metric must be both greater than 1 and greater than the *suppress-above* metric. The default value of *max-flap* metric is 16 and the default value of *suppress-above* metric is 3.

Recommended Action:

No action required.

%BGP-W-REUSEBELOW Reuse-below metric must be less than suppressabove metric

Explanation:

The *reuse-below* metric must be less than the *suppress-above* metric. The default value of the *reuse-below* metric is 2 and the default value of the *suppress-above* metric is 3.

Recommended Action:

No action required.

%BGP-W-UNREACHDECAY Unreach-decay time should be greater than or equal to reach-decay time

Explanation:

The *Unreach-decay* time must be greater than or equal to the *Reach-decay* time. The default value of *Unreach-decay* time is 900 and the default value of *Reach-decay* time is 300.

Recommended Action:

No action required.

Error Messages

%BGP-E-ATTRLISTNOTFOUND Attribute list with id <name> not found

Explanation:

The optional attribute list with the specified name could not be found.

Recommended Action:

Check the name for typo or define the optional attribute list with that name.

%BGP-E-BADBGPVERIGP BGP peers of type IGP must run version 3 or better

Explanation:

BGP peers of type IGP must run version 3 or better.

Recommended Action:

Change the version for the IGP Peer to be version 3 or better.

%BGP-E-BADBGPVERIGPH Internal BGP peer associated with IGP must run at version 3 or better

Explanation:

IGP Peering can only be done with hosts configured for BGP version 3.0 or higher.

Recommended Action:

Run BGP version 3.0 or higher for those peer.

%BGP-E-BADBGPVERRRF Route Reflection Clients must use BGP version 4 or better

Explanation:

Route Reflection only works with peers configured for BGP version 4.

Recommended Action:

Use BGP version 4 for the specified group if need to use route reflection client feature.

%BGP-E-BADCLUSTID Clusterid may not be 0.0.0.0

Explanation:

The Cluster identification cannot be 0.0.0.0.

Recommended Action:

Change the Cluster identification to something other than 0.0.0.0.

%BGP-E-BADEXTBGPRRF Only Internal, IGP or Routing groups may be route reflection clients. *<name>* is an external group.

Explanation:

External groups cannot be route reflection clients.

Recommended Action:

Do not use the route reflection feature on named external group.

%BGP-E-BADEXTSTPRFGR Setpref can only be used with Internal, IGP, or Routing groups not with external group <*name*>

Explanation:

The setpref metric should only be configured for internal, igp or routing group.

Recommended Action:

Remove the *setpref* metric from the external group.

%BGP-E-BADEXTSTPRFHS Setpref can only be used with Internal, IGP or Routing host not with external host *<name>*.

Explanation:

Set-Pref option can only be used for Internal, routing or IGP host.

Recommended Action:

Since the peer-host belongs to the external group remove the Set-Pref Option.

%BGP-E-BADHOLDTIMEGR Holdtime < number > for BGP group < name > is less than the minimum permitted time of < number >

Explanation:

Hold time is less than the minimum permitted.

Recommended Action:

Change the value of the configured holdtime to greater than the minimum permitted.

%BGP-E-BADHOLDTIMEHS Holdtime < number > for BGP peer < name > is less than the minimum permitted time of < number >

Explanation:

Hold time for the named BGP peer is configured less than the minimum allowed.

Recommended Action:

Change the hold-time for the BGP Peer so that it is configured to be higher than the minimum allowed.

%BGP-E-BADHSTSETPREF Set-Pref option for internal peer host should be the same as used in the group declaration

Explanation:

Set-Pref setting for the internal, routing or IGP peer should be the same as that used for the group.

Recommended Action:

Change the Set-Pref setting for the specified group and peer host so that they are equal.

%BGP-E-BADLOCALADDR Local-address option for internal peer host should be the same as used in the group declaration

Explanation:

Local Address setting for the internal, routing or IGP peer should be the same as that used for the group.

Recommended Action:

Change the peer-host and the peer-group local address setting so that they are equal.

%BGP-E-BADMETRICOUT metricout option for internal peer host should be the same as used in the group declaration

Explanation:

Metricout setting for the specified internal, routing or IGP peer host should be the same as that used for the group.

Recommended Action:

Change the peer-host and the peer-group metricout setting so that they are equal.

%BGP-E-BADOUTDELAY Outdelay option for internal peer host should be the same as used in the group declaration

Explanation:

Out delay option for the internal, routing or IGP peer should be the same as that used for the group.

Recommended Action:

Change the peer-host and the peer-group out delay setting so that they are equal.

%BGP-E-BADPROTOVAL Protocol may only be used for internal routing groups

Explanation:

An IGP protocol needs to be specified for routing group only.

Recommended Action:

Do not specify the IGP for the specified group.

%BGP-E-BADSETPREF if SetPref is set on one internal peer group, it must be set on all internal peer groups. SetPref is not configured for <name> group.

Explanation:

If SetPref setting is used for one internal group it should be used for all internal groups.

Recommended Action:

Configure a SetPref metric for the specified group.

%BGP-E-EXTASSAME The peeras < number > for external-type group match AS < number > of router

Explanation:

The peer AS (peer's autonomous system) of the specified external-type group should not match the AS of this router.

Recommended Action:

Change the peer AS of the external-type group so that it does not match the AS of this router.

%BGP-E-EXTLOCASSAME The local as < number > for external group should not match peer AS < number >

Explanation:

The local AS (local autonomous system) of the specified external group should not match the peer AS.

Recommended Action:

Change the peer AS to be different from the local AS of the specified group.

%BGP-E-GROUPIDEXISTS Group with id *<name>* also has type *<name>* and as *<number>*

Explanation:

The specified group already exists.

Recommended Action:

Use some other name while creating a group.

%BGP-E-GROUPNOTFOUND Group with id <*name>* not found

Explanation:

The specified group could not be found.

Recommended Action:

The group name may be typed incorrectly. If not, create a group of that name.

%BGP-E-GROUPOVFL No more free groups max *<number>* current *<number>*

Explanation:

The number of configured groups is more than the one allowed.

Recommended Action:

Contact Enterasys Technical Support and discuss support for more groups.

%BGP-E-HOSTIDEXISTS Host with Id <name> exists in group <name>

Explanation:

Peer-host with the same ip address already exists in the group.

Recommended Action:

Either create a peer-host with a different IP address or use the already created peer-host.

%BGP-E-HSTNOTFNDALLGR Peer host *<name>* not found in any group.

Explanation:

The specified peer host is not found in any peer groups.

The peer-host may be identified incorrectly. Input the correct peer-host.

%BGP-E-INTASNOTSAME The peeras *<number>* for Internal, IGP or Routing group does not match AS *<number>* of router

Explanation:

The peer AS (peer's autonomous system) for the specified internal, IGP, or routing group does not match that of the router.

Recommended Action:

Change the peer AS of the specified internal, IGP, or routing group to this router's AS.

%BGP-E-INVCFG BGP cannot run because of invalid configuration

Explanation:

An invalid BGP configuration was given to the XP. Therefore BGP cannot run.

Recommended Action:

Correct the Errors in the configuration and submit the configuration to the router.

%BGP-E-LOCASNOTSAME The local as <number> for Internal, IGP, or routing group does not match peer AS <number>

Explanation:

The local AS (local autonomous system) number for the internal, IGP, or routing group does not match the peer AS.

Recommended Action:

Change the peer AS to the same value as local AS.

%BGP-E-MAXFLAP max-flap metric must be greater than the larger of 1 and suppress-above metric

Explanation:

The max-flap metric must be larger of 1 and the suppress-above metric.

Recommended Action:

Set the *max-flap* metric to be larger of 1 and the *suppress-above* metric. The default value of the *max-flap* metric is 16 and the default value of the *suppress-above* metric is 3.

%BGP-E-MAXPEERSPGRP No more free hosts max < number > current < number >

Explanation:

No more than the specified number of peer-hosts can be configured.

Recommended Action:

If you need support for more hosts, contact Enterasys Technical Support.

%BGP-E-MAXPEERSPRTR No more free hosts max < number > current < number >

Explanation:

No more than the specified number of peer-hosts can be configured.

Recommended Action:

If you need support for more hosts, contact Enterasys Technical Support.

%BGP-E-NETEXISTS Network < name > exists in group < name >

Explanation:

The specified network number already exists for the group.

Recommended Action:

Remove the specified network number from the configuration.

%BGP-E-NETNOTFOUND Network < name > is not a known network for peer-group < name >

Explanation:

The specified network number is not found in the specified peer-group.

Recommended Action:

Either the network number is associated incorrectly for the peer-group, or the network is not configured for the peer-group. If the network is not configured, then configure the network for the peer-group.

%BGP-E-NETOVFL No more free networks max < number > current < number >

Explanation:

The number of networks configured for the peer-group exceed the maximum allowed.

Recommended Action:

If you need support for more networks, contact Enterasys Technical Support.

%BGP-E-NOASCONFIG No autonomous system is specified

Explanation:

No autonomous system was specified.

Recommended Action:

Specify the autonomous system using the ip-router global set autonomous-system command.

%BGP-E-NOASCNTUSEGR AS-Count can only be used with external group. *<name>* is not an external group.

Explanation:

AS-count setting can only be used with an external group.

Recommended Action:

Remove the AS-count setting for the specified non-external group.

%BGP-E-NOASCNTUSEHS AS-Count can only be used with external host. *<name>* is not a external host.

Explanation:

AS-count option can only be used for external peer-host. The specified peer-host does not belong to group type external.

Recommended Action:

Remove the AS-count Setting.

%BGP-E-NOLEGALGRPS No legal groups configured.

Explanation:

No legal groups (i.e. groups without configuration errors) found, therefore BGP cannot be started.

Configure a group without configuration errors.

%BGP-E-NOLEGALPEERS BGP group *<name>* has no legal peers configured or an allowed networks list for it.

Explanation:

The specified BGP group has neither any legal peer configured for it nor any allowed legal networks. A legal peer or network is one which does not have any configuration error.

Recommended Action:

Configure a peer or an allowed network without any configuration error.

%BGP-E-NONXTHOPUSEGR Next-Hop-Self can only be used with external group. *<name>* is not an external group.

Explanation:

Next-hop-self setting can only be used with an external group.

Recommended Action:

Remove the next-hop-self setting for the specified non-external group.

%BGP-E-NONXTHOPUSEHS Next-Hop-Self can only be used with external host. *<name>* is not a external host.

Explanation:

Next-hop-self option can only be used for external peer-host. The specified peer-host does not belong to group type external.

Recommended Action:

Remove the next-hop-self Setting.

%BGP-E-NORTRIDCFGD No router-id has been configured for the router

Explanation:

No Router-id has been configured for the router.

Recommended Action:

Specify the router-id using ip-router global set router-id command.

%BGP-E-NOSUCHTASK BGP Task does not exist

Explanation:

BGP is not running.

Recommended Action:

BGP can be started by using BGP Start command.

%BGP-E-OBJMISS BGP object to be displayed must be specified

Explanation:

BGP object has not yet been specified.

Recommended Action:

Specify the BGP object.

%BGP-E-PEERIDSAME Peer router-id (*<name>*) is the same as that of the router

Explanation:

The Peer host address is the same as this router's ID.

Recommended Action:

Either change the peer-host address or change this router's ID so that they are different.

%BGP-E-PROTONOTCFG IGP protocol must be specified for internal routing group. No protocol is specified for group *<name>*.

Explanation:

An IGP protocol is not specified for the specified internal routing group.

Recommended Action:

Specify an IGP protocol for the specified internal routing group.

%BGP-E-PROTONOTCFGED Proto option should be specified for group types IGP and Routing

Explanation:

The protocol option is not configured for group types IGP or routing.

Protocol should be configured for group types routing and IGP. Please configure the protocol for the peer-group.

%BGP-E-REUSEBELOW reuse-below metric must be less than suppressabove metric

Explanation:

The reuse-below metric must be less than the suppress-above metric.

Recommended Action:

Set the *reuse-below* metric to be less than the *suppress-above* metric. The default value of the *reuse-below* metric is 2 and the default value of the *suppress-above* metric is 3.

%BGP-E-SAMEGROUP at least as, type rrclient, or localas should be different between groups *<name>* and *<name>*

Explanation:

Either AS or type or rrclient or local AS should be different between two groups.

Recommended Action:

Configure either AS, type, reclient or local AS differently for the specified groups.

%BGP-E-TSKDELETED BGP Task is in deleted state (flags = <hex value>)

Explanation:

BGP Task is in deleted State.

Recommended Action:

Reboot the system. Contact Enterasys Technical Support.

%BGP-E-UNREACHDECAY Unreach-decay time should be greater than or equal to reach-decay time

Explanation:

The *Unreach-decay* time must be greater than or equal to the *Reach-decay* time.

Recommended Action:

Set the *Unreach-decay* time to be greater than or equal to the *Reach-decay* time. The default value of *Unreach-decay* time is 900 and the default value of *Reach-decay* time is 300.

%BGP-E-WRKINPROGRESS: Work In Progress and not completed; Activate tracing by going into Config Mode BGP Commands

Explanation:

Activating BGP tracing from non-config mode is not completed. Activate BGP tracing from config mode.

Recommended Action:

Use the BGP tracing command in config mode.

%BGP-E-ZEROGRPCFGED No groups configured

Explanation:

There are no groups configured for BGP. At least one group and a peer-host should be configured.

Recommended Action:

Configure at least one group for BGP using bgp create peer-group command.

%BGP-E-ZEROPEERS BGP group < name > has neither configured peers or an allowed networks list

Explanation:

The said BGP group has neither any peer configured for it nor any allowed networks.

Recommended Action:

Configure a peer using the **bgp add peer-host** command or an allowed network using the **bgp add network** command.

Chapter 7

Chassis-Related Error Messages

This chapter describes the error messages that relate to the chassis.

Informational Messages

%CTRONCHASSIS-I-FANNORMAL fan operation normal

Explanation:

This message appears on a 6SSRM, when fan operation is normal

Recommended Action:

This message is for the user's benefit. No action is required.

%CTRONCHASSIS-I-PWRINSTALLED power supply # was installed

Explanation:

This message appears on a 6SSRM, when a power supply is turned on or inserted into a chassis.

Recommended Action:

This message is for the user's benefit. No action is required.

%CTRONCHASSIS-I-PWRNORMAL power supply # operation is normal

Explanation:

This message appears on a 6SSRM, when a power supply is turned on or inserted into a chassis and the operation is normal.

Recommended Action:

This message is for the user's benefit. No action is required.

%CTRONCHASSIS-I-PWRREDUNDENT power supply is redundant

Explanation:

This message appears on a 6SSRM, when a power supply is turned or inserted into a chassis, and a second power supply is present.

Recommended Action:

This message is for the user's benefit. No action is required.

Warning Messages

%CTRONCHASSIS-W-FANFAIL fan operation failure

Explanation:

This message appears on a 6SSRM, when the fan operation fails

Recommended Action:

Check Fans

%CTRONCHASSIS-W-PWRFAIL power supply # failure

Explanation:

This message appears on a 6SSRM, when a power supply is turned off or removed from a chassis.

%CTRONCHASSIS-W-PWRNOTREDUNDENT power supply is not redundant

Explanation:

This message appears on a 6SSRM, when a power supply is turned on or inserted into a chassis, and is the only power supply.

Recommended Action:

This message is for the user's benefit. No action is required.

%CTRONCHASSIS-W-PWRREMOVED power supply # was removed

Explanation:

This message appears on a 6SSRM, when a power supply is turned on or inserted into a chassis.

Fatal Messages

%CTRONCHASSIS-F-EVWAIT event wait failed with error '%d'

Explanation:

The specified event failed.

Recommended Action:

Contact Enterasys Technical Support.

%CTRONCHASSIS-F-TMRCREATFAIL timer creation failed with error '%d'

Explanation:

The timer creation failed.

Recommended Action:

Contact Enterasys Technical Support.

%CTRONCHASSIS-F-TMRSTARTFAIL failed to start timer '0x%x', error '%d'

Explanation:

This message appears when an internal error has occurred.

Recommended Action:

Reinstall the system software image. If the problem persists, please call Enterasys Technical Support.

Chapter 8

Native CLI Error Messages

This chapter describes the error messages for the Command Line Interface facility.

Warning Messages

%CLI-W-CHANGES Uncommitted configuration changes exist.

Explanation:

The user is attempting to log off or exit but there are non-committed configuration changes in the scratchpad.

Recommended Action:

If you want to commit those changes, you should abort the log off and commit your changes.

%CLI-W-INMLP port '%s' is part of MLP bundle mp.%d

Explanation:

The user is attempting to refer to an individual port which is part of a multi-port bundle for a command for which this is not allowed.

Recommended Action:

The required action depends of the particular command. Either remove the port from the multi-port bundle, or refer to the multi-port bundle itself in the command.

%CLI-W-INTRUNK port '<portname>' is part of SmartTRUNK '<name>'

Explanation:

This warning message is alerting the user to the fact that the specified port belongs to a SmartTRUNK. Depending on the operation of the command, this may or may not be allowed.

Recommended Action:

Make sure you really want to execute this command on a port that belongs to a SmartTRUNK.

%CLI-W-MODNOTFOUND < Module_name >: module '< number >' does not exist - ignoring

Explanation:

The user is referring to a physical module that is not currently available on the system. This warning message indicates that the command the user specified will not have an effect on the module since the module doesn't exist.

Recommended Action:

Verify physical module exists in XP before attempting to configure the specified module.

%CLI-W-MON_CONSOLE Terminal monitor not necessary for the Console

Explanation:

The user is attempting to turn on terminal monitoring on the console.

Recommended Action:

None. Terminal monitoring is not necessary on the console as this output will appear there by default.

%CLI-W-NOHISTENT non-existent history entry '<command_name>'

Explanation:

The user tried to recall a command that doesn't exist in the command history buffer.

Recommended Action:

Check command and re-enter.

%CLI-W-PORTBAD Port '/ failed self-test - ignoring

Explanation:

During system initialization, this message is displayed if a particular port failed the self-test. The failed port is ignored.

Recommended Action:

Contact Enterasys Technical Support. You may have a bad port on one of your modules.

%CLI-W-PORTNOTFOUND port '/ does not exist - ignoring

Explanation:

The user is referring to a port on a module that is not currently available on the system. This is simply a warning message indicating that the command the user specified will not have an effect on the port since the module doesn't exist.

Recommended Action:

Verify that the port exists in the XP before attempting to configure the specified port.

Error Messages

%CLI-E-ATM_ONLY This command requires an ATM port

Explanation:

The user entered a non-ATM port for a command that requires ATM ports.

Recommended Action:

Re-enter the command with an ATM port.

%CLI-E-BADIFNAME Illegal interface name: "<interface_name>" is a reserved keyword

Explanation:

This error message is displayed when the user attempts to use a reserved keyword as an interface name. The reserved keywords are "default" and "all."

Recommended Action:

Specify a different name for the given interface.

%CLI-E-BADMCASTADDR Multicast address required: '<IP_address>'

Explanation:

The command requires a multicast address as a parameter but the user entered a non-multicast address

Recommended Action:

Specify a multicast address.

%CLI-E-BADNAME Illegal name: '<*Hostname*>', use alphanumeric and dash '-' only

Explanation:

An illegal hostname is specified. The name can have alphanumerics and dashes only.

Recommended Action:

Specify a valid hostname with alphanumerics and dashes only.

%CLI-E-BADNAME2 Illegal name: '<Hostname>', use alphanumeric, h '-' and '_' only

Explanation:

An illegal name is specified. The name can have alphanumerics, dashes and underscores only.

Recommended Action:

Specify a valid name with alphanumerics, dashes and underscores only.

%CLI-E-BADOPTCOMBO options '<option_name>' and '<option_name>' may not be used together

Explanation:

The two options are mutually exclusive and may not be used together.

Recommended Action:

Verify options and re-enter command.

%CLI-E-BADUNIADDR Unicast address required: '<IP_address>'

Explanation:

The command requires an IP unicast address as a parameter but the user entered a non-unicast address, for example, a multicast address.

Recommended Action:

Specify a unicast address.

%CLI-E-CMDUNKNWN unknown or ambiguous command '<command name>'

Explanation:

The user specified a command or reserved word that doesn't exist or is ambiguous.

Recommended Action:

Check to make sure that you typed in the command correctly. If there are multiple commands that match the specific command you typed (ambiguous command), enter additional characters of the command you want to clear the ambiguity.

%CLI-E-COMPUNKNWN unknown or ambiguous facility component '<command_name>'

Explanation:

The user specified a command or reserved word that doesn't exist or is ambiguous.

Recommended Action:

Check to make sure that you typed in the command correctly. If there are multiple commands that match the specific command you typed (ambiguous command), enter additional characters of the command you want to clear the ambiguity.

%CLI-E-FACUNKNWN unknown or ambiguous facility '<command name>'

Explanation:

The user specified a command or reserved word that doesn't exist or is ambiguous.

Recommended Action:

Check to make sure that you typed in the command correctly. If there are multiple commands that match the specific command you typed (ambiguous command), enter additional characters of the command you want to clear the ambiguity.

%CLI-E-FAILED Execution failed for "<command_name>"

Explanation:

An error occurred when the specified command was executed.

Recommended Action:

Another error follows this error message which indicates the actual cause of the error. Examine the subsequent error message and fix the problem accordingly.

%CLI-E-HISTNOMEM error adding to history file - insufficient memory

Explanation:

Insufficient memory for command history file.

Recommended Action:

System resources are limited. Upgrade memory size. If problem persists, contact Enterasys Technical Support.

%CLI-E-HOSTBITS Host portion of IP address not zero: '<IP_address>'

Explanation:

When the specified IP address is ANDed with the specified netmask, the host portion of the address is not 0. The command that you just executed expects the host portion of the address to be 0.

Recommended Action:

Specify an IP address with the network portion of the address that matches the specified netmask. For example, 1.2.3.4/24 is not valid but 1.2.3.0/24 is.

%CLI-E-INCMPCMD incomplete command - aborting

Explanation:

The command is incomplete. It is either missing a parameter value or a required option.

Recommended Action:

Specify a complete command with the missing parameter.

%CLI-E-INCMPQUOTE unterminated quote - missing terminating (")

Explanation:

A string in quotes is missing the terminating quote.

Re-enter the command with the terminating quote.

%CLI-E-IPC_QUEUE error in opening IPC queue for this session

Explanation:

An internal error occurred when initializing the CLI.

Recommended Action:

Contact Enterasys Technical Support.

%CLI-E-IPC_QUEUE_CLOSE error in closing IPC queue for this session

Explanation:

An internal error occurred when shutting down the CLI.

Recommended Action:

Contact Enterasys Technical Support.

%CLI-E-IVADDR invalid memory address '<memory_address>'

Explanation:

An invalid memory address is specified. A memory address must be a non-negative number.

Recommended Action:

Specify a valid memory address.

%CLI-E-IVADDRLIST invalid memory address list '<memory_address>'

Explanation:

One or more addresses in the memory address list is invalid. A memory address must be a non-negative number.

Recommended Action:

Specify a valid memory address.

%CLI-E-IVCHANNEL invalid or unoccupied channel number specified: '<channel_number>'

Explanation:

The user specified a channel that doesn't exist or is not occupied.

Recommended Action:

Specify a channel that is occupied.

%CLI-E-IVCMD invalid command '<command_name>'

Explanation:

An invalid command word is specified.

Recommended Action:

Check to make sure that the command exists and that you didn't type in the wrong command.

%CLI-E-IVCONDITIONAL invalid conditional expression '<expression_type>'

Explanation:

You may have specified an invalid conditional expression. A conditional expression must start with a conditional symbol and be followed by a number. The three acceptable conditional symbols are: > (greater than), < (less than) and != (not equal to). For example, these are valid conditional expressions: >1024 (greater than 1024), <1024 (less than 1024) and !=1024 (not equal to 1024).

Recommended Action:

Specify a valid conditional expression.

%CLI-E-IVFACINST invalid facility instance ''rameter_name>'

Explanation:

An invalid parameter is specified.

Recommended Action:

Check to make sure that the parameter you entered agrees with the parameter type and value this command expects.

%CLI-E-IVFLOAT invalid floating point number '<number>'

Explanation:

An invalid floating point number is specified.

Recommended Action:

Enter a valid floating point number.

%CLI-E-IVHEX invalid hexadecimal value '<hex_value>'

Explanation:

An invalid hexadecimal number is specified. Only 0-9 and A-F are valid digits for a hexadecimal number.

Recommended Action:

Specify a valid hexadecimal number.

%CLI-E-IVIFNAME_IPADDR invalid interface name or IP address '<IP_address/Interface_name>'

Explanation:

An invalid interface name or an invalid IP address is specified. Only alphabets, period (.), dash (-) and underscore (_) are allowed in an interface name. In addition, the strings 'default' and 'all' are reserved and cannot be used.

Recommended Action:

Specify a valid interface name or a valid IP address.

%CLI-E-IVIFNAMES invalid interface name list given:

'<interface_name>'

Explanation:

One or more specified interface names in the interface name list is invalid. Names in the interface name list must be separated by commas (,) without spaces.

Recommended Action:

Specify a valid interface name list.

%CLI-E-IVIPADDR invalid IP address '<IP_address>'

Explanation:

An invalid IP address is specified.

Recommended Action:

Specify an IP address of the form x.x.x.x where x must be between 0-255.

%CLI-E-IVIPADDR_MASK invalid IP address or mask '%s'

Explanation:

You may have specified an IP address and mask pair in which the address and/or mask is invalid. Depending on the command, the mask may be a network mask or filtering mask. The mask can be described using the traditional IP address syntax (255.0.0.0) or a CIDR syntax (/8). For example, the following two parameters are equivalent: 10.1.0.0/255.255.0.0 or 10.1.0.0/16.

Recommended Action:

Specify a valid IP address and mask pair.

%CLI-E-IVIPLIST invalid IP address list '<IP_address>'

Explanation:

An invalid list of IP addresses is specified. If the list has more than one address, then the list must be specified inside quotes. Addresses must be separated by spaces.

Recommended Action:

Specify a valid IP address list.

%CLI-E-IVIPRANGE invalid IP range specified '%s'

Explanation:

An invalid IP range is specified.

Recommended Action:

Specify an IP range in the form x.x.x.x.x.x where x must be between 0-255. Re-enter the command for a non-ATM port.

%CLI-E-IVIPXADDR invalid IPX address '<IPX_address>'

Explanation:

An invalid IPX address is specified. A valid IPX address is a hexadecimal number less than 0xffffffff.

Recommended Action:

Specify a valid IPX address.

%CLI-E-IVIPXADDR_MAC invalid IPX network.node address '<IPX_address'

Explanation:

An invalid IPX network.node address is specified. The network portion of the address must be a valid IPX address. The node portion of the address must be a valid MAC address. The two components of the address are separated by a period (.) without any spaces between them.

Recommended Action:

Specify a valid IPX address.

%CLI-E-IVLIST invalid list '<command_name>'

Explanation:

Invalid CLI list.

Recommended Action:

Verify CLI list and re-enter command.

%CLI-E-IVMACADDR invalid MAC address '<MAC_address>'

Explanation:

Invalid MAC address.

Recommended Action:

Try again with proper MAC address. Format of MAC address is xx:xx:xx:xx:xx or xxxxx:xxxxxx.

%CLI-E-IVMASK Non-contiguous mask not allowed

Explanation:

The mask was non-contiguous and this is not allowed.

Recommended Action:

Retry with a continuous mask.

%CLI-E-IVMODRANGE module range '<module_name>' is illegal

Explanation:

Invalid module range.

Recommended Action:

Verify module range and re-enter a valid module range.

%CLI-E-IVNAME_IPADDR invalid hostname or IP address '<IP_address/Hostname>'

Explanation:

Invalid hostname or IP address.

Recommended Action:

Verify IP address is in correct format xxx.xxx.xxx, or the hostname is valid.

%CLI-E-IVNUMBER invalid numerical value '%s'

Explanation:

Numerical value is not valid.

Recommended Action:

Verify numerical value and re-enter command with valid number.

$\mbox{\ensuremath{\mbox{\sc CLI-E-IVNUMHILIMIT}}}$ numerical value '<number>' is higher than acceptable

Explanation:

Numerical value is larger than acceptable.

Verify numerical value and re-enter command with valid number.

%CLI-E-IVNUMLOLIMIT numerical value '<number>' is lower than acceptable

Explanation:

Numerical value is smaller than acceptable.

Recommended Action:

Verify numerical value and re-enter command with valid number.

%CLI-E-IVNUMRANGE invalid numerical range '<number>' (e.g. 1,3-5,6,13-25)

Explanation:

Numerical range is not valid.

Recommended Action:

Verify numerical value and re-enter command with valid number.

%CLI-E-IVOBJINST invalid object instance '<object_name>'

Explanation:

The object instance of the CLI command is not valid.

Recommended Action:

Verify object instance and re-enter command with the valid object instance.

%CLI-E-IVOPT invalid option or option value '<option_name>'

Explanation:

The option or option value of the CLI command is not valid.

Recommended Action:

Verify option value and re-enter command with valid option instance and valid option value.

%CLI-E-IVOPTVAL invalid option value '<option_name>'

Explanation:

The option value of the CLI command is not valid.

Recommended Action:

Verify option value and re-enter command with valid option value.

%CLI-E-IVPORTLIST invalid port's list '<port_name>'

Explanation:

The port range is not legal.

Recommended Action:

Ensure that you have a valid port range (1-8 for et) (1-2 for gi).

%CLI-E-IVPORTNAME syntax error in port name ''<port_name>'

Explanation:

Port name is invalid.

Recommended Action:

Ensure you have a valid port name (e.g., et.1.2, gi.3.1) and that it is physically present.

%CLI-E-IVPORTRANGE port range ''<port_name>' is illegal

Explanation:

The port range is not legal.

Recommended Action:

Ensure that you have a valid port range (1-8 for et) (1-2 for gi).

%CLI-E-IVPORTYPE unrecognized port type '''''

Explanation:

The port type is invalid.

Recommended Action:

Ensure you have a valid port type (et, gi, etc) and it is physically present.

%CLI-E-IVSAPSRVNAME invalid SAP server name: '<server_name>'

Explanation:

The SAP server name is invalid.

Recommended Action:

Verify SAP server name and re-enter command with valid SAP server name.

%CLI-E-IVURL invalid URL: '<URL_name>'

Explanation:

The URL is invalid.

Recommended Action:

Verify URL and re-enter command with valid URL.

%CLI-E-IVVCRANGE VC range 'number' is illegal

Explanation:

The specified VC range is illegal. Valid VC range is between 16-991.

Recommended Action:

Specify a VC range between 16-991.

%CLI-E-LARGELIST list of < number > elements is too large

Explanation:

The CLI list is too large.

Recommended Action:

Re-enter command with fewer elements.

%CLI-E-LARGENUMRNG numerical list of < number > is too large

Explanation:

The numerical list is too large.

Recommended Action:

Re-enter command with fewer numerical elements.

%CLI-E-LARGEPORTRNG port list of <*number*> ranges is too large

Explanation:

The port list is too large.

Recommended Action:

Re-enter command with fewer port elements.

%CLI-E-MAXLEN "<command_name>" exceeded maximum length of <number> characters

Explanation:

The CLI command is too long.

Recommended Action:

No CLI commands need to be this long. Check to see if your interface names are excessive in length.

%CLI-E-MISSING_VCI Missing VCI specification

Explanation:

The user entered a port with no VCI specification for a command that requires a VCI specification.

Recommended Action:

Re-enter the command with a port that has a VCI Specification.

%CLI-E-MISSING_VPI Missing VPI specification

Explanation:

The user entered a port with no VPI specifications for a command that requires a VPI specification.

Recommended Action:

Re-enter the command with a port that has a VPI Specification.

%CLI-E-MISSOPTION missing one of these required options: <option_name>

Explanation:

One of the required CLI command options is missing.

Re-enter command with appropriate option.

%CLI-E-MISSREQD Missing required parameter '/crameter_name>'

Explanation:

One of the required CLI command parameters is missing.

Recommended Action:

Re-enter command with the appropriate parameter.

%CLI-E-MODRANGEBAD module range '<module_name>', syntax error

Explanation:

The module range is invalid.

Recommended Action:

Re-enter command with a valid module range (e.g., et.1.8)

%CLI-E-MODULEONLY Please enter module specification only (e.g. hs.3)

Explanation:

The command requires the user to enter a WAN module without any port or VC information. For example, to specify HSSI module 3, the user should use **hs.3**.

Recommended Action:

Re-enter command with a WAN module only.

%CLI-E-NAMETOOLONG port name '' is too long

Explanation:

The CLI port name is too long.

Recommended Action:

Re-enter command with a valid port name (e.g., et.1.8).

%CLI-E-NOATM ATM port not allowed for this command

Explanation:

The user specified an ATM port for a command that does not operate on an ATM port.

Recommended Action:

%CLI-E-NOFACINST no facility instance allowed

Explanation:

This CLI facility instance is invalid.

Recommended Action:

Re-enter command with proper syntax.

%CLI-E-NOMEM processing error - insufficient memory

Explanation:

Insufficient memory for operation.

Recommended Action:

System resources are limited. Upgrade memory size. If problem persists, contact Enterasys Technical Support.

%CLI-E-NOMP MLP port not allowed; physical port only

Explanation:

The user specified an MLP port for a command for which this is not allowed.

Recommended Action:

Re-enter the command without the MLP port.

%CLI-E-NOOPTVAL missing required value for option '<value>'

Explanation:

One of the required CLI command options is missing.

Recommended Action:

Re-enter command with the appropriate option.

%CLI-E-NOPHYPORT physical port not allowed; SmartTRUNK port only

Explanation:

The user specified a physical port when the command expects a SmartTRUNK port only.

Recommended Action:

Re-enter command with a SmartTRUNK port.

%CLI-E-NOTRUNK SmartTRUNK port not allowed; physical port only

Explanation:

The user specified a SmartTRUNK when the command expects a physical port only.

Recommended Action:

Re-enter command with a physical port.

%CLI-E-NO_VC VC specification is not allowed

Explanation:

The user specified a VC for the WAN port but the command does not allow a VC to be specified.

Recommended Action:

Re-enter command with a WAN port without a VC

%CLI-E-NOWAN WAN port not allowed for this command

Explanation:

The user specified a WAN port when the command does not operate on a WAN port.

Recommended Action:

Re-enter command with a non-WAN port.

%CLI-E-OBJUNKNWN unknown or ambiguous command object '<command_name>'

Explanation:

The CLI command is invalid.

Re-enter command with proper syntax.

%CLI-E-OPTREQSOPT option '<option_name>' requires ONE of these options: <option_name>

Explanation:

The CLI command requires another option.

Recommended Action:

Re-enter command with the proper option.

%CLI-E-OPTUNKNWN unknown or ambiguous option '<option_name>'

Explanation:

One of the required CLI command options is invalid.

Recommended Action:

Re-enter command with the appropriate option.

%CLI-E-PARSEIVKYWD parser error - invalid keyword '<command name>'

Explanation:

The CLI command has an invalid keyword.

Recommended Action:

Try again with appropriate keyword.

%CLI-E-PARSENOOPT parser error - missing required option '<command_name>'

Explanation:

The CLI command requires another option.

Recommended Action:

Re-enter command with proper options.

%CLI-E-PARSEOPTERR parser error during option processing - aborting

Explanation:

The CLI command could not be parsed.

Recommended Action:

Re-enter command with proper syntax.

%CLI-E-PORTRANGEBAD port range ''/crt_name', syntax error

Explanation:

The CLI port range is invalid.

Recommended Action:

Re-enter command with proper port range (e.g., et.1.(1-8)).

%CLI-E-TOOMANYPORTS Only one port allowed ''''

Explanation:

Too many ports in CLI command.

Recommended Action:

Re-enter command with only one port specified.

%CLI-E-VCRANGEBAD VC range 'number', syntax error

Explanation:

The specified range of VC is wrong or has a syntax error.

Recommended Action:

Specify a correct range for the VC.

%CLI-E-WANONLY This command requires a WAN port

Explanation:

The user specified a non-WAN port when this command expects a WAN port only.

Recommended Action:

Re-enter the command with a WAN port.

Chapter 9

Common CLI Error Messages

This chapter describes the error messages for the Common CLI.

Warning Messages

%COMMON-W-CHANGES Uncommitted configuration changes exist

Explanation:

The user is attempting to log off or exit but there are non-committed configuration changes in the scratchpad.

Recommended Action:

If you want to commit those changes, you should abort the log off and commit your changes.

%COMMON-W-CMDNONREMOVABLE Deletion of non-removable command(s) failed

Explanation:

The user is attempting to remove non-removable commands from the Active Configuration.

The commands cannot be removed from the Active Configuration. No action is necessary.

Error Messages

%COMMON-E-ATM_ONLY This command requires an ATM port

Explanation:

The user has entered a port list that is not a required ATM port list.

Recommended Action:

Replace the port list with an ATM port list.

%COMMON-E-CMDUNKNOWN unknown or ambiguous command '<command name>'

Explanation:

The user specified a command or reserved word that doesn't exist or is ambiguous.

Recommended Action:

Check to make sure that you typed in the command correctly. If there are multiple commands that match the specific command you typed (ambiguous command), enter additional characters of the command you want to clear the ambiguity.

%COMMON-E-CMDUSERMODE command '<command_name>' not allowed in current mode

Explanation:

The user attempted to execute a command not allowed in the Common CLI mode the user is currently in.

Refer to the Common CLI Reference Manual to determine which Common CLI mode the command is allowed to execute in. Access the correct Common CLI mode and re-execute the command.

%COMMON-E-FAILED Execution failed for "<command_name>"

Explanation:

An error occurred when the specified command was executed.

Recommended Action:

Another error follows this error message which indicates the actual cause of the error. Examine the subsequent error message and fix the problem accordingly.

%COMMON-E-FDDI_ONLY This command requires a FDDI port

Explanation:

The user has entered a port list that is not a required FDDI port list.

Recommended Action:

Replace the port list with a FDDI port list.

%COMMON-E-INVALIDHEX '<value>' Not a Hex value

Explanation:

The user entered an incorrect value for the hexadecimal parameter.

Recommended Action:

Re-enter the value in the correct hexadecimal format. Consult the Common CLI Reference Manual for the correct hexadecimal format.

%COMMON-E-INVALIDHEXRANGE value '%s' not in valid Hex Range

Explanation:

The user entered a hexadecimal value that was not within a specified range.

Recommended Action:

Re-enter the value within the correct hexadecimal range. The hexadecimal range can be determined through the Common CLI help facility, or reference the Common CLI Reference Manual.

%COMMON-E-INVALIDIFNAME Invalid interface name: '<value>'

Explanation:

The user has specified an incorrect interface name.

Recommended Action:

Check to make sure the interface with that name exists. Use the command show interfaces to get a complete list of available interfaces.

%COMMON-E-INVALIDINT '<value>' Not an Integer for Parameter ''cparameter_name>'

Explanation:

The value entered by the user for the Parameter was not in an integer format.

Recommended Action:

Re-enter the value for the Parameter in an integer format.

%COMMON-E-INVALIDINTSET Invalid format <value> for Integer Set Parameter_name>

Explanation:

The value entered by the user for the Parameter was in an invalid format for an Integer Set (also known as a numerical range).

Re-enter the Integer Set value in the correct format. Consult the Common CLI Reference Manual for the correct format listed as a numerical range.

%COMMON-E-INVALIDIP Invalid IP address format '<value>'

Explanation:

The user entered an IP address in an invalid format.

Recommended Action:

Re-enter the IP address in the correct format. Consult the Common CLI Reference Manual for the correct IP address formats.

%COMMON-E-INVALIDIPX Invalid IPX address format '<value>': use form 'a1b2c3d4.abcd.efab.cdef'

Explanation:

The user entered an IPX address in the incorrect format.

Recommended Action:

Re-enter the IPX address in the correct format specified in the error message.

%COMMON-E-INVALIDMAC Invalid MAC address format '<value>'

Explanation:

The user entered a MAC address in an invalid format.

Recommended Action:

Re-enter the MAC address in the correct format. Consult the Common CLI Reference Manual for the correct MAC address formats.

%COMMON-E-INVALIDMACHEX Invalid hex-code '<hex_value>' in MAC address '<MAC_address>'

Explanation:

A part of the MAC address the user entered has an invalid hexadecimal value.

Recommended Action:

Re-enter the MAC address with the correct hexadecimal value. Consult the Common CLI Reference Manual for the correct MAC address formats.

%COMMON-E-INVALIDNAMEIP Invalid hostname or IP address format '<value>'

Explanation:

The user entered a hostname or IP address in an invalid format.

Recommended Action:

Re-enter the hostname or IP address in the correct format. Consult the Common CLI Reference Manual for the correct hostname or IP address formats.

%COMMON-E-INVALIDPARAM Invalid param, possible values for Parameter ''rameter_name>' '<value list>'

Explanation:

The user entered an invalid parameter value.

Recommended Action:

Re-enter the command with one of the correct parameter values listed in the error message.

%COMMON-E-INVALIDPORT Invalid port range: '<value>'

Explanation:

The user has entered an invalid range of port numbers.

Re-enter the correct range of port numbers. Consult the Common CLI Reference Manual for the correct format for a range of port numbers.

%COMMON-E-INVALIDPORTLIST Invalid port list: '<value>'

Explanation:

The user has entered the port list in an invalid format, or the specified ports in the list do not exist.

Recommended Action:

Re-enter the port list in the correct format, or check to see if the specified ports are valid. Consult the Common CLI Reference Manual for the correct format for a port list.

%COMMON-E-INVALIDRANGE value '<value>' not in valid Integer Range

Explanation:

The user entered an Integer or numeric value that was not within a specified range.

Recommended Action:

Re-enter the value within the correct numeric range. The numeric range can be determined through the Common CLI help facility, or reference the Common CLI Reference Manual.

%COMMON-E-INVALIDSLOT Invalid slot range: '<value>'

Explanation:

The user has entered an invalid range of slot numbers.

Recommended Action:

Re-enter the correct range of slot numbers. Consult the Common CLI Reference Manual for the correct format for a range of slot numbers.

%COMMON-E-INVALIDSTRING string length not more than <length> for ''rameter_name>'

Explanation:

The user entered a parameter string that exceeded the specified string length.

Recommended Action:

Re-enter the parameter string that is less or equal to the specified string length.

%COMMON-E-INVALIDVC Invalid VC range: '<value>'

Explanation:

The user has entered an invalid range of VC values.

Recommended Action:

Re-enter the correct range of VC values. Consult the Common CLI Reference Manual for the correct format for a range of VC values.

%COMMON-E-INVALIDVPI Invalid VPI range: '<value>'

Explanation:

The user has entered an invalid range of VPI values.

Recommended Action:

Re-enter the correct range of VPI values. Consult the Common CLI Reference Manual for the correct format for a range of VPI values.

%COMMON-E-LOGINFAILED Console login failed

Explanation:

This message appears when the console login failed.

Recommended Action:

Ensure you have the appropriate username and password.

%COMMON-E-MANDATORY Please enter all mandatory commands or parameters

Explanation:

The user executed a command without the entire mandatory commands and/or parameters.

Recommended Action:

Check to make sure all the necessary commands and/or parameters are present for the action you want to execute. Use the Common CLI help facility to determine what commands and/or parameters are mandatory.

%COMMON-E-MISSING_VCI Missing VCI specification

Explanation:

The user entered a port with no VCI specification for a command that requires a VCI specification.

Recommended Action:

Re-enter the command with a port that has a VCI Specification.

%COMMON-E-MISSING_VPI Missing VPI specification

Explanation:

The user entered a port with no VPI specifications for a command that requires a VPI specification.

Recommended Action:

Re-enter the command with a port that has a VPI Specification.

%COMMON-E-MODNOTFOUND <module_type>: module '<module_number>' does not exist

Explanation:

The user is referring to a physical module that is not currently available on the system. This warning message indicates that the command the user specified will not have an effect on the module since the module doesn't exist.

Verify physical module exists before attempting to configure the specified module.

%COMMON-E-MODULE_ONLY Please enter module specification only (e.g. hssi3)

Explanation:

The user has entered a port list instead of the required module name.

Recommended Action:

Replace the port list with the module name (e.g. hssi3).

%COMMON-E-NO_VC VC specification is not allowed

Explanation:

The user specified a VC for the WAN port but the command does not allow a VC to be specified.

Recommended Action:

Re-enter command with a WAN port without a VC.

%COMMON-E-NO_VCI VCI specification is not allowed

Explanation:

The user has entered a VCI specification that is not allowed for this command.

Recommended Action:

Consult the Common CLI Reference Manual to determine what is allowed for the command.

%COMMON-E-NO_VPI VPI specification is not allowed

Explanation:

The user has entered a VPI specification that is not allowed for this command.

Recommended Action:

Consult the Common CLI Reference Manual to determine what is allowed for the command.

%COMMON-E-NOATM ATM port not allowed for this command

Explanation:

The user has entered an ATM port name that is not a valid port name for the command.

Recommended Action:

Use the Common CLI help facility to determine the valid ports for the command, or consult the Common CLI Reference Manual.

%COMMON-E-NODATATYPE Datatype for the parameter '<value>' incorrect

Explanation:

The user has entered a parameter value that is not within the valid list of parameters for the current position within the command.

Recommended Action:

Use the Common CLI help facility to find out which types of parameters are available for the current position within the command.

%COMMON-E-NOMEM processing error - insufficient memory

Explanation:

Insufficient memory for operation.

Recommended Action:

System resources are limited. Upgrade memory size. If problem persists, contact Enterasys Technical Support.

%COMMON-E-NOMP MLP port not allowed; physical port only

Explanation:

The user has entered a multi-link ppp port group name instead of a physical port name. A physical port name is required.

Recommended Action:

Determine which physical ports are specified in the multi-link ppp port group. Use the physical port names when executing the command.

%COMMON-E-NOPHYPORT Physical port not allowed; <smart_trunk_port_name> port only

Explanation:

The user has entered a physical port name instead of a smart trunk port name. A smart trunk port name is required.

Recommended Action:

Determine which smart trunk the physical port belongs to. Use the smart trunk port name when executing the command.

%COMMON-E-NOPOS POS port not allowed for this command

Explanation:

The user has entered a POS port name that is not a valid port name for the command.

Recommended Action:

Use the Common CLI help facility to determine the valid ports for the command, or consult the Common CLI Reference Manual.

%COMMON-E-NOTIMPLEMENTED This command has not been implemented

Explanation:

The command executed is currently not implemented.

Recommended Action:

No action is necessary.

%COMMON-E-NOTRUNK <smart_trunk_port_name> port not allowed; physical port only

Explanation:

The user has entered a smart trunk port name instead of a physical port name. A physical port name is required.

Recommended Action:

Determine which physical ports are specified in the smart trunk. Use the physical port names when executing the command.

%COMMON-E-NOTSUPPORTED This command is not supported

Explanation:

The command executed is not currently supported.

Recommended Action:

No action is necessary.

%COMMON-E-NOWAN WAN port not allowed for this command

Explanation:

The user has entered a WAN port name, which is not a valid port name for the command.

Recommended Action:

Use the Common CLI help facility to determine the valid ports for the command, or consult the Common CLI Reference Manual.

%COMMON-E-PARAMMISSING Missing value for '<parameter>'

Explanation:

The user executed a command without a value for the parameter.

Recommended Action:

Enter a value for the parameter. The value must be in the correct parameter format.

%COMMON-E-PORTBAD Port '<port_name>' not available

Explanation:

The user has entered a port name that does not exist.

Recommended Action:

Re-execute the command with a valid port name.

%COMMON-E-POS_ONLY This command requires a POS port

Explanation:

The user has entered a port list that is not a required POS port list.

Recommended Action:

Replace the port list with a POS port list.

%COMMON-E-SONET_ONLY This command requires a SONET port

Explanation:

The user has entered a port list that is not a required SONET port list.

Recommended Action:

Replace the port list with a SONET port list.

%COMMON-E-TOOMANYPORTS Only one port allowed

Explanation:

Recommended Action:

%COMMON-E-WAN_ONLY This command requires a WAN port

Explanation:

The user has entered a port list that is not a required WAN port list.

Recommended Action:

Replace the port list with a WAN port list.

Chapter 10

Configuration Error Messages

This chapter describes the error messages for the Configuration facility.

Informational Messages

%CONFIG-I-AREERASED ARE Blade '<number>' configuration erased

Explanation:

The configuration for the blade in the specified slot has been erased.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-ERASED Non-committed changes erased

Explanation:

Non-committed changes in the scratchpad are erased.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-ERASED Startup configuration file erased

Explanation:

The Startup configuration file is erased.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-NOCHANGES There are no non-committed changes

Explanation:

The user is attempting to examine the non-committed commands in the scratchpad and there are not any.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-NOCONFIG The running system has no configuration

Explanation:

The user is attempting to examine the active configuration of the system but the system has no configuration.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-SAVED configuration saved to Startup configuration

Explanation:

The active configuration has been saved to the Startup configuration.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-WILDCARD '<number>' command(s) marked for negation

Explanation:

This message indicates that n number of commands are marked for negation.

Recommended Action:

Informational Message. No action necessary.

%CONFIG-I-WRITTEN File copied successfully.

Explanation:

The requested file copy operation completed successfully.

Recommended Action:

Informational Message. No action necessary.

Warning Messages

%CONFIG-W-BACKUP_CFG Cannot find Startup config - using backup on PCMCIA flash

Explanation:

While booting, the system was unable to locate the startup config, and therefore is attempting to boot from a backup on the PCMCIA Flash Module.

Recommended Action:

Create a startup config by doing a save startup with the desired active configuration.

%CONFIG-W-CFG_BLANK Startup config has no useful commands - using backup on PCMCIA flash

Explanation:

While booting, the system found no valid commands in the startup config, and therefore is attempting to boot from a backup on the PCMCIA Flash Module.

Recommended Action:

Create a startup config by doing a save startup with the desired active configuration.

%CONFIG-W-MISMATCHPotentially incompatible versions between the configuration (<number>.<number>) and the system software (<number>.<number>)

Explanation:

The configuration file was created using a version of the system software that is different from the version that is running on the system. The version numbers are displayed in parenthesis.

Recommended Action:

Re-enter configuration using current system software.

%CONFIG-W-NOCOMMITChanges in Scratchpad not committed to the running system

Explanation:

This warning message is displayed when you want to exit Configure mode after making configuration changes but did not commit the changes. The non-committed changes will not have any effect on the running system. They will stay in the Scratchpad until you commit them or erase the scratchpad.

Recommended Action:

Commit the changes if you want them to effect the running system.

%CONFIG-W-NOTSAVEDChanges made to the running system are not saved to Startup.

Explanation:

Changes were made to the configuration of the running system but the changes are not saved in the Startup configuration. If the system is rebooted without saving these changes, the changes will be lost. This message is displayed when you want to exit the current login session or reboot and the active configuration does not match the Startup configuration.

Recommended Action:

Save configuration to startup if you wish the system to startup using the current configuration.

Error Messages

%CONFIG-E-BADMOVE Source and Destination are the same

Explanation:

While using the ACL editor the user attempted to move an existing ACL to its existing position.

Recommended Action:

Verify that the ACL destination was entered correctly.

%CONFIG-E-BADPATH Bad file or pathname specified: %s

Explanation:

When entering the path name of a config file, the user specified a path that dos not exist.

Recommended Action:

Re-enter the command with the correct path.

%CONFIG-E-BADVERSION Bad version string: <version_name>

Explanation:

The configuration file you have contains a bad version string.

Recommended Action:

Check to see if the version string in the configuration file is corrupted. See if you can restore a backup configuration file or try to manually fix the version string.

%CONFIG-E-BINARY Binary data encountered, configuration aborted

Explanation:

The configuration file downloaded from TFTP or RCP server contains binary data. The configuration file should only contain ASCII text characters.

Recommended Action:

Check to make sure you have the correct file or that the file contains only ASCII text characters.

%CONFIG-E-CONFIG_EMPTY There is no configuration information to save

Explanation:

The user is trying to save configuration information to a file but there is nothing to save. The configuration is empty.

Recommended Action:

None.

%CONFIG-E-DUPLICATE Command is already in the active configuration, ignored...

Explanation:

The user is attempting to enter a configuration command that is already in the active configuration. In other words, the same configuration command is entered again.

Recommended Action:

None.

%CONFIG-E-GET_SEMA4 Unable to acquire %s semaphore: %d

Explanation:

An internal error occurred when trying to access one of the configuration databases.

Recommended Action:

Contact Enterasys Technical Support.

%CONFIG-E-INVLDMOVE Invalid Source and or Destination

Explanation:

Source and or destination of comment line specified is invalid.

Recommended Action:

Verify that both source and destination were entered correctly.

%CONFIG-E-NEED_COMMAND Need at least one command word to match

Explanation:

The user is attempting to do a wildcard negate operation using *no* <*string*> * but the specified wildcard string does not match any existing command.

Recommended Action:

Verify you have entered the wildcard string correctly.

%CONFIG-E-NOMATCH No matching command found

Explanation:

The user is attempting to negate a command (using "no...") but the specified command doesn't exist.

Recommended Action:

Verify you have entered the command to be negated correctly. You can also use the *negate* command together with a command number.

%CONFIG-E-NONEGATE Cannot negate the command and change options at the same time; negation ignored...

Explanation:

The user tried to make active a set of scratchpad changes that included both a negation and option changes for the same command.

Recommended Action:

Only the change of options will take effect. Re-enter the negation command.

%CONFIG-E-NOSUBSTITUTE Cannot change options and negate the command at the same time; new command ignored...

Explanation:

The user tried to make active a set of scratchpad changes that included both a negation and option changes for the same command.

Recommended Action:

Only the negation will take effect. Re-enter the command with the new option.

%CONFIG-E-NOSUCHFILE Unable to find configuration file: %s

Explanation:

When entering the name of a config file, the user specified a file that does not exist.

Recommended Action:

Re-enter the command with the correct file name.

%CONFIG-E-NOTFOUND Command number '<number>' not found

Explanation:

The user is attempting to negate a command that does not exist.

Recommended Action:

Check to make sure the command number you specified is correct.

%CONFIG-E-PORTS_OVERLAP Port list in 'vlan add ports vlan_name>' is overlapped with port list in 'vlan add ports cylan_name>'

Explanation:

When you save a command in transit config into active config, the XP compares the command with the commands in active config to see if there is any port overlap between the port lists. If any commands of the same type have overlapping port lists, the XP will not allow you to save the command into active config.

For example:

```
xp(config)# sh
Running system configuration:
!
! Last modified from Console on 2000-11-30 09:46:28
!
1 : vlan create vlan1 port-based id 10
2 : vlan add ports et.7.5 to vlan1
xp(config)# vlan add ports et.7.* to vlan1
xp(config)# save ac
%CONFIG-E-PORTS_OVERLAP, Port list in 'vlan add ports et.7.* to vlan1'
is overlapped with port list in 'vlan add ports et.7.5 to vlan1'
```

Recommended Action:

Modify the new command to remove the overlap or remove the existing command before you save the new one.

%CONFIG-E-REL_SEMA4 Unable to release %s semaphore: %d

Explanation:

An internal error occurred when trying to access one of the configuration databases.

Recommended Action:

Contact Enterasys Technical Support.

%CONFIG-E-SEARCH Search string '<string>' not found

Explanation:

The user is searching the active configuration for all commands with the specified search string. This message indicates that the search string does not appear in any of the commands in the active configuration.

Recommended Action:

Check to make sure that you entered the search string correctly.

%CONFIG-E-TOOLONG Command is too long, ignored...

Explanation:

A command in the configuration file exceeds the maximum length of 256 characters. As a result, the command is ignored.

Recommended Action:

It is unlikely that a valid command can contain more than 256 characters. Check to make sure the command you entered is correct.

Fatal Error Messages

%CONFIG-F-CREATE_SEMA4 Unable to create %s semaphore: %d

Explanation:

An internal error occurred when trying to create one of the configuration databases.

Recommended Action:

Chapter 11

Console Error Messages

This chapter describes the error messages for the Console facility.

Warning Messages

%CONS-W-AUTH_DENIED '<name>' server (<ipaddr>) access denied

Explanation:

This message appears when the authentication server denies you login access. This could be because you entered the wrong password or your username is not recognized.

Recommended Action:

Retry with proper password.

%CONS-W-AUTH_NONE '<name>' server fallback: (none)

Explanation:

This message appears when the authentication server denies you login access and there is no fallback behavior configured.

Recommended Action:

Retry with proper password or configure a fallback behavior using the **last-resort** option.

%CONS-W-AUTH_PASSWD '<name>' server fallback: (password)

Explanation:

This message appears when the authentication server denies you login access but the fallback behavior is to verify your login access using the Enabled mode password.

Recommended Action:

Retry with proper password or do nothing.

%CONS-W-AUTH_SUCCEED '<name>' server fallback: (succeed)

Explanation:

This message appears when the authentication server denies you login access but the fallback behavior is to log you in regardless.

Recommended Action:

Retry with proper password or do nothing.

%CONS-W-BADPASSWD incorrect password

Explanation:

This message appears when you type in an incorrect password.

Recommended Action:

Retry with proper password.

Error Messages

%CONS-E-IOCTL ioctl failed with status < number >

Explanation:

This message appears when the IOCTL resource failed.

Recommended Action:

System resources are limited. Upgrade with more memory. If problem persists, contact Enterasys Technical Support.

%CONS-E-LOGINFAIL console login failed

Explanation:

This message appears when the console login failed.

Recommended Action:

Ensure you have the appropriate username and password.

%CONS-E-NOMEM processing error - insufficient memory

Explanation:

This message appears when network load exceeds system capacity.

Recommended Action:

System resources are limited. Upgrade with more memory. If problem persists, contact Enterasys Technical Support.

%CONS-E-PWD2LONG password is longer than < number > characters

Explanation:

This message appears when password length is too long.

Recommended Action:

Enter a shorter password.

Chapter 12

DDT Error Messages

This chapter describes the error messages for the DDT facility.

Error Messages

%DDT-E-SUNI_CSR_TEST: Mod-Phy SUNI CSR Test: FAILED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-SUNI_CSR_TEST: Mod-Phy SUNI CSR Test: PASSED

Explanation:

Internal error.

Recommended Action:

%DDT-E-TSHP_CSR_TEST: ToolShop CSR Test: FAILED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_CSR_TEST: ToolShop CSR Test: PASSED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_END_TEST: ToolShop En-Decap Memory Test: FAILED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_END_TEST: ToolShop En-Decap Memory Test: PASSED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_SAR_TEST: ToolShop SAR Buff Memory Test: FAILED

Explanation:

Internal error.

Recommended Action:

%DDT-E-TSHP_SAR_TEST: ToolShop SAR Buff Memory Test: PASSED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_TEST: ToolShop Test: PASSED

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%DDT-E-TSHP_TEST: ToolShop Test: FAILED

Explanation:

Internal error.

Recommended Action:

Chapter 13

DHCP Error Messages

This chapter describes the error messages for the Dynamic Host Configuration Protocol (DHCP) server.

Informational Messages

%DHCPD-I-DBEMPTY The DHCP lease database is empty

Explanation:

There is no data in the lease database, as there are currently no address assignments.

Recommended Action:

Informational message. No action necessary.

%DHCPD-I-DBFLUSHED DHCP lease database synchronized

Explanation:

The DHCP server has updated its lease database.

Recommended Action:

Informational message. No action necessary.

%DHCPD-I-NOACTIVE There are no active leases

Explanation:

There are no currently active leases.

Recommended Action:

Informational message. No action necessary.

%DHCPD-I-NOBINDING No binding found for the specified IP address

Explanation:

No lease exists for the specified IP address.

Recommended Action:

Informational message. No action necessary.

%DHCPD-I-NOEXPIRED There are no expired leases

Explanation:

There are no expired leases.

Recommended Action:

Informational message. No action necessary.

%DHCPD-I-NOSTATIC There are no static IP leases configured

Explanation:

There are no leases with static IP address assignments.

Recommended Action:

Informational message. No action necessary.

Chapter 14

DVMRP Error Messages

This chapter describes the error messages for the Distance Vector Multicast Routing Protocol facility.

Informational Messages

%DVMRP-I-STARTED DVMRP service started

Explanation:

This message is displayed when DVMRP is started.

Recommended Action:

Informational Message. No action necessary.

%DVMRP-I-TERMINATED DVMRP service terminated

Explanation:

This message is displayed when DVMRP is stopped.

Recommended Action:

Informational Message. No action necessary.

Warning Messages

%DVMRP-W-NOTRUNNING DVMRP service is currently not running

Explanation:

This message is displayed when the DVMRP service is already stopped and a command is given to stop DVMRP.

Recommended Action:

Verify DVMRP service.

%DVMRP-W-STARTED_ALRDY DVMRP service started already

Explanation:

This message is displayed when the DVMRP service is already started and a command is given to start DVMRP.

Recommended Action:

Verify DVMRP service.

Error Messages

%DVMRP-E-BADADDR <IP_address>: bad address

Explanation:

This message is displayed when the IP-address entered is not valid, e.g. a loopback interface address.

Recommended Action:

Verify IP-address and re-enter command.

%DVMRP-E-BADADDRMASK address/mask %s does not map to 239.0.0.0/8 range

Explanation:

This message is displayed when the scope for the DVMRP service on an interface is outside the 239.0.0.0/8 range.

Recommended Action:

Only use the locally administrative range, for example 239.0.0.0/8, as the scope for DVMRP service on an interface.

%DVMRP-E-DUPIFADDR < IP_address >: duplicate address

Explanation:

This message is displayed when the IP-address entered is already in use.

Recommended Action:

Verify IP-address.

%DVMRP-E-DUPNAME: interface < name > already exists

Explanation:

This message is displayed when the interface name entered is already in use.

Recommended Action:

Verify interface name.

%DVMRP-E-DUPTNL Tunnel < tunnel-name > is already defined

Explanation:

This message is displayed when the tunnel <tunnel-name> already has been defined between specified local and remote addresses.

Recommended Action:

Verify DVMRP tunnel name.

%DVMRP-E-IFNOTFOUND *<interface_name*>: no such interface address.

Explanation:

This message is displayed when the specified interface or IP-address does not exist.

Recommended Action:

Verify interface and IP-address.

%DVMRP-E-L2_ENABLED L2 IGMP Snooping enabled on vlan %s

Explanation:

This message is displayed when an attempt is made to enable layer 3 Multicasting on a VLAN that has Layer 2 IGMP snooping already enabled on it.

Recommended Action:

Both Layer 3 Multicasting and Layer 2 IGMP snooping cannot e enabled on the same VLAN. Remove Layer 2 IGMP snooping before enabling Layer 3 Multicasting.

%DVMRP-E-MEMORY not enough memory

Explanation:

This message is displayed when the DVMRP service runs out of memory.

Recommended Action:

If possible, remove some DVMRP service. Otherwise, contact Enterasys Technical Support.

%DVMRP-E-RECVFROM recvfrom() failed with errno < number>

Explanation:

This message is displayed when the DVMRP service is not able to receive data.

Recommended Action:

Contact Enterasys Technical Support.

%DVMRP-E-SYSTEM system error

Explanation:

This message is displayed when an internal error has occurred in the DVMRP service.

Recommended Action:

Contact Enterasys Technical Support.

%DVMRP-E-TOOMANYVIF too many interfaces defined

Explanation:

This message is displayed when greater than 64 multicast interfaces have been defined.

Recommended Action:

Remove multicast interfaces until a maximum of 64 remain.

Fatal Errors

%DVMRP-F-IOCTL ioctl(<string>) failed, errno = <number>

Explanation:

This message is displayed when an internal error has occurred in the DVMRP service.

Recommended Action:

Contact Enterasys Technical Support.

%DVMRP-F-SEMAPHORE Could not get semaphore at startup

Explanation:

This message is displayed if DVMRP is unable to acquire a system semaphore.

Recommended Action:

Chapter 15

ERR Error Messages

This chapter describes error messages you may encounter that were designed for internal use only.

Informational Messages

%ERR-I-UNMAPDERR, unmapped system error number 'x' (Caller=0x81657890)

Explanation:

An informational event occurred but an information definition is not available.

Recommended Action:

Contact Enterasys Technical support.

%ERR-I-UNKNWNERR, unknown error number 'x' (Caller=0x81657890)

Explanation:

An informational event occurred but the error number exceeded the range limit.

Recommended Action:

Warning Messages

%ERR-W-UNMAPDERR, unmapped system error number 'x' (Caller=0x81657890)

Explanation:

A warning occurred but no warning definition exists.

Recommended Action:

Contact Enterasys Technical support.

%ERR-W-UNKNWNERR, unknown error number 'x' (Caller=0x81657890)

Explanation:

A warning occurred but the error number exceeded the range limit.

Recommended Action:

Contact Enterasys Technical support.

Error Messages

%ERR-E-UNMAPDERR, unmapped system error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but no error definition was available.

Recommended Action:

Contact Enterasys Technical support.

%ERR-E-UNKNWNERR, unknown error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but the error number exceeded the range limit.

Recommended Action:

Contact Enterasys Technical support.

%ERR-E-FACADDFAIL, failed to add facility 'XX'

Explanation:

The facility is not registered with the system.

Recommended Action:

Contact Enterasys Technical support.

%ERR-E-IVARGCNT, invalid argument count for error '%%XXX-X-XXX'

Explanation:

The arguments necessary to print the error definition are not available.

Recommended Action:

Contact Enterasys Technical support.

Fatal Messages

%ERR-F-UNMAPDERR, unmapped system error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but no error definition exists.

Recommended Action:

Contact Enterasys Technical support.

%ERR-F-UNKNWNERR, unknown error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but the error number exceeded the range limit.

Recommended Action:

%ERR-F-IVARGCNT, invalid argument count for error '%%XXX-X-XXX'

Explanation:

The the arguments necessary to print this error were not available.

Recommended Action:

Contact Enterasys Technical support.

Unknown Messages

%ERR-U-UNMAPDERR, unmapped system error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but no error definition exists.

Recommended Action:

Contact Enterasys Technical support.

%ERR-U-UNKNWNERR, unknown error number 'x' (Caller=0x81657890)

Explanation:

An error occurred but the error number exceeded the range limit.

Recommended Action:

Chapter 16

FDDI Error Messages

This chapter describes the error messages for the Fiber Distributed Data Interface (FDDI) facility.

Informational Messages

%FDDI-I-FW_DATE Module < mod_id> Firmware date < date>

Explanation:

This informational message displays information about the firmware on the on-board FDDI module processor. It is displayed each time the module is initialized.

Recommended Action:

None.

%FDDI-I-FW_DESC Module < mod_id > Firmware description '<string >'

Explanation:

This informational message displays information about the firmware on the on-board FDDI module processor. It is displayed each time the module is initialized.

Recommended Action:

None.

%FDDI-I-FW_HOST Module < mod_id > Firmware build host < hostname >

Explanation:

This informational message displays information about the firmware on the on-board FDDI module processor. It is displayed each time the module is initialized.

Recommended Action:

None.

%FDDI-I-FW_USER Module < mod_id > Firmware build user < username >

Explanation:

This informational message displays information about the firmware on the on-board FDDI module processor. It is displayed each time the module is initialized.

Recommended Action:

None.

%FDDI-I-MODULE_MSG Module < mod_id > Firmware version < string >

Explanation:

This informational message displays the version for the firmware that executes on the on-board processor of the FDDI module. It will be displayed each time the module is initialized. This version is not the version of the firmware that executes on the XP.

Recommended Action:

None.

Warning Messages

%FDDI-W-AUTO_FLASH Module <mod_id> automatic flash update from <string> to <string>

Explanation:

The on-board FDDI module processor gets its firmware from a flash. The firmware for this flash will be automatically updated if the main firmware image requires a different version.

Recommended Action:

None.

%FDDI-W-AUTO_YORK_PROGRAM Module <mod_id> automatic Yorktown FPGA update from <string> to <string>

Explanation:

This message is displayed when the FPGA that converts FDDI frames to Ethernet frames is being loaded with a new program.

Recommended Action:

None

%FDDI-W-REINIT_MODULE Module < value > is being re-initialized

Explanation:

This warning message indicates that the FDDI module is being reinitialized. This message appears in conjunction with another message indicating an error condition that has reset the module.

Recommended Action:

Examine the error message previous to this message for the root cause of the reset.

Error Messages

%FDDI-E-BAD_FLASH_MAGIC Module < mod_id> Invalid flash magic number '< number>'

Explanation:

This error indicates that the firmware used by on-board FDDI processor does not have the correct signature.

Recommended Action:

This error can be resolved by loading new valid firmware.

%FDDI-E-BAD_FLASH_SUM Module < mod_id > Invalid flash checksum

Explanation:

This error indicates that the firmware used by on-board FDDI processor does not have the correct checksum.

Recommended Action:

This error can be resolved by loading new valid firmware.

%FDDI-E-FDDI_MODE SAS stations are not allowed to be in DAS/SAC mode

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-FLASH_CORRUPTED Module < < mod_id>> flash, < string> is corrupted

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_CRC Module < <mod_id>> flash, <string> has bad CRC

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_ERASE Module < <mod_id>> flash erase error

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_NOT_SREC Module < mod_id > flash, < string > is not an SREC file

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_PROGRAM Module < < mod_id>> flash programming error

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_SREC_LOAD Module < <mod_id>> flash, problem opening <string>

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-FLASH_VERIFY Module < <mod_id>> flash verify error

Explanation:

This error message occurs when the flash is being updated.

Recommended Action:

Repeat flash update.

%FDDI-E-HEARTBEAT_LOST Module < mod_id > lost heartbeat, fault = <value>

Explanation:

This error message indicates that the XP processor has not received a heartbeat "I am alive" message from the on-board FDDI processor.

Recommended Action:

This is a recoverable error that will cause the module to be reinitialized.

%FDDI-E-INIT_HUGHES Module < mod_id> - Hughes FPGA not programmed

Explanation:

This error message indicates that the FPGA that controls the FDDI module is not programmed, indicating a manufacturing error on the module.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-INIT_MODULE Module < mod_id > not initialized

Explanation:

This error message indicates that a particular FDDI module has not initialized properly. It will appear in conjunction with another message indicating the specific error that has occurred. Other functional FDDI modules will remain operational.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-INIT_SYSTEM Initialization failed, all FDDI modules unusable

Explanation:

This error message indicates that the entire FDDI subsystem could not be initialized and that all FDDI modules will not be operational. This error is caused by a lack of system resources.

Recommended Action:

%FDDI-E-INIT_TASK Task creation in '<string>' status <status_id>

Explanation:

This error indicates a task creation failure caused by a lack of system-level resources.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-INIT_TIMER Timer creation in '<string>' status <status_id>

Explanation:

This error indicates a timer creation failure caused by a lack of system-level resources.

%FDDI-E-INIT_YORK Module < mod_id> - Yorktown FPGA not programmed

Explanation:

This error message indicates that the FPGA that controls the translation of FDDI frames to Ethernet frames is not programmed, indicating a manufacturing error on the module.

Recommended Action:

Replace the module.

%FDDI-E-IPC_SEQUENCE IPC sequence on module <mod_id>, expected <value>, received <value>

Explanation:

This error message indicates that inter-processor communication (IPC) between the XP processor and the on-board FDDI processor has detected an inconsistency.

Recommended Action:

This is a recoverable error that will cause the module to be reinitialized. Monitor module reinitialization.

%FDDI-E-MAC_MA_UNIT_ENAB Set to ma unit data enable failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-MAC_T_REQ Set to treq failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-NO_REPLY Module <mod_id> did not reply to initialization, checkpoint = <value>, fault = <value>

Explanation:

This error message indicates that the XP requested the on-board FDDI processor to perform its system initialization but the processor did not complete its initialization. The checkpoint and fault values will indicate the partial completion or the detected error code for the on-board FDDI processor.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-PATH_MAX_T_REQ Set to max treq failed for port port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-PATH_T_MAX_LB Set to t max lower bound failed for port port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-PATH_TVX_LB Set to tvx lower bound failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-PORT_LER_ALARM Set to ler alarm failed for port port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-PORT_LER_CUTOFF Set to ler cutoff failed for port port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-POST_FAIL Module < mod_id > failed POST status = < status_id >

Explanation:

This error message indicates that the "power on self test" (POST) has detected an internal hardware failure on the FDDI module.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-SMT_CONN_POL Set to connection policy failed for port <port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-SMT_STAT_RPT_POL Set to status reporting policy failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-SMT_T_NOTIFY Set to tnotify failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-SMT_TRACE_MAX_EXP Set to trace max expiration failed for port cport_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-SMT_USER_DATA Set to userdata failed for port <port_id>

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-TRANS_APPLETALK_ARP Appletalk ARP frames can only be translated to 802.3 Snap or Ethernet II frames

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-TRANS_IPX IPX Snap frames can only be translated to Ethernet II or 802.3 Raw IPX frames

Explanation:

This error message is generated in response to user configuration errors.

Recommended Action:

Correct configuration error as indicated.

%FDDI-E-YORK_FILE Module <mod_id> Yorktown FPGA, problem opening <string>

Explanation:

This error message indicates that an attempt to update the FPGA that controls the translation of FDDI to Ethernet frames has failed due to a failed file operation.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-E-YORK_PROGRAM Unable to update module <mod_id>Yorktown FPGA from <string> to <string>

Explanation:

This error message indicates that an attempt to update the FPGA that controls the translation of FDDI to Ethernet frames has failed due to a programming error on the FPGA.

Recommended Action:

Fatal Messages

%FDDI-F-IPC_ADDR_ALIGN IPC address out of alignment <value>

Explanation:

This error indicates that the XP processor has made an invalid request to the on-board FDDI processor. This indicates an internal inconsistency within the XP firmware and will cause the entire XP to reboot.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI_F-IPC_ADDR_RANGE IPC address out of range <value>

Explanation:

This error indicates that the XP processor has made an invalid request to the on-board FDDI processor. This indicates an internal inconsistency within the XP firmware and will cause the entire XP to reboot.

Recommended Action:

Contact Enterasys Technical Support.

%FDDI-F-IPC_ARG IPC <string> bad arg <value> = <value>

Explanation:

This error indicates that the XP processor has made an invalid request to the on-board FDDI processor. This indicates an internal inconsistency within the XP firmware and will cause the entire XP to reboot.

Recommended Action:

Chapter 17

10Base-T Ethernet Driver Error Messages

This chapter describes the error messages for the 10Base-T Ethernet Driver facility.

Informational Messages

%ETH-I-MACADDR < name>: ethernet address < mac address>

Explanation:

This message is displayed when the interface is being used on the indicated mac address.

Recommended Action:

None.

%ETH-I-STARTINTF %s %d: interface started

Explanation:

This message is displayed when the interface has been started.

Recommended Action:

None.

%ETH-I- STOPINTF %s%d: interface stopped

Explanation:

This message is displayed when the interface has been stopped.

Recommended Action:

None.

Warning Messages

%ETH-W-BADTRLOFF %s%d: bad trailer offset %d>=ETHERMTU

Explanation:

Received packet with illegal header. Bad trailer encapsulation offset.

Recommended Action:

Utilize traffic diagnostic tools in order to locate the offending sender.

%ETH-W-BADTRLOFF1 %s%d: bad trailer, toff=%d tlen=%d plen=%d

Explanation:

Received packet with illegal header. Bad trailer encapsulation header information.

Recommended Action:

Utilize traffic diagnostic tools in order to locate the offending sender.

%ETH-W-BIGFRAME < name > < number >: bad received packet length, < number > bytes

Explanation:

Packet received off the network was larger than legal ethernet size.

Recommended Action:

Use packet sniffing tool to determine which host is sending illegal frames.

%ETH-W-QSENDFULL queue is full, sts=%d

Explanation:

Received full queue message when trying to send buffer to diagnostics en0 queue during dec21143 diagnostics interrupt service routine.

Recommended Action:

Diagnose the amount of traffic utilizing the en0 port of the control module.

Error Messages

%ETH-E-DIAGFAIL 10Base-T port failed internal diagnostics

Explanation:

10Base-T port on Control Module failed diagnostics or initialization.

Recommended Action:

Replace the Control Module.

%ETH-E-DIAGQ Couldn't create DIAGNOSTIC Queue, sts=0x%x, qptr=0x%x

Explanation:

Couldn't create a queue for the diagnostics of the en0 port during startup.

Recommended Action:

Contact Enterasys Technical Support.

%ETH-E-NOTFDS insufficient transmit buffers

Explanation:

Insufficient transmit buffers in 10Base-T port.

Recommended Action:

This is mostly a transient error message and has no detrimental effect on the system. However, if the condition persists, contact Enterasys Technical Support.

Fatal Errors

%ETH-F-HISRFAIL failed to create driver HISR, sts=<number>

Explanation:

This is an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ETH-F-INITFAIL 10Base-T ethernet failed initialization

Explanation:

10Base-T port on Control Module failed diagnostics or initialization.

Recommended Action:

Replace the Control Module.

%ETH-F-LISRFAIL failed to register driver LISR, sts=<number>

Explanation:

This is an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%ETH-F-NOSTKMEM not enough memory to allocate stack

Explanation:

System is running low on DRAM.

Recommended Action:

Upgrade the amount of DRAM DIMM memory to the next highest recommended amount.

%ETH-F-QSENDFAIL failed to send on queue, sts=%d

Explanation:

Failed to send buffer to diagnostics en0 queue during dec21143 diagnostics interrupt service routine.

Recommended Action:

Contact Enterasys Technical Support.

$\%ETH\text{-}F\text{-}TOOMANYINTFS\ \%d$ is too many interfaces to configure (max. %d)

Explanation:

Too many ethernet units are attached. Cannot initialize ethernet during startup.

Recommended Action:

Chapter 18

GARP Error Messages

This chapter describes the error messages for the GARP facility.

Informational Messages

%GARP-I-APPSTCHNG Applicant state change: Port rort>, Attr Type:<number>, Attr Value: <number>, Event: <event>, Old State: <old_state>,New State: <new state>

Explanation:

This message appears when GARP State Machines debugging has been turned on and there is an applicant state change.

Recommended Action:

Informational message. No action necessary.

%GARP-I-REGSTCHNG Registrar state change: Port rort><, Attr Type:</pre>
<number><, Attr Value: <number><, Event: <event><, Old State: <old_state>
New State: <new state>

Explanation:

This message appears when GARP State Machines debugging has been turned on and there is a registrar state change.

Recommended Action:

Informational message. No action necessary.

%GARP-I-TIMER_SET GARP timers set. Leaveall = <leaveall_timer>, Join = <join_timer> for <port_list>.

Explanation:

This message appears when the timers for GARP are set.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%GARP-W-NOSTDEBUG Can not debug State Machines if Join Timer is less than <number>

Explanation:

This error message appears when turning on GARP State Machines debugging and the join timer is less than number specified.

Recommended Action:

Change the join timer to the value specified.

Error Messages

%GARP-E-BAD_TIMERS Wrong GARP timer values. Timers should satisfy the following relationship: Leave >= Join * 3 and LeaveAll > Leave

Explanation:

This error message appears when the timer values specified are invalid.

Recommended Action:

Make sure the timer values satisfy the following relationship: Leave >= Join * 3 and LeaveAll > Leave.

%GARP-E-NOMEM No memory to send GARP PDU

Explanation:

This error message appears when the XP has run out of free memory.

Recommended Action:

Add more memory to the XP Control Module.

%GARP-E-XMTQFULL Cannot send GARP PDU, transmit queue is full

Explanation:

This error message appears when GARP cannot send out a PDU because the transmit queue is full.

Recommended Action:

Reduce traffic to free up the transmit queue.

Chapter 19

GateD Global Error Messages

This chapter describes the error messages for the GateD Parent facility.

Informational Messages

%GATED-I-NOROUTE No route to destination

Explanation:

The XP Routing Information Base does not have any route to the specified prefix.

Recommended Action:

Reenter the command with a different prefix.

%GATED-I-RECONFIGDONE Reinitializing (pid 0x<hex_number>) done at <number>

Explanation:

This message displays the process ID and the time at which the XP routing process was reinitialized to handle any new configuration.

Recommended Action:

This message is for the user's benefit. No action is required.

%GATED-I-START Started (pid 0x<hex_number>) on <name>

Explanation:

This message displays the process ID and the time at which the XP routing process was initiated.

Recommended Action:

This message is for the user's benefit. No action is required.

Warning Messages

%GATED-W-BADLOGIN GII login failed from %s

Explanation:

Examine some of the tables maintained by the routing process using the GII utility. The XP Routing Process prints this message on the console when a user from a specific machine enters the GII password incorrectly three times.

Recommended Action:

In this case, ensure that no one is trying to access the router without proper authorization. If there is any possibility of someone trying to access the router in an unauthorized fashion, then the router-manager is advised to change the enabled password of the router.

Error Messages

%GATED-E-ABORT Aborted (pid 0x<hex_number>) at <number>

Explanation:

This error message displays the specified process ID and the time at which this routing process was aborted.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-ADVALLOCFAIL Memory allocation failed for a contributing route

Explanation:

This error message is displayed when the XP routing process cannot allocate memory for a route contributing to an aggregate.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-ADVALLOCLIST Memory allocation failed for a contributing list

Explanation:

This error message is displayed when the XP routing process cannot allocate memory for a contributing list.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-ADVNULL4IMGAGGR Policy element null for implicit aggregate route

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-ASSERTFAIL Assertion failed pid[0x<hex_number>], file <name>, line <number>: <error>

Explanation:

This error message is displayed when an internal check fails in the XP's routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CFGOPENFAIL GateD cannot open the configuration file.

Explanation:

This error message is displayed when the XP routing process is unable to open its configuration file.

Recommended Action:

%GATED-E-CFGPARSEERR GateD configuration file had parse errors.

Explanation:

This error message is displayed when the XP routing process encounters errors/corruption in its configuration file.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CLIMALLOCFAIL CLI malloc failed.

Explanation:

This error message is displayed when the XP experiences a memory allocation failure in one of its routing process display commands.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CLNTCONFAIL Cannot connect to console server (client <cli>client_id> error = <number>)

Explanation:

This error message is displayed when the XP experiences a connection failure in one of its routing process display commands.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CLNTOPENFAIL Cannot open GateD console-client socket (error = <number>)

Explanation:

This error message is displayed when the XP experiences a failure trying to open a socket in one of its routing process display commands.

Recommended Action:

%GATED-E-CONSACCEPTFAIL Cannot accept GateD console socket <number> (error = <number>)

Explanation:

This error message is displayed when the XP experiences a "socket accept" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CONSBINDFAIL Cannot bind GateD console socket <number> (error = <number>)

Explanation:

This error message is displayed when the XP experiences a "socket bind" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CONSFDOPENFAIL Fdopen failed for console connection <*number>*

Explanation:

This error message is displayed when the XP fails to open a file mapped to the specified socket during its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CONSOPENFAIL Cannot open GateD console socket (error = <number>)

Explanation:

This error message is displayed when the XP fails to open the given socket during its routing process.

Recommended Action:

%GATED-E-CONSLISTENFAIL Cannot listen GateD console socket <number> (error = <number>)

Explanation:

This error message is displayed when the XP experiences a "socket listen" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-CONSREADFAIL Cannot read from console socket <socket_id> (error = <number>)

Explanation:

This error message is displayed when the XP experiences a "socket read" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-DMIATTACHEDNULL DMI attached null for implicit aggregate route

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

$\%GATED\text{-}E\text{-}DMIEXTAGGRMISMATCH DMI external }0x\%x$ not equal to aggr_adv 0x%x

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

%GATED-E-DSTMSKINSFAIL Explicit aggregate for network **%s/%s** exists. Implicit ignored

Explanation:

This error message is displayed when the addition of an implicit aggregate route to a destination network fails because of the presence of an explicit aggregate to the same destination network. In this case the implicit aggregate route is ignored.

Recommended Action:

None.

%GATED-E-EXIT Exited (pid 0x<hex_number>) at <number>

Explanation:

This error message displays the process ID and the time at which the XP routing process failed (exited) due to internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-FACADD error adding facility '<name>'

Explanation:

System resources are limited and the GateD Parent system facility failed to initialize.

Recommended Action:

Increase system memory and if problem persists, contact Enterasys Technical Support.

%GATED-E-ILLROUTERID Router id cannot be in the loopback network

Explanation:

The IP address which is chosen to be the Router-ID of the router cannot be from the loopback network (127.0.0.0).

Recommended Action:

Enter an IP address belonging to the router which is not on the loopback network (127.0.0.0).

%GATED-E-IMPAGGREXISTS Implicit aggregate for network %s/%s exists. Explicit ignored

Explanation:

This error message is displayed when the addition of an explicit aggregate route to a destination network fails because of the presence of an implicit aggregate to the same destination network. In this case the explicit aggregate route is ignored.

Recommended Action:

None.

%GATED-E-INVCONSSLOT Invalid console slot (*<number>*). Max *<number>*.

Explanation:

This error message is displayed when the XP experiences an internal error in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-IOCTLFAIL ioctl returned (<number>) for <number>

Explanation:

This error message is displayed when the XP experiences a "socket ioctl" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-MAXACTIVECCONN Maximum active console connections < number > exceeded

Explanation:

This error message is displayed when the user attempts to activate more than the maximum number of allowable console-client connections for the XP routing process.

Recommended Action:

Deactivate any unnecessary connections, then activate the new one.

%GATED-E-NOAGGRGHEAD No aggregate head rt (0x%x) rth (0x%x)

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-NOAGGRGHEADPLCY No aggregate head rt (0x%x) rth (0x%x) policy elem (0x%x)

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-NOAGGRRADVDST No aggregate route in policy elem (0x%x) flag (0x%x)

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-NOAGGRRADVLIST No aggregate route in policy elem (0x%x) flag (0x%x)

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

%GATED-E-NOAGGRROUT No aggregate route in policy elem (0x%x) flag (0x%x)

Explanation:

This error message is displayed when the XP routing process detects an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-NOSUCHTASK Task does not exist.

Explanation:

This error message is displayed when the user instructs the XP routing process to perform an operation for which there is no corresponding sub-task.

Recommended Action:

Ensure that you have specified the appropriate task and/or that its syntax is correct.

%GATED-E-NUMOFCCONNERR Numof active console connections mismatch (max < number > cur < number >)

Explanation:

This error message is displayed when the XP experiences an internal error in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-OPT2ADDRSPECFAIL Copy from option to addr spec failed.

Explanation:

This message is displayed when there was an error while processing one of the CLI command parameters (possibly the "gateway" or "interface" parameter).

Recommended Action:

Try re-entering the command after verifying that the parameters are valid. If the problem persists, contact Enterasys Technical Support.

%GATED-E-SNMPEVTNOTIFY Error sending SNMP event

(status=<*number*>)

Explanation:

This message is displayed when an SNMP request to access GateD-related information failed.

Recommended Action:

Try performing the SNMP request again. If this message displays repeatedly, contact Enterasys Technical Support.

%GATED-E-SNMPIFINUSE Snmp interface is in use (action=<number>).

Explanation:

This message is displayed because only 1 SNMP reader may access GateD's tables at a time.

Recommended Action:

Serialize SNMP requests to GateD's tables.

%GATED-E-SNMPRSPNOTIFY Error sending SNMP response (status=<number>)

Explanation:

This message is displayed when an SNMP request to access GateD-related information failed.

Recommended Action:

Try performing the SNMP request again. If this message displays repeatedly, contact Enterasys Technical Support.

%GATED-E-SNMPTMO No SNMP response from Gated (status=<number>)

Explanation:

This message is displayed when an SNMP request to access GateD-related information failed.

Recommended Action:

Try performing the SNMP request again. If this message displays repeatedly, contact Enterasys Technical Support.

%GATED-E-SSOCKOPTFAIL Set socket option returned (*<number>*) for *<number>*

Explanation:

This error message is displayed when the XP fails to set a socket option in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-TSKDELETED Task (<name>, 0x<hex_number>) is in deleted state (flags=0x<hex_number>)

Explanation:

This error message is displayed when the user instructs the XP routing process to perform an operation for which the corresponding sub-task is in the deleted state.

Recommended Action:

Contact Enterasys Technical Support.

%GATED-E-WRITEFAIL Write socket returned (*<number>*) for *<number>*

Explanation:

This error message is displayed when the XP experiences a "socket write" operation failure in its routing process.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%GATED-F-DATAMALLOCFAIL Malloc failed for Gated data-section.

Explanation:

This message is displayed when, during initialization, the GateD task could not successfully allocate the required memory.

Recommended Action:

Restart the system. If the problem persists, please call Enterasys Technical Support.

%GATED-F-NULLDATAPTR Saved data-section pointer is NULL.

Explanation:

This message is displayed when the GateD task detected a memory corruption problem.

Recommended Action:

Restart the system. If the problem persists, please call Enterasys Technical Support.

Chapter 20

GVRP Error Messages

This chapter describes the error messages for the GVRP facility.

Informational Messages

%GVRP-I-DYN_VLAN_DISABLED Dynamic VLAN has been disabled

Explanation:

This message appears when dynamic VLAN creation is disabled.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-DYN_VLAN_ENABLED Dynamic VLAN has been enabled

Explanation:

This message appears when dynamic VLAN creation is enabled.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-PORT_ADDED GVRP added port cont to vlan (cvlan_id)

Explanation:

This message appears when a port is added to a VLAN by GVRP.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-PORT_REMOVED GVRP removed port *<port>* from vlan (*<vlan_id>*)

Explanation:

This message appears when a port is removed from a VLAN by GVRP.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-STARTED GVRP has been started

Explanation:

This message appears when GVRP is started.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-STOPPED GVRP has been stopped

Explanation:

This message appears when GVRP is stopped.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-VLAN_CREATE GVRP Vlan Successfully Created (<vlan_id>)

Explanation:

This message appears when a VLAN is created by GVRP.

Recommended Action:

Informational message. No action necessary.

%GVRP-I-VLAN_REMOVED GVRP Vlan Successfully Removed (<vlan_id>)

Explanation:

This message appears when a VLAN is removed by GVRP.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%GVRP-W-DYNAMIC_VLAN GVRP cannot create Vlan (<*vlan_id*>). Enable it via the CLI.

Explanation:

This message appears when GVRP cannot create the VLAN.

Recommended Action:

Make sure dynamic VLAN creation is enabled via the CLI.

%GVRP-W-PORT_FORBIDDEN Port port> is forbidden from being added to vlan <vlan_id>

Explanation:

This message appears when GVRP tries to add a forbidden port to a VLAN.

Recommended Action:

No action necessary.

%GVRP-W-REG_MODE GVRP can't set registrar mode on ports that are not gvrp enabled -- cport_list>

Explanation:

This message appears when the attempt is made to set the registrar mode on at least one port that is not GVRP enabled.

Recommended Action:

Enable GVRP on the ports that aren't already and set the registrar mode again.

%GVRP-W-TRUNK_PORT Port port> must be a trunk port in order to add it to a vlan (<vlan_id>)

Explanation:

This message appears when GVRP tries to add an access port to a VLAN.

Recommended Action:

Change the specified port to a trunk port.

%GVRP-W-VLAN_ADD_PORT GVRP could not add port <port> to vlan (<vlan_id>)

Explanation

This message appears when GVRP is not able to add port to vlan.

Recommended Action

Report to Technical Support.

%GVRP-W-VLAN_L4BDG GVRP tried to remove a Vlan that is L4 bridging enabled (<vlan_id>)

Explanation:

This message appears when GVRP tries to remove a VLAN that has L4 bridging enabled on it.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-W-VLAN_NOTEXISTS GVRP tried to remove a non-existent Vlan (<vlan_id>)

Explanation

This message appears when GVRP tries to remove a VLAN that does not exist.

Recommended Action:

%GVRP-W-VLAN_PORTS GVRP tried to remove a Vlan with ports still in the Vlan (<vlan_id>)

Explanation

This message appears when GVRP tries to remove a vlan that still has ports.

Recommended Action

Report to Technical Support.

%GVRP-W-VLAN_REMOVE_PORT GVRP could not remove port <port> from vlan (<vlan_id>)

Explanation:

This message appears when GVRP is not able to remove port from VLAN.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-W-VLAN_STATIC GVRP tried to remove a statically created Vlan (<vlan_id>)

Explanation

This message appears when GVRP tries to remove a vlan that was statically created (not created by GVRP).

Recommended Action

Report to Technical Support.

Error Messages

%GVRP-E-GET_SEMA4 GVRP Failed to Acquire semaphore errorcode: <number>

Explanation:

This message appears when GVRP fails to acquire a semaphore.

Recommended Action:

%GVRP-E-PORT_INVALID GVRP Error - Port <*port_number>* is invalid

Explanation:

This message appears when GVRP tries to add an invalid port to, or remove an invalid port from, a VLAN

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-E-REG_MCAST GVRP Could not register the multicast address: 0180C2:000021 on port:

Explanation:

This message appears when GVRP fails to register the GVRP multicast address on specified port.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-E-REG_MODE GVRP can't set registrar mode on ports that are not gvrp enabled -- cport_list>

Explanation:

This message appears when the attempt is made to set the registrar mode on ports that are not GVRP enabled.

Recommended Action:

Enable GVRP on the ports and set the registrar mode again.

%GVRP-E-REL_SEMA4 GVRP Failed to Release semaphore errorcode:<number>

Explanation:

This message appears when GVRP fails to release a semaphore.

Recommended Action:

%GVRP-E-UNREG_MCAST Could not unregister the multicast address: 0180C2:000021 on port:

Explanation:

This message appears when GVRP fails to unregister the GVRP multicast address on specified port.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-E-VLAN_BOUND GVRP Error - Vlan bound to IP/IPX interface. Remove the interface first (<vlan_id>)

Explanation:

This message appears when GVRP attempts to remove a VLAN that is bound to an IP/IPX interface.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-E-VLAN_CREATE_ERROR GVRP Error occurred while trying to create Vlan (<vlan_id>)

Explanation:

This message appears when an error happens while GVRP is creating a vlan.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-E-VLAN_REMOVE_ERROR GVRP Error occurred while trying to remove Vlan (<vlan_id>)

Explanation:

This message appears when an error happens while GVRP is removing a VLAN.

Recommended Action:

Fatal Errors

%GVRP-F-CREATE_Q Failed to create GVRP queue: <queue_name> errorcode: <number <

Explanation:

This message appears when there is an error creating the queue on which to receive GVRP packets.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-F-CREATE_SEMA4 Failed to create GVRP semaphore: <return_code>

Explanation:

This message appears when there is an error while creating the GVRP semaphore.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-F-CREATE_TMR Failed to create GVRP Timer : <return_code>

Explanation:

This message appears when there is an error while creating the GVRP timer.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-F-REG_GVRP Failed to register <string>, errorcode <return_code>

Explanation:

This message appears when there is an error registering to receive GVRP PDUs.

Recommended Action:

%GVRP-F-RESET_TMR Failed to reset GVRP Timer : <return_code>

Explanation:

This message appears when there is an error while resetting the GVRP timer.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-F-START_TMR Failed to start GVRP Timer: <return_code>

Explanation:

This message appears when there is an error while starting the GVRP timer.

Recommended Action:

Contact Enterasys Technical Support.

%GVRP-F-STOP_TMR Failed to stop GVRP Timer: <return_code>

Explanation:

This message appears when there is an error while stopping the GVRP timer.

Recommended Action:

Chapter 21

HBT Error Messages

This chapter describes the error messages for the Control Module Heartbeat facility.

Informational Messages

%HBT-I-HELLORCVD heartbeat from active <*cm_type*> in slot <*slot_id*>

Explanation:

Heartbeat message received by the backup Control Module from the primary Control Module in the specified slot.

Recommended Action:

Informational message. No action necessary.

%HBT-I-MASTERCPUFAIL active <cm_type> in slot <slot_id> has failed

Explanation:

Backup Control Module has detected a failure of the primary Control Module. Backup Control Module will assume primary role.

Recommended Action:

Replace failed Control Module.

%HBT-I-SYNCTIMERCVD, time synchronized to: %s

Explanation:

This message is displayed on the backup control module when it receives a time-synchronization packet from the primary control module and sets the synchronized time. It will appear under one of the following situations: (1) The router is rebooted. (2) A backup control module is hot-swapped in. (3) The primary control module resets its time.

Recommended Action:

None.

Warning Messages

%HBT-W-BACKUPFAILURE backup CM in slot *<slot_id>* is not operating

Explanation:

A backup Control Module has been detected, but it is not functioning properly.

Recommended Action:

Replace indicated Control Module.

%HBT-W-DIFFDRAM DRAM configurations between redundant <cm_type> differs (primary = <mem_size>, backup = <mem_size>)

Explanation:

The amount of CPU memory differs between the primary and backup Control Modules.

Recommended Action:

Ensure that both Control Modules have the same amount of CPU memory.

%HBT-W-DIFFNETMEM Network memory between redundant <cm_type> differs (primary = <mem_size>, backup = <mem_size>)

Explanation:

There are incompatible versions of the primary and backup Control Modules or one Control Module has a fault.

Recommended Action:

Install compatible versions of primary and backup Control Modules.

%HBT-W-HBTTAKEOVER Taking over mastership from peer CM.

Explanation:

Backup control module is asked to become master by the master CM because of some fatal error on the master CM.

Recommended Action:

Check old master control module.

%HBT-W-INCONSISMAC Inconsistent count of system MACS between redundant <*cm_type*> differs (primary = <*num_MACS*>, backup = <*num_MACS*>)

Explanation:

Primary and backup Control Modules have incompatible software versions.

Recommended Action:

Install compatible versions of primary and backup Control Modules.

%HBT-W-INVLDMSG Invalid message received from client port <port_id>, on channel <channel_id>

Explanation:

Invalid Heartbeat message received from backup Control Module.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-W-INVLDSRC Invalid source address <*src_addr*> attempting to connect to service port

Explanation:

A message was received from an invalid source.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-W-INVLDSRVC Invalid service request <*rqst_id*>, from client port <*port_id*>, on channel <*channel_id*>

Explanation:

Invalid service request received.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-W-SYNCINPROG database update currently in progress - please try again

Explanation:

The primary Control Module is currently transferring data to the backup Control Module.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-W-VERSMISMATCH HBT message version mismatch (primary = <*ver_id*>, backup = <*ver_id*>)

Explanation:

This message is displayed when the backup control module is running a different software version than the primary control module.

Recommended Action:

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

Error Messages

%HBT-E-BADPKT bad HBT message from physical port port_id>

Explanation:

A message was received with an incorrect message ID.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-E-CFGRCVERR incorrect configuration file lengths, expected <*value>*, actual <*value>*

Explanation:

A message was received that was shorter than the expected length.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-E-HBTLOOPED HBT message mistakenly looped back on slot <slot_id>

Explanation:

Transmitted message looped back to source Control Module.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-E-NONBUF unable to get network transmit buffer

Explanation:

No transmit buffers are available.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message displays repeatedly, contact Enterasys Technical Support.

%HBT-E-SETTIME, setting of synchronized time failed

Explanation:

This message is displayed on the backup control module when it fails to set the synchronized time after receiving a time-synchronization packet from the primary control module.

Recommended Action:

%HBT-E-UNKNWNMSG unknown HBT message <msg>

Explanation:

An unknown message was received.

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

%HBT-E-XMTQFULL unable to send frame xmit queue full

Explanation:

The Control Module is unable to send messages to other Control Module(s).

Recommended Action:

A single occurrence of this message has no detrimental effect on the system. If this message is displayed repeatedly, contact Enterasys Technical Support.

Fatal Errors

%HBT-F-BADSYSID inconsistent system types <sys_id> and <sys_id>

Explanation:

The primary and backup Control Modules report different system IDs.

Recommended Action:

Replace a Control Module. If problem persists, contact Enterasys Technical Support.

%HBT-F-CREATEQ error creating $\langle q_id \rangle$ queue, error = $\langle error_id \rangle$

Explanation:

This message appears when an internal error has occurred.

Recommended Action:

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

%HBT-F-ETYPEREG error registering special ether type, error = <*error_id>*

Explanation:

This message appears when an internal error has occurred.

Recommended Action:

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

%HBT-F-EVENTWAIT Event wait failed, error = <*error_id*>

Explanation:

This message appears when an internal error has occurred.

Recommended Action:

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

%HBT-F-MULTIMASTERS both <*cm_type*>(s) attempting to be primary controllers

Explanation:

More than one Control Module is operating as the primary controller.

Recommended Action:

Contact Enterasys Technical Support.

%HBT-F-MULTISECNDRY both <*cm_type*>(s) reverted to backup controller status

Explanation:

All Control Modules are configured as backup controllers.

Recommended Action:

Contact Enterasys Technical Support.

%HBT-F-TIMER error creating <timer_id> timer, error = <error_id>

Explanation:

This message appears when an internal error has occurred.

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

%HBT-F-TMRSTARTFAIL failed to start timer <timer_id>, error = <error_id>

Explanation:

This message appears when an internal error has occurred.

Recommended Action:

Reinstall the system software image. If problem persists, contact Enterasys Technical Support.

Chapter 22

IGMP Error Messages

This chapter describes the error messages for the Internet Group Membership Protocol (IGMP) facility.

Informational Messages

%IGMP-I-SNOOP_STARTED Igmp L2 Snooping Started

Explanation:

This message is displayed when Layer 2 IGMP Snooping service is started.

Recommended Action:

Informational message. No action necessary.

%IGMP-I-SNOOP_STOPPED Igmp L2 Snooping Stopped

Explanation:

This message is displayed when Layer 2 IGMP Snooping service is stopped.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%IGMP-W-MODIFYREPORT responsetime was bigger than queryinterval: modified to <number>

Explanation:

This message appears when the response time is set to a value larger than the query interval. If query interval is reduced, then response time is automatically reduced.

Recommended Action:

Verify query interval value.

Error Messages

%IGMP-E-ALLOWED_LIST Allowed igmp group list is already set

Explanation:

This message appears when the user attempts to set the NotAllowed igmp list while the Allowed IGMP list is specified.

Recommended Action:

Ensure that the NotAllowed IGMP list is specified, and try to set it again.

%IGMP-E-BADRESPTIME Bad response time < number >, must be less than < number >

Explanation:

This message appears when the response time entered is larger than the query interval.

Recommended Action:

Enter a response time that is less than the query interval.

%IGMP-E-DUPNAME <1> %s: duplicate address

Explanation:

This message is displayed when the interface name specified is already in use.

Verify interface name.

%IGMP-E-IFNOTFOUND < IP_interface/name >: no such interface address

Explanation:

This error message will be displayed if the user specifies a non-existent interface or IP address for the specified interface.

Recommended Action:

Ensure that the specified interface or IP address exists and/or you have typed it correctly, then enter the command again.

%IGMP-E-INV_VLAN <1> %s is not found

Explanation:

This message is displayed if an attempt is made to set parameters for VLAN based IGMP on an invalid VLAN.

Recommended Action:

Verify specified VLAN.

%IGMP-E-IP_VLAN <1> %s is not an IP vlan

Explanation:

This message is displayed if an attempt is made to set parameters for VLAN based IGMP on a non-IP VLAN.

Recommended Action:

Only specify an IP VLAN for VLAN based IGMP snooping.

%IGMP-E-L2_ENABLED <1> L2 IGMP Snooping enabled on vlan %s

Explanation:

This message is displayed when an attempt is made to enable Layer 3 Multicasting on a VLAN that has Layer 2 IGMP snooping already enable on it.

Recommended Action:

Both Layer 3 Multicasting and Layer 2 IGMP snooping cannot be enabled on the same VLAN. Remove Layer 2 IGMP snooping before enabling Layer 3 Multicasting.

%IGMP-E-L3_ENABLED <1> Multicast Routing enabled on vlan %s

Explanation:

This message is displayed when an attempt is made to enable Layer 2 IGMP snooping on a VLAN which has Layer 3 Multicasting on the VLAN before enabling Layer 2 IGMP snooping.

Recommended Action:

Both Layer 3 Multicasting and Layer 2 IGMP snooping cannot be enabled on the same VLAN. Remove Layer 3 Multicasting on the VLAN before enabling Layer 2 IGMP snooping.

%IGMP-E-NOTALLOWED_LIST NotAllowed igmp group list is already set

Explanation:

This message appears when the user attempts to set the Allowed igmp list while the NotAllowed IGMP list is specified.

Recommended Action:

Ensure that the Allowed IGMP list is specified, and try to set it again.

%IGMP-E-OVERLAP L2 IGMP %s Invalid Ports %s

Explanation:

This message is displayed if an attempt is made to set parameters for VLAN based IGMP snooping with a portlist that contains both permanent and filter ports.

Recommended Action:

Only specify either filter or permanent ports in the command for setting VLAN based IGMP snooping.

Chapter 23

Interface Configuration Error Messages

This chapter describes the error messages for the Interface Configuration facility.

Informational Messages

%INTERFACE-I-CREATEDIF Interface <interface_name> was successfully created.

Explanation:

This message is displayed when an interface has been successfully created by the "interface create" command

Recommended Action:

Informational Message. No action necessary.

%INTERFACE-I-REMOVEDIF Interface <interface_name> was successfully removed.

Explanation:

This message is displayed when the negation of an "interface create" command has completed successfully.

Informational Message. No action necessary.

%INTERFACE-I-REMOVINGIF Removing interface <interface_name>. Please wait.

Explanation:

This message is displayed when the user has negated an **interface create** command. This may take some time to complete. Upon completion, another message is displayed to let the user know that the negation has completed.

Recommended Action:

Informational Message. No action necessary.

%INTERFACE-I-WAN_PPP_BCAST_ASSUMED The interface <interface_name> was marked as Broadcast.

Explanation:

A broadcast 13 interface is created for this PPP port.

Recommended Action:

None.

%INTERFACE-I-WANFAIL Creating interface <interface_name> failed, starting clean-up.

Explanation:

This message is displayed when the user has attempted to create a WAN interface but the command was unsuccessful.

Recommended Action:

Informational Message. No action necessary.

Warning Messages

%INTERFACE-W-WAN_CREATE_FAILED interface create failed

Explanation:

Can not create 13 interface on the WAN card port.

Check for additional error messages.

%INTERFACE-W-WAN_NEGATE_FAILED interface negation failed

Explanation:

Negation failed on the WAN card ports.

Recommended Action:

Check for additional error messages.

%INTERFACE-W-WAN_PPP_BCAST_IGNORED The interface <interface_name> was marked as Point-to-Point. The broadcast address specified was ignored.

Explanation:

The Broadcast address option for the **interface create** command was ignored since it is a Point-to-Point interface.

Recommended Action:

None.

%INTERFACE-W-WAN_VLAN_EXIST command for port *<port-name*) failed since it is already on vlan *<vlan-name*>.

Explanation:

The **vlan add port** or **interface create** command failed because a VLAN is already assigned to the non-trunk WAN card PPP ports for Frame Relay VCS.

Recommended Action:

Make sure that the WAN card port is not another VLAN.

%INTERFACE-W-ZEROPORTSINIF The VLAN <*vlan-name*>, which is being bound to interface <*interface-name*>, has no ports in it.

Explanation:

There are no ports in the VLAN on which an interface is configured.

Recommended Action:

Make sure there is at least one port in the VLAN on which an interface is configured.

Error Messages

%INTERFACE-E-ACLATTACHED An ACL is attached to this interface. Please detach ACL '<ACL_name>' from interface '<interface_name>' first.

Explanation:

This message is displayed when the user is trying to delete an interface which has an ACL bound to it.

Recommended Action:

Negate the ACL first, before negating the interface.

%INTERFACE-E-ADDR_IN_EXISTING_SUBNET The address <address> being configured on interface <interface_name> belongs to a subnet which has already been configured on interface<interface-name>.

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-APS_PROTECTINGPORT Port port-name has been configured as an APS Protecting port.

Explanation:

This message is displayed when the port is already configured as a Protection port for APS.

Recommended Action:

Specify a non-protecting port or use the vlan option.

%INTERFACE-E-ARPKEEPTIMECONFIGURED ARP keep time is configured on this interface. Please remove it from interface '%s' first.

Explanation:

This message appears when you attempt to remove an interface from the configuration while the ARP keep-time is still configured on that interface.

Remove the ARP keep-time command configured on that interface, then remove the interface.

%INTERFACE-E-BADATMMUX Only one protocol can be configured over a VC with encap type of vc-mux. Please check the port encap type and try again.

Explanation:

An ATM VC with encap type vc-mux sends no protocol information over the wire. Because the protocol is determined from the VC, only IP or IPX can be configured over a vlan or port that contains an ATM VC in vc-mux encap mode. This error appears when you attempt to add a second protocol with the interface create command. If the port or vlan contains any ATM VCs with an encap type of vc-mux, the interface command fails.

Recommended Action:

Check the port encap type and try again.

%INTERFACE-E-BADIFTYPE Interface <interface_name>: Point-to-Point interface type can only be specified for interfaces defined over PPP ports.

Explanation:

This message is displayed when the type of interface cannot be created on the specified ports.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-BADMTU The specified MTU - < number > - is too large. Please select a smaller value and try again.

Explanation:

The MTU value for this particular interface is too large.

Recommended Action:

Specify a smaller MTU value and try again.

%INTERFACE-E-BADPORT The specified port - port number *< number >* - is illegal. Please check the port name and try again.

Explanation:

This error message should not appear.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-BADVC The specified VLAN -<*VLAN_name>* - does not exist. Please check the name of the VLAN and try again.

Explanation:

This message is displayed when the user has specified a VLAN that does not exist, in the **interface create** command.

Recommended Action:

Check the name of the VLAN to make sure that it is the name of an existing VLAN. If the VLAN to be used for this interface does not exist, first create the VLAN before creating an interface bound to the VLAN.

%INTERFACE-E-BADVLAN Only one vc can be applied to interface command. Please check the port name and try again.

Explanation:

This message is displayed when the user has specified a VC to be applied to an interface when a VC is already applied to the interface.

Recommended Action:

Verify the port name.

%INTERFACE-E-BCAST0HOST Invalid IP address - address <IP_address> is a broadcast address.

Explanation:

This message is displayed when the user is trying to configure an interface with an address which is a broadcast address with zeroes for the "host" part of the address. This is not allowed.

Recommended Action:

Specify a unicast IP address when creating an interface or adding an IP address to it.

%INTERFACE-E-BCAST1HOST Invalid IP address - address <IP_address> is a broadcast address.

Explanation:

This message is displayed when the user is trying to configure an interface with an address which is a broadcast address with ones for the "host" part of the address. This is not allowed.

Recommended Action:

Specify a unicast IP address when creating an interface or adding an IP address to it.

%INTERFACE-E-CACHEATTACHED A web-cache is attached to this interface.

Explanation:

This message is displayed when the interface is web-cache-defined and cannot be removed without detaching the web-cache first.

Recommended Action:

Detach the web-cache defined on the interface before removing the interface itself.

%INTERFACE-E-CANNOTBRINGUP Interface <interface_name> has not been configured with any IP or IPX addresses. Please configure it before bringing it up.

Explanation:

This message is displayed when the user is trying to bring an interface up using the **interface up** command, but the interface has not been configured with an IP address.

Recommended Action:

Configure the interface before bringing it up.

%INTERFACE-E-CANNOTNEGATE Interface <interface_name > cannot be negated because addresses have been configured for it using "interface add" commands. Please negate the appropriate "interface add" commands before negating the "interface create" command.

Explanation:

This message is displayed when the user is trying to negate an interface to which IP addresses have been added using the **interface add ip** command.

The **interface add ip** commands must be negated before the **interface create** command can be negated.

%INTERFACE-E-CANTCREATEIF Unknown error creating interface <interface_name>!

Explanation:

This message is displayed when an internal error occurred while creating an interface.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-CMD < command_name > expected an argument, didn't get one

Explanation:

This message is displayed when <command_name> expected an argument, but didn't get one.

Recommended Action:

Contact Enterasys Technical Support for information about this message.

%INTERFACE-E-DIFFSUBNET local address (<IP_address>) and peer address (<IP_address>) are not on the same subnet.

Explanation:

This message is displayed when the local address and the remote (peer) address of a WAN IP interface do not belong to the same subnet.

Recommended Action:

Ensure that both the local and peer IP addresses belong to the same subnet.

%INTERFACE-EXISTS Interface <interface_name> has already been created. Please use another name for the interface.

Explanation:

This message is displayed when the user is attempting to create an interface with a name which is already being used by another interface.

Use another name for the interface being created.

%INTERFACE-E-IFNONE No IP interfaces found.

Explanation:

This message is displayed when the user is trying to display information for all interfaces of a particular type, but no interfaces matching the request were found.

Recommended Action:

None

%INTERFACE-E-IFNOTIP An IP address cannot be configured on interface <interface_name> because the interface does not support IP.

Explanation:

This message is displayed when the user is attempting to configure an IP (IPX) address on an interface that does not support IP (IPX).

Recommended Action:

Create another interface that supports the required protocol and then configure it with the address.

%INTERFACE-E-IFVLANEXISTS There is already an <interface_type> interface called <interface_name> on VLAN <VLAN_name>. A VLAN can be bound to only one L3 interface for each protocol.

Explanation:

This message is displayed when the user attempts to create an IP/IPX interface on a VLAN that already has an IP/IPX interface association. As the message text states, only one L3 interface can be associated with a VLAN for each type of protocol.

Recommended Action:

Specify a different interface type/name for the given VLAN.

%INTERFACE-E-INVALIDATES_EXISTING_ADDR An existing address <address> on interface <interface_name> matches the subnet of the address-netmask (%s/%s) of the interface <interface_name> being created.

Explanation:

This message is displayed when the software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-INVALIDIFNAME The name *<interface_name>* is not allowed for interfaces. Please use another name.

Explanation:

This message is displayed when the user attempts to create an interface with an invalid name. The interface names "en", "lo", "en0", and "lo0" are reserved names.

Recommended Action:

Choose a correct interface name.

%INTERFACE-E- INVALIDNETMASK The netmask < netmask > is an invalid netmask.

Explanation:

This message is displayed when the subnet mask entered for the interface is invalid.

Recommended Action:

Make sure the subnet mask is valid.

%INTERFACE-E-IPADDREXISTS The IP address < IP_address > is already configured on interface < interface_name >.

Explanation:

This message is displayed when the user is trying to configure the same address twice on the system. This is not allowed.

Recommended Action:

Remove the command which generated this error from the configuration.

%INTERFACE-E-IPREDATTACHED Attempting to config IP address <IP_address> which is currently in use by a virtual-router on interface <interface_name>.

Explanation:

This message is displayed when the user attempts to add or remove an IP address to or from an interface that is currently serving as part of a VRRP virtual router. Executing this command would leave the router in an "inconsistent" state.

Recommended Action:

Remove the IP address from the VRRP router and then add or remove the IP address as before.

%INTERFACE-E-MACADDRNOTALLOWED Mac address option is not allowed for WAN card.

Explanation:

The MAC address option is not allowed for WAN cart ports.

Recommended Action:

None.

%INTERFACE-E-MACCONFLICT The MAC address < MAC_address > conflicts with another MAC address < MAC-address > being used on this port. Only one MAC address can be configured per port, per protocol.

Explanation:

This message is displayed when the user attempts to specify a MAC address that is different from the MAC address already associated with the given port for the IP/IPX interface being created. As the message text states, only one MAC address may be specified per port for each type of protocol.

Recommended Action:

No action necessary. The new MAC address has not been assigned.

%INTERFACE-E-NAME <string> is not a valid host or network address

Explanation:

This message is displayed when a user supplies an invalid host or network address.

Recommended Action:

Contact Enterasys Technical Support for information about this message.

%INTERFACE-E-NAMETOOLONG The interface name <interface_name > is too long. The name cannot be longer than 32 characters.

Explanation:

This message is displayed when the user has entered a name for an IP/IPX interface which is too long.

Recommended Action:

Use a shorter name. The maximum allowed length is displayed in the error message.

%INTERFACE-E- NATATTACHED An NAT is attached to this interface.

Explanation:

This message is displayed when the interface is NAT-defined and cannot be removed without detaching NAT first.

Recommended Action:

Detach the NAT definition on the interface first before removing the interface itself.

%INTERFACE-E-NOEXIST Interface <interface_name > does not exist. Please check the name and try again.

Explanation:

This message is displayed when a command refers to an interface which does not exist. Usually, this occurs if the interface name is typed in incorrectly.

Recommended Action:

Check the name of the interface in the command that failed, and make sure that it matches the name of an interface that has already been created.

%INTERFACE-E-NOMAC The MAC address < MAC_address > is being used by the en0 10base-T interface on the CPU module and is reserved. Please use another MAC address.

Explanation:

The specified MAC address is reserved for use with the XP's CPU module.

Recommended Action:

Specify another MAC address for your interface.

%INTERFACE-E-NOMLTPL Interface <interface_name > cannot support secondary address due to old line card

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%INTERFACE-E-NOPEERADDR Interface <interface_name> is configured as a Broadcast interface.

Explanation:

This message is displayed when the interface is configured as a Broadcast interface and no peer address is given.

Recommended Action:

Make sure that there is a peer address specified with the interface when the Broadcast type is configured.

%INTERFACE-E-NOSUCHIF Interface *<interface_name>* was not found or is not configured with any 'IP' addresses.

Explanation:

This message is displayed when the user is trying to show information about an interface that does not exist, or is not configured with the protocols of interest to the user.

Recommended Action:

Check the name of the interface.

%INTERFACE-E-NOSUCHPORT Port doesn't exist on this system.

Explanation:

This message occurs when a port is not found by the system even though the module exists.

Recommended Action:

Contact Enterasys Technical Support for information about this message.

%INTERFACE-E-NOSUCHVCL Specified VCL does not exist.

Explanation:

Internal error.

Recommended Action:

User should specify a different VC.

%INTERFACE-E-OMACMISMATCH The interface <interface_name> is also using VLAN <vlan_name>. When two interfaces use the same VLAN, they must use the same output MAC encapsulation. Please change the output MAC encapsulation or use another VLAN.

Explanation:

(See message text.)

Recommended Action:

(See message text.)

%INTERFACE-E-POLICYATTACHED A Policy is attached to this interface. Please detach policy '<policy-name'> 'from interface '<interface_name'> 'first.

Explanation:

This message is displayed when the interface is Policy-defined and cannot be removed without detaching the Policy first.

Recommended Action:

Detach the Policy defined on the interface before removing the interface itself.

%INTERFACE-E-PORTHASVLAN Port port_number> already belongs
to VLAN <vlan_name>. Please use the -vlan- option of the -interface createcommand instead of the -port- option.

Explanation:

When an interface is created using the **interface create... port** *<portname>* command, a VLAN is created for the interface and the port is added to the VLAN. If the port is an access port and is already on a VLAN for the type of interface being created (IP/IPX), then it cannot be added to another VLAN.

Use the **interface create... vlan** <*vlanname*> version of the command to bind the interface to the VLAN which contains the desired port.

%INTERFACE-E-PORTINVLAN Only ports belonging to the default vlan can be added to a SmartTRUNK.

Explanation:

This error message is displayed when the user attempts to add a port to a SmartTRUNK that already belongs to a VLAN other than the default VLAN.

Recommended Action:

Remove the port from any other VLANs (except the default VLAN) by negating any existing **vlan add ports** commands relating to the port in question. Then add the port to the desired SmartTRUNK.

%INTERFACE-E-PPPADDNOTSUPP Interface <interface-name> is already configured as a Point-To-Point interface.

Explanation:

Adding an address to a Point-to-Point interface is not supported.

Recommended Action:

Create a broadcast interface if multiple interfaces are needed.

%INTERFACE-E-PPPIFPORTSEXCD Point-to-Point interface <interface-name> cannot have more than 1 port specified.

Explanation:

A Point-to-Point interface can not have more than one port.

Recommended Action:

Use the **interface create** command on a single port. Or ensure that only one port is in the VLAN when suing the **interface create** command on a VLAN.

%INTERFACE-E-PROTNOTSUPP VLAN <*vlan_name*> does not support the IP protocol. Please check the VLAN name and try again.

Explanation:

This message is displayed when the user is trying to create an interface bound to a VLAN which does not support the protocol of the interface (IP/IPX).

Recommended Action:

Create a VLAN which supports the desired protocol before creating an interface for that protocol.

%INTERFACE-E-QOSATTACHED A QOS flow definition is attached to interface <interface_name>. Please negate the QOS commands applied to this interface.

Explanation:

Before negating (deleting) an interface, QOS flows associated with the interface must be negated.

Recommended Action:

Locate and negate (delete) all CLI commands associating QOS flows with the interface you wish to negate, then negate the interface.

%INTERFACE-E-RARPDENABLED RARPD is enabled on this interface. Please disable it first.

Explanation:

The "interface create" command cannot be negated due to the fact that RARPD is enabled on the interface.

Recommended Action:

Negate the corresponding "rarpd set interface" command before attempting to remove the interface.

%INTERFACE-E-RESERVEDIF Interface lo0 is a reserved interface and cannot be created. However, you can add addresses to the interface using the _interface add_ command.

Explanation:

The interfaces lo0 (loopback) and en0 (management port on the CPU module) are automatically created by the system. They cannot be created by the user. However, the user can add addresses to these interfaces.

Remove the command which generated the message from the configuration. Use the **interface add ip** command to add an IP address to the interface, if desired.

%INTERFACE-E-RLATTACHED A Rate Limit policy is attached to this interface.

Explanation:

This message is displayed when the interface is Rate-Limit-defined and cannot be removed without detaching the Rate-Limit first.

Recommended Action:

Detach the Rate-Limit defined on the interface before removing the interface itself.

%INTERFACE-E-SAMEADDR local address < address > and peer address < address > are the same.

Explanation:

This message is displayed when the peer address given matches the local address.

Recommended Action:

Make sure that the peer address you are trying to configure is different from the local address.

%INTERFACE-E-SAMEENCAP The encapsulation entered is already being used on another network attached to this interface.

Explanation:

This message is displayed when the encapsulation entered is already being used by another network attached in the same interface.

Recommended Action:

Make sure no two networks on the same interface have the same encapsulation.

%INTERFACE-E-STNOTFOUND SmartTRUNK st.<number> not found.

Explanation:

This message occurs when the user attempts to add an interface to a SmartTRUNK and the SmartTRUNK does not exist.

Verify the SmartTRUNK exists.

%INTERFACE-E-SUBNETEXISTS The address *<IP_address>* belongs to a subnet which is already configured on this system.

Explanation:

The user is trying to create an interface on a subnet which is already configured on another interface on the same device.

Recommended Action:

Remove the command that generated the error message from the configuration.

%INTERFACE-E-VLANIFTYPENOTSUPP Interface <interface_name>: Point-to-Point interface type cannot be specified along with the VLAN option.

Explanation:

This message is displayed when a Point-to-Point interface type is selected with a VLAN option.

Recommended Action:

Use the *port* option with the **interface create** command instead of the *vlan* option.

%INTERFACE-E-ZEROPORTSINIF Interface <interface_name > is not associated with any ports

Explanation:

This message is displayed when three are no ports associated with the configured interface.

Recommended Action:

Make sure there is at least one port associated with the configured interface.

Chapter 24

IP Stack Error Messages

This chapter describes the error messages for the IP Stack facility.

Informational Messages

%IP-I-ARPNOTFOUND No matching ARP entry found

Explanation:

This message is displayed when the user is trying to delete an entry which does not exist.

Recommended Action:

Informational Message. No action necessary.

%IP-I-ARPOVRWRITE arp info overwritten for <IP_address> by (MAC_address)

Explanation:

An ARP entry was updated as a result of receiving an ARP message with information different from the information contained in the entry. This can happen if a connected device is rebooted with a different Ethernet adapter.

Recommended Action:

Informational Message. No action necessary.

%IP-I-REPUNRESOLVE Replacing unresolved arp for <IP_address> with <MAC_address>

Explanation:

This message is displayed when a previously unresolved ARP for a given IP address is updated as a result of a user-defined static ARP entry.

Recommended Action:

Informational Message. No action is necessary.

%IP-I-ROUTEADDED <3> Route to %s %s via gateway %s was successfully added

Explanation:

This message indicates that a route entry was added.

Recommended Action:

This message is informational only. No action is necessary.

%IP-I-ROUTEDELETED <3> Route to %s %s via gateway %s was successfully deleted

Explanation:

This message indicates that a route entry was deleted.

Recommended Action:

This message is informational only. No action is necessary.

%IP-I-RTQREALLYOLD in_rtqtimo: adjusted rtq_reallyold to <number>

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

Warning Messages

%IP-W-ARPEXCEEDED The maximum number of ARPs (<number>) was exceeded - no ARP entry created.

Explanation:

This message is displayed when the maximum number of ARP packets has been sent with no response.

Recommended Action:

Verify connectivity to the device which ARP packets are being sent.

%IP-W-BADBCAST arp: ether address is broadcast for IP address <IP_address>!

Explanation:

This message is displayed when an ARP packet with a broadcast source Ethernet address was received.

Recommended Action:

There may be a device on the network which is misconfigured or behaving erratically.

%IP-W-DUPLIP duplicate IP address <*IP-address*> sent from ethernet address: <*MAC-address*>

Explanation:

This message is displayed when an ARP packet was received from another device that has been configured with the same IP address as the XP. This is a misconfiguration of the network.

Recommended Action:

Change the IP address on the XP or the other device. The other device can be identified by the MAC address displayed in the message.

%IP-W-RTQKILL1 in_rtqkill: error %d

Explanation:

This message indicates that the software component that manages IP resources has detected an internal error.

Contact Enterasys Technical Support.

Error Messages

%IP-E-ARPLKUP arplookup <IP_address> failed: <error-number>

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%IP-E-BADANNOT rn_delete: inconsistent annotation

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-CLRTEGFAIL NUE_Set_Flag failed

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-CNTRLTMRFAIL NU_Control_Timer failed for %s

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-GTWY arp_rtrequest: bad gateway value

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%IP-E-MASKDUP rn_addmask: mask impossibly already in tree

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-MAXKEYLEN rn_init: radix functions require max_keylen be sent

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NATCFG <3> Port %s cannot be set to destination based routing with interface %s set as NAT %s

Explanation:

NAT cannot work for an interface if that port is in destination based routing.

Recommended Action:

Make sure that the port on which NAT support is needed is not in destination based routing mode.

%IP-E-NATHSTMODECFG <3> Port %s cannot be set to host blow based routing with interface %s set as NAT %s

Explanation:

NAT cannot work for an interface if that port is in host flow based routing.

Make sure that the port on which NAT support is needed is not in host flow based routing mode.

%IP-E-NOANNOT rn delete: couldn't find our annotation

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NOCHANNUM Invalid channel number -- < number >-

Explanation:

This message is displayed when the user specifies a valid channel number that is currently inactive.

Recommended Action:

Specify an active channel. If you need quick help determining which channels are available, you can enter the **system show hardware** CLI command to display your current hardware configuration.

%IP-E-NOIPADDRCFG No IP Interface configured for port %s

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NOMASK rn_new_radix_mask: Mask for route not entered

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NOMEM arp_rtrequest: memory request failed

Explanation:

This message is displayed when the system is out of memory.

Recommended Action:

Reboot the device.

%IP-E-NONODE rn_delete: couldn't find us

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NONUNIQRT rn_addroute: Non-unique normal route, mask not entered

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-NOTEN0 A default route cannot be set with a gateway reachable via en0

Explanation:

This message is displayed when the user is trying to add a default route such that packets that match the default route will be sent on the en0 interface. This is not allowed because the en0 interface is reserved for management purposes.

Recommended Action:

Do not specify en0 as the gateway interface. Do not use a device which is connected to en0 as a gateway.

%IP-E-ORPHANMASK rn_delete: Orphaned Mask %x at %x

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-RESETTMRFAIL NU_Reset_Timer failed

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-ROUTEEXISTS <3> A route to %s %s via gateway %s is already present

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-SETTEGFAIL NUE_Set_Flag failed

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

%IP-E-WAITTEGFAIL Wait_For_Teg failed

Explanation:

The software component that manages IP resources has detected an internal error.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 25

IP Helper and BOOTP Relay Agent Error Messages

This chapter describes the error messages for the IP Helper and BOOTP/DHCP Relay Agent facility.

Informational Messages

$\% IPHELPER-I-FWD\ Packet\ forwarded\ {\it <IP\ address>}\ to\ {\it <interface>}$

Explanation:

The XP forwarded a packet that arrived with the displayed IP address and UDP port number, to the interface with the displayed unicast IP address.

Recommended Action:

Informational message. No action necessary.

%IPHELPER-I-FWD_IF Packet forwarded <IP address> to <addresses> (ifaddr <address>)

Explanation:

The XP forwarded a packet that arrived with the displayed IP address and UDP port number, to the interface with the displayed broadcast and unicast IP addresses.

Informational message. No action necessary.

%IPHELPER-I-TTLEXP TTL expired; packet from <IP address> not forwarded

Explanation:

The XP dropped the packet with the displayed IP address and UDP port number due to its TTL expiration.

Recommended Action:

Informational message. No action necessary.

%RELAY_I_BOOTREPLY Forwarded BOOTREPLY for <host> to <interface>

Explanation:

The XP forwarded a BOOTREPLY from a BOOTP server to the client with the displayed IP and MAC address.

Recommended Action:

Informational message. No action necessary.

%RELAY-I-BOOTREQUEST Forwarded BOOTREQUEST for <host> to <interface>

Explanation:

The XP forwarded a BOOTREQUEST from the client with the displayed MAC address to the displayed IP address.

Recommended Action:

Informational message. No action necessary.

%RELAY-I-GIADDR BOOTP reply with unknown giaddr <address>

Explanation:

The XP dropped a BOOTREPLY packet with the displayed giaddr IP address because it does not match any of the interfaces on the XP.

Informational message. No action necessary.

%RELAY-I-NOFORWARD BOOTP/DHCP forwarding not allowed on <interface>

Explanation:

The XP received a BOOTP/DHCP packet on an interface where an IP helper address is configured but it's not for BOOTP/DHCP packets. The helper address is configured to forward UDP broadcast packets of a service other than BOOTP/DHCP.

Recommended Action:

No action is necessary if you don't want the Relay Agent to forward BOOTP/DHCP broadcast packets to an IP helper address. If you want the packet to be forwarded, then you need to configure an IP helper address for that interface.

%RELAY-I-NOHELPER BOOTP packet received on *<interface>* with no IP helper configured

Explanation:

The XP received a BOOTP/DHCP packet on an interface but no IP helper address is configured for that interface. As a result, the broadcast BOOTP/DHCP packet will not be forwarded by the XP.

Recommended Action:

No action is necessary if you don't want the Relay Agent to forward BOOTP/DHCP broadcast packets to an IP helper address. If you want the packet to be forwarded, then you need to configure an IP helper address for that interface.

%RELAY-I-PACKET BOOTP <?> (<?>) received at interface <interface>

Explanation:

The XP received a BOOTP request or reply packet. The packet's giaddr IP address, whether it is a request or reply and whether it is a broadcast or unicast packet, is displayed.

Recommended Action:

Informational message. No action necessary.

Error Messages

%IPHELPER-E-DUPHELPER Duplicate helper address < IP_address >

Explanation:

This error message appears when the user attempts to assign a helper address to an interface with which the same helper address has already been assigned.

Recommended Action:

Assign a different helper address to the interface.

%IPHELPER-E-NOSUCHIF No such interface: <interface_name>

Explanation:

This error message appears when the user specifies a helper address for a nonexistent interface.

Recommended Action:

Specify a helper address on an existing interface.

Chapter 26

IPC (WAN) Error Messages

This chapter describes the error messages for the IPC facility used by the WAN software.

Warning Messages

%IPC-W-MODFAIL Remote module *<number>* failed *(<n>* times)... attempting hotswap

Explanation:

This message is displayed when the XP detects a failure with a WAN module and attempts to restart it via hotswap.

Recommended Action:

If necessary, contact Enterasys Technical Support and furnish them with the crash dump of the WAN image.

Note: The first three times the XP detects a failure with a WAN module, it will attempt to automatically restart via hotswap. After the third time, you must manually conduct a hotswap to attempt resuming contact with the failed WAN module.

Error Messages

%IPC-E-MALLOCFAIL Failed to allocate memory for <message>

Explanation:

This message is displayed when the XP is not able to allocate memory. The reason could be that the system does not have enough memory to support the configuration. (For example, the number of interfaces configured.)

Recommended Action:

Try removing some configuration entries (delete some interfaces). If problem persists, contact Enterasys Technical Support.

%IPC-E-MODFAIL Too many remote module *<number>* failures (*<n>* times)

Explanation:

This error message is displayed when the XP detects a failure with a particular WAN module more than three times.

Recommended Action:

Try hotswapping the WAN module to resume communication. If that does not solve the problem, contact Enterasys Technical Support.

%IPC-E-SENDFAIL Failed to send msg with error < number >

Explanation:

This is an internal error. This may affect the functionality of the system.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 27

IPX Protocol Error Messages

This chapter describes the error messages for the IPX Protocol facility.

Informational Messages

%IPX-I-BUFFERSSUCC Allocated buffer size of %lu for %s.

Explanation:

This message is displayed when the IPX task successfully allocates socket buffers.

Recommended Action:

Informational message. No action necessary.

%IPX-I-IPXSTATCLEAR IPX Statistics cleared.

Explanation:

This message is displayed when the IPX statistics information is cleared.

Recommended Action:

Informational message. No action necessary.

%IPX-I-RIPPACKPERITER Rip packets per iteration changed to %d.

Explanation:

This message is displayed when the maximum RIP packets to be processed limit is set.

Recommended Action:

Informational message. No action necessary.

%IPX-I-RIPREQPACKPERITER Rip request packets per iteration changed to %d.

Explanation:

This message is displayed when the maximum RIP request packets to be processed limit is set.

Recommended Action:

Informational message. No action necessary.

%IPX-I-SAPGNSPACKPERITER Sap gns packets per iteration changed to %d.

Explanation:

This message is displayed when the maximum SAP GNS packets to be processed limit is set.

Recommended Action:

Informational message. No action necessary.

%IPX-I-SAPPACKPERITER Sap packets per iteration changed to %d.

Explanation:

This message is displayed when the maximum SAP packets to be processed is set.

Recommended Action:

Informational message. No action necessary.

Error Messages

%IPX-E-BUFFERSFAIL <3> Could not allocate buffer size of %lu for %s. Error = %d.

Explanation:

This message is displayed when the desired buffer size could not be allocated.

Recommended Action:

Reduce the size of the buffers requested and try again.

%IPX-E-CLRTEGFAIL NUE_Set_TEG_Flag failed (0x%x).

Explanation:

This message is displayed when the CLR TEG call to the kernel fails.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-CNTRLTMRFAIL NU_Control_Timer failed (0x%x) for %s.

Explanation:

This message is displayed when the control timer call to the kernel fails.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ENOSOCKSIZEELEM No shadow socket size entry available

Explanation:

Internal allocation array is filled up.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ERIPCLINOMEM Cannot allocate memory for CLI

Explanation:

This message is displayed when IPX cannot allocate memory for CLI bulk print buffer.

Recommended Action:

If possible, remove some IPX entries to free up memory.

%IPX-E-ERIPIFSHAD Cannot allocate memory for shadow delete interface entry

Explanation:

This message is displayed when the XP cannot allocate memory for shadow delete interface structure.

Recommended Action:

If possible, remove some interfaces to free up memory.

%IPX-E-ERIPNOIFELEM No shadow delete interface entry available

Explanation:

This message is displayed when the XP cannot get a free slot in the shadow delete interface array.

Recommended Action:

Do not delete more than 10 interfaces combined for all the telnet sessions

${\bf \%IPX\text{-}E\text{-}ERIPNOSHOWELEM\ No\ shadow\ show\ entry\ available}$

Explanation:

This message is displayed when IPX cannot get a free slot in the shadow show entry array. There can be a maximum of 20 active shows combined from all the telnet session.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ERIPNOSTATRTELEM No shadow static route entry available

Explanation:

This message is displayed when IPX cannot allocate a slot in the static route entry array. There is a maximum of 64 static route entries allowed.

Delete static routes until there are 64 entries.

%IPX-E-ERIPSHOWSHAD Cannot allocate memory for shadow show entry

Explanation:

This message is displayed when IPX cannot allocate memory for shadow show entry.

Recommended Action:

If possible, remove some IPX entries to free up memory.

%IPX-E-ERIPSTATRTFAIL Cannot add static route; route add failed

Explanation:

This message is displayed when an add static route failed because of lack of memory.

Recommended Action:

If possible, remove some static routes to free up memory, or contact Enterasys Technical Support if you wish to upgrade memory.

%IPX-E-ERIPSTATRTINTF Cannot define static route for the interface route

Explanation:

This message is displayed when IPX cannot make the interface routes static.

Recommended Action:

Verify interface is a directly attached network. You cannot add a static IPX route for a directly attached network.

%IPX-E-ERIPSTATRTSHAD Cannot allocate memory for shadow static route entry

Explanation:

This message is displayed when IPX cannot allocate memory for shadow static route entry.

Recommended Action:

If possible, remove some static routes to free up memory.

%IPX-E-ERIPTEGFAIL '<string>': Set_TEG_Flag ret 0x<hex_number> event_flag <flag>

Explanation:

This message is displayed when IPX cannot set the task event group flag in the designation function.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ESAPNOMEM Cannot allocate memory for SAP entry

Explanation:

This message is displayed when the IPX task cannot allocate memory.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ESAPNOSTATSAPELEM No shadow static sap entry available

Explanation:

This message is displayed when the XP cannot get a free slot in the shadow static SAP entry array. You cannot add more than 64 static SAP entries.

Recommended Action:

Delete SAP entries until there are 64 entries.

%IPX-E-ESAPSTATSAPFAIL Cannot add static sap; sap add failed due to low memory

Explanation:

This message is displayed when the user attempts to add a static sap, but there is insufficient memory to accommodate such an addition.

Recommended Action:

Expand existing memory and try again. If situation persists, contact Enterasys Technical Support.

%IPX-E-ESAPSTATSAPSHAD Cannot allocate memory for shadow static sap entry

Explanation:

This message is displayed when the XP cannot allocate memory for shadow static SAP entry structure.

Recommended Action:

If possible, remove some SAP entries to free up memory.

%IPX-E-ESOCKSIZESHAD Cannot allocate memory for shadow socket size array

Explanation:

This message is displayed when the IPX task cannot allocate memory.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-ESOCKTEGFAIL <3> '%s' : Set_TEG_Flag ret 0x%x event_flag %lu

Explanation:

This message is displayed when the IPX task cannot set the TEG flag.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-INTMAXMCREATED Number of IPX interface created exceeds < number > allowed

Explanation:

The number of IPX interfaces has exceeded the maximum allowable.

Note: The XP supports a maximum of 64 IPX interfaces.

Recommended Action:

Create no more than the maximum allowable number of IPX interfaces.

%IPX-E-NOCHANNUM Invalid channel number -- < number >-

Explanation:

This message is displayed when a user inputs an invalid channel number (or the channel number does not refer a to slot that contains a line card).

Recommended Action:

Enter a valid channel number. A valid channel is numbered 0 through 7 and refers to a slot that contains a line card.

%IPX-E-NOIPXADDRCFG No IPX Interface configured for Port %s.

Explanation:

This message is displayed when the user tries to set Destination based forwarding mode on a port on which there is no IPX interface configured.

Recommended Action:

Configure an IPX interface before setting the port in destination based forwarding mode.

%IPX-E-NOMODULENUM Invalid module number -- %d.

Explanation:

This message is displayed when the user inputs an invalid module number or refers to a slot that does not contain a line card.

Recommended Action:

Enter a valid module number that contains a line card. The valid module number can be found by using the Enable mode command "system show hardware."

%IPX-E-RESETTMRFAIL NU_Reset_Timer failed (0x%x).

Explanation:

This message is displayed when the reset timer call to the kernel fails.

Recommended Action:

Contact Enterasys Technical Support.

%IPX-E-SETTEGFAIL NUE_Set_TEG_Flag failed (0x%x).

Explanation:

This message is displayed when the SET TEG call to the kernel fails.

Contact Enterasys Technical Support.

%IPX-E-WAITTEGFAIL Wait_For_TEG failed (0x%x).

Explanation:

This message is displayed when the TEG event call to the kernel fails.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 28

Layer 2 Table Manager Error Messages

This chapter describes the error messages for the Layer 2 Table Manager facility.

Informational Messages

%L2TM-I-CLI_ACK < command_name >

Explanation:

This message is displayed as acknowledgment of a successfully completed L2 configuration command (e.g. successful address filter registration).

Recommended Action:

Informational message. No action necessary.

Warning Messages

%L2TM-W-ADD_L2_ENTRY add L2 entry failed (<number>; port <port_name>; vlan <id>; mac <MAC_address>)

Explanation:

This message is displayed when a MAC address could not be added to a port's L2 table.

Recommended Action:

This occurs if ALL the MAC addresses in a port's L2 table are management entries not to be deleted, therefore preventing dynamically learned MACs from being installed.

%L2TM-W-ADD_L2_ENTRY_FLOW add L2 entry failed (<number>; port <port_name>; vlan <id>; src <mac_address> dst <mac_address>)

Explanation:

This message is displayed when a flow could not be added to a port's L2 table.

Recommended Action:

This occurs if ALL the FLOW is in a port's L2 table are management entries not to be deleted, therefore preventing dynamically learned flow from being started.

%L2TM-W-APS_CONFLICT Port (%s) inherited %s config. %s

Explanation:

This message is displayed to indicate that there is a conflict in the configuration.

Recommended Action:

APS ports should be in address-bridging mode (default for layer 2). Verify configuration.

%L2TM-W-APS_STATUS Port %s - already %s

Explanation:

This message is displayed when a port added to an APS is already a member of the APS.

Recommended Action:

Verify the configuration of the port in question.

%L2TM-W-BAD_PORT request to perform an action on an invalid port (Port %d; %s)

Explanation:

A software error occurred. This message is also displayed when you perform an action on a port that does not support the action or on a port that does not exist.

Recommended Action:

If the problem persists, contact Enterasys Technical Support. You may want to verify that the port affected by the command is actually in the system (i.e., they have not been hotswapped out) and that the port in question supports this action.

%L2TM-W-DMND_DEL L2 max table capacity reached: <name> cap<number> thr<number> src<number> dst<number> flw<number> mgt<number> (<number> >= <number>)

Explanation:

This message is displayed when a port's maximum L2 table capacity has almost been reached. Some MAC entries will automatically be deleted (CAPacity, THReshold, SouRCe MACs, DeST MACs, FLoWs, ManaGeMent MACs).

Recommended Action:

If this message is displayed frequently, you may need a board with higher table capacity or you may want to change the port's hash-mode (see **port set**). For further assistance, call Enterasys Technical Support.

%L2TM-W-FLOW_MISMATCH MAC table flow inconsistency (<name>; port <port_name>; vlan <id>; src <MAC_address>; dst <MAC_address>)

Explanation:

This message is displayed when the hardware and software views of the MAC tables are out of sync.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-HANDLE_BKTFULL bucket full-deletion failed (port <name>; vlan <id>; mac <MAC_address>)

Explanation:

This message is displayed when multiple MAC addresses map to the same hardware location. A request for one of the MACs to be removed can't be completed.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-INVALID_VLAN Port port_name receiving frames from non-member VLAN (<vlan_id>). Possible misconfiguration.

Explanation:

This message is displayed when a port is receiving frames corresponding to a VLAN of which it is not a member.

Recommended Action:

This is likely due to reception of 802.1Q tagged frames that are not configured for this port. Check your VLAN-to-port configuration. This may be an indication of a misconfigured network. To filter these messages, enter **stp set vlan-disable** in config mode.

%L2TM-W-L3ARP_TX send message to ARP MAC Move queue failed (<string> <number>)

Explanation:

This message is displayed when a send message to the ARP MAC Move queue failed.

Recommended Action:

This may be a temporary condition. Retry.

%L2TM-W-L4BDGCONFIG L4 bridging configuration error - <string>

Explanation:

This message is displayed when a non-IP/IPX packet was received and dropped.

Recommended Action:

Verify the configuration of the Layer 4 bridging VLAN.

%L2TM-W-L4BDGHDRERR L4 bridging L3 header error

Explanation:

This message is displayed when an error is detected in an IP/IPX packet header.

Recommended Action:

No action is required.

%L2TM-W-L4BDGL3QUE L4 bridging L3 miss queue error - <string>

Explanation:

This message is displayed when a packet is received from a VLAN which is not in Layer 4 bridging mode.

Recommended Action:

Verify the configuration of Layer 4 bridging VLANs.

%L2TM-W-L4BDGTBL L4 bridging MAC table error - <string>

Explanation:

This message is displayed when there is an error processing the MAC table lookup. See <string> for additional details.

Recommended Action:

Verify the configuration of the Layer 4 bridging VLANs.

%L2TM-W-MAC_MOVED mac **%04X:%04X:04X** moved (**%s --> %s**).

Explanation:

This message is displayed when the diagnostic command 12-tables start mac-moves is issued. These messages help the user determine the source of mac movement between ports.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-MAC_REG MAC address registration failed (%s)

Explanation:

This message is displayed when one of the parameters required to add a MAC address into a port's table is invalid.

Informational message. No action necessary. (these are not user requests to add MAC addresses).

%L2TM-W-MACTBL MAC table error - <string>

Explanation:

This message is displayed when a request to add or remove a MAC address from a port's L2 table failed.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-MALLOC malloc failed (<string>)

Explanation:

This message is displayed when an L2 request for memory failed. System is running out of memory.

Recommended Action:

Call Enterasys Technical Support.

%L2TM-W-MSG_RX L2 queue received unrecognized message (<number>)

Explanation:

This message is displayed when the L2 queue received an unrecognized request.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-MSG_TX send message to L2 queue failed (<string> - <number>)

Explanation:

This message is displayed when a send message to the L2 queue failed.

Recommended Action:

The queue may be temporarily full.

%L2TM-W-RMON_TX send message to RMON queue failed (%s - %d)

Explanation:

This message is displayed when debugging is turned on for RMON. This message indicates that there was a problem sending data to the Queue used to send RMON updates to the external management system.

Recommended Action:

Capture information displayed and contact Enterasys Technical Support.

%L2TM-W-ST_CONFLICT Port (<name>) inherited SmartTRUNK config <config name>.

Explanation:

This message is displayed when a port has been added to a Smart Trunk.

Recommended Action:

Informational message. No action necessary. (This message is purely for the user's benefit.)

%L2TM-W-ST_PORT_SYNC Error while updating L2 table of new %s port

Explanation:

This message is displayed while synchronizing ports in a link group. If any problem occurs during the synchronization, this message will be displayed.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-ST_STATUS Port %s - %s is already %s

Explanation:

This message is displayed when a port added to a smarttrunk is already a member of the smarttrunk.

Recommended Action:

Verify the configuration of the smarttrunk.

%L2TM-W-STATION_MOVE MAC addresses are moving between port <port_name> and other port(s). Possible loop.

Explanation:

This warning message is displayed when one or more MAC addresses that had previously been learned on one port have now been learned on a different port.

Recommended Action:

If a cable has been moved from one port to another, or if there have been recent spanning-tree topology changes, then you can ignore this message. However, if this message is displayed repeatedly, a loop may exist requiring you to enable spanning-tree.

Explanation:

This message is displayed when the hardware and software views of the MAC tables are out of sync.

Recommended Action:

Informational message. No action necessary.

%L2TM-W-VLANID VLAN Id %d does not exist.

Explanation:

This warning is displayed when a filter or static entry is applied for a vlan that does not exist.

Recommended Action:

Verify that the vlan configuration is correct for the network, then retry the command.

%L2TM-W-WANNOTALLOWED L2 filtering on vc is not supported

Explanation:

This message is displayed when an action is requested on a WAN port that is not supported.

Recommended Action:

Verify configuration.

Error Messages

%L2TM-E-CREATE_TMR timer creation failed (retCode <number>)

Explanation:

This message is displayed when, during initialization (system boot), the L2 task could not create a timer resource (used to age-out MAC addresses).

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

%L2TM-E-DMND_DEL could not remove enough entries from L2 table (port <port_id>)

Explanation:

This message is displayed when a port's table is almost full. Some MAC addresses were automatically removed. However, not enough entries were found (more entries were expected).

Recommended Action:

The software and hardware view of the MAC tables may be out of sync. If this message displays repeatedly, contact Enterasys Technical Support.

%L2TM-E-FLOW_HW Attempt to enable flow bridging mode in a prototype module/port failed (%s).

Explanation:

This message is displayed when attempting to enable flow bridging mode on a module that doesn't support flow bridging mode.

Recommended Action:

Upgrade the hardware or do not specify flow bridging mode.

%L2TM-E-FLT_CONFLICT <string>

Explanation:

This message is displayed when multiple L2 filters have been configured and there are conflicts between 2 of them (contradictory configuration).

The message informs you of the conflicting parameters. Please modify the configuration accordingly.

%L2TM-E-FLT_INVALID <string>

Explanation:

This message is displayed when an L2 filter was successfully configured but later, when the filter was being applied to traffic that matched the requirements, not all the filtering information was found.

Recommended Action:

Negate and then re-enter the L2 filter command. If problem persists, contact Enterasys Technical Support.

%L2TM-E-FLT_MAC invalid MAC address while specifying L2 filter

Explanation:

This message is displayed when one of the MAC address parameters required to register an L2 filter is invalid.

Recommended Action:

Save a copy of your configuration file and send it to Enterasys Technical Support.

%L2TM-E-GET_SEMA4 failed acquiring sema4 (retCode <number>)

Explanation:

This message is displayed when the lock used to guarantee the integrity of the MAC address table could not be acquired/set.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%L2TM-E-PORT_CLEANUP unsuccessful port cleanup (p <name> src <number> dst<number> flow<number> mgt<number>)

Explanation:

This message is displayed when a port was hot-swapped (out) and not all of its related information could be successfully removed.

Informational message. No action necessary.

%L2TM-E-REL_SEMA4 failed releasing sema4 (retCode <number>)

Explanation:

This message is displayed when the lock used to guarantee the integrity of the MAC address table could not be released.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%L2TM-E-ST_CONFLICT failed adding port (<port_name>) to SmartTRUNK <smart trunk>

Explanation:

This message is displayed when adding a port to a Enterasys fails.

Recommended Action:

Verify the port being added to a SmartTRUNK.

%L2TM-E-START_TMR failed to start timer 0x<hex_number> (retCode <number>)

Explanation:

This message is displayed when, during initialization (system boot), the L2 task could not start a timer (used to age-out MAC addresses).

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

%L2TM-E-STNOTFOUND SmartTRUNK st.<number> not found

Explanation:

This message is displayed when the user attempts to specify a particular Smart Trunk port that the XP cannot identify.

Recommended Action:

Verify that the specified port is actually part of a SmartTRUNK.

%L2TM-E-WANNOTALLOWED L2 filtering on vc is not supported

Explanation:

This message is displayed when an L2 static entry is configured on a WAN port per VC. Filters on WAN port VCs are not supported.

Recommended Action:

This feature (static entry) cannot include a WAN VC as a parameter.

Fatal Errors

%L2TM-F-CREATE_Q failed creating queue <string> (retCode <number>)

Explanation:

This message is displayed when, during initialization (system boot), the L2 task could not create a queue resource (used to receive MAC addresses during learning).

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

%L2TM-F-CREATE_SEMA4 failed creating sema4 (retCode <number>)

Explanation:

This message is displayed when, during initialization (system boot), the L2 task could not create a semaphore resource used to maintain the integrity of the MAC tables

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

%L2TM-F-REG_LRN failed registering L2-learning with NI

Explanation:

This message is displayed when, during initialization (system boot), the L2 task could not register to receive frames for learning.

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

Chapter 29

Layer 3 Aging Error Messages

This chapter describes the error messages for the Level 3 Aging facility.

Error Messages

%L3AGE-F-EVWAIT event wait failed with error '%d'

Explanation:

This message appears when the L3 aging task event wait failed due to system resource problems.

Recommended Action:

System will reboot. If problem persists, contact Enterasys Technical Support.

%L3AGE-F-TMRCREATFAIL timer creation failed with error '%d'

Explanation:

This message appears when the timer for the L3 aging task could not be created due to limited system resources

Recommended Action:

Increase system memory or contact Enterasys Technical Support to resolve the problem.

%L3AGE-F-TMRSTARTFAIL failed to start timer '0x%x', error '%d'

Explanation:

This message appears when the timer for the L3 aging task could not be started due to limited system resources

Recommended Action:

Increase system memory or contact Enterasys Technical Support to resolve the problem.

Chapter 30

Load Balance Error Messages

This chapter describes the error messages for the Load Balance facility.

Informational Messages

%LOADBAL-I-AGINGTIMER Load Balance Client-Server mappings aging timer set to <number of minutes> minutes

Explanation:

The aging timer for client-server mappings is set to the specified number of minutes.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-APPDOWN Host status change detected: applications on port port num> of <server IP> belonging to group group name> is down

Explanation:

The operational state of the specified application on the server has been set to down.

Recommended Action:

%LOADBAL-I-APPUP Host status change detected: applications on port port num> of <server IP> belonging to group group name> is up

Explanation:

The operational state of the specified application on the server has been set to up.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-CHGPOLICY Load Balance policy changed to <new policy> from <old policy> for group <group name>

Explanation:

The policy for distributing workload on load-balancing servers is changed for the specified group.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-CLADDGRPACC <*Client ipaddr/ipaddr range*> added to access list of group <*group name*>

Explanation:

The specified address or address range is added to the list of hosts that are allowed to access the load balancing server group without address translation.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-CLREMGRPACC <*Client ipaddr/ipaddr range>* removed from access list of group <*group name>*

Explanation:

The specified address or address range has been removed from the list of hosts that are allowed to access the load balancing server group without address translation.

Recommended Action:

%LOADBAL-I-FTPCONTROL FTP Control port set to *<port number>* for load balancing

Explanation:

The FTP control port is set to the specified port number.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-GRPCREATED Group *<group name>* successfully created with virtual IP *<ipaddr>* and port *<virtual port number>*

Explanation:

The load balancing group is created with the specified virtual IP address and virtual port number.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-GRPDELETED Load Balancing group *<group name>* **deleted successfully**

Explanation:

The specified load balancing group was deleted.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-HOSTADDED Host <ipaddr> with port successfully added to group group name>

Explanation:

The specified server was added to the load balancing group.

Recommended Action:

%LOADBAL-I-HOSTDELETED Host <ipaddr> successfully deleted from group <*group name>*

Explanation:

The specified server was deleted from the load balancing group.

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-HOSTDOWN Host Status Change Detected: <ipaddr> belonging to group group name> is Down

Explanation:

The operational status of the specified server in the load balancing group has been set to 'down.'

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-HOSTUP Host Status Change Detected: <ipaddr> belonging to group group name> is Up

Explanation:

The operational status of the specified server in the load balancing group has been set to 'up.'

Recommended Action:

Informational message. No action necessary.

%LOADBAL-I-SETVARIANT Load Balance Mappings Hash Index variant set to variant <new variant> from <old variant>

Explanation:

The hash variant for calculating the load balancing mappings index is set to the new variant number.

Recommended Action:

%LOADBAL-I-VPNDEST VPN destination port set to *<port_num>* for Load Balancing

Explanation:

VPN groups will now need to use this port.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%LOADBAL-W-ADMINALREADYDOWN Host < ipaddr> with port < port number> in group < group name> is already marked down by admin

Explanation:

The specified server has already been set to 'down' admin status.

Recommended Action:

No action necessary.

%LOADBAL-W-ADMINALREADYUP Host <*ipaddr*> with port <*port number*> in group <*group name*> is already marked up by admin

Explanation:

The specified server has already been set to 'up' admin status.

Recommended Action:

No action necessary.

%LOADBAL-W-HOSTSTATE Incoming packets for group *<group name>* being dropped. Due to their current state, no destination host could be selected.

Explanation:

This warning message is displayed when all servers in the load balancing group are either set to 'down' admin status or are not responding.

Use the **load-balance show virtual-hosts** command to check the status of the servers in the group. Set the admin status of servers to 'up.' Make sure servers are running.

%LOADBAL-W-NOHOSTSADDED Incoming packets for group <*group name>* being dropped. No servers have been added to group <*group name>*

Explanation:

Clients are trying to access the virtual address and port number of the load balancing group, but there are no servers in the group to which the XP can redirect the client requests. The load balancing group has been created but no servers have been added to the group.

Recommended Action:

Add servers to the specified group with the **load-balance add host-to-group** or **load-balance add host-to-vip-range** commands.

Error Messages

%LOADBAL-E-ACCLSTEXISTS Access List still exists for group *<group name>*. Please remove access list of group before proceeding

Explanation:

You attempted to remove the group, but an access list exists for the group.

Recommended Action:

Remove the access list for the group first before removing the group.

%LOADBAL-E-GRPNAMEUSED

Group name < group name > is already used Implicit to be generated group name < group name > is already used

Explanation:

You attempted to create a group name that already exists. When using the load-balance create viprange-name command to create groups, note that separate server groups for each virtual IP address in the range are implicitly created.

Recommended Action:

Use the **load-balance show virtual-hosts** command to see the created groups.

%LOADBAL-E-HOSTEXISTS Destination hosts still exist for group <*group name>*. Please remove them from the group before proceeding

Explanation:

You attempted to delete a group or range before removing the hosts from the group or range.

Recommended Action:

Use the negate command to remove hosts from the group or range first before deleting the group or range.

%LOADBAL-E-HOSTINLIST Host <ipaddr> with port <port number> is already added to group group name>

Explanation:

You attempted to add a server that has already been added to the same group.

Recommended Action:

Use the **load-balance show virtual-hosts** command to see the created groups and the servers that belong to those groups.

%LOADBAL-E-ILLEGALRANGE Illegal range. Please try again.

Explanation:

You specified an illegal IP address range. The range must be in the form 10.10.1.1-10.10.1.3.

Recommended Action:

Check the syntax of the IP address range you specified.

%LOADBAL-E-INVALIDPORT

Cannot create a Virtual IP range on port 20 (ftp data port) Cannot create a group on port 20 (ftp data port) Cannot add a host with port 20 (ftp data port)

Explanation

Port number 20 is the FTP data port and cannot be specified as the virtual port number for a group or virtual IP range, or the port for a server.

Recommended Action:

Specify a port number other than 20.

%LOADBAL-E-IPINACCLIST Client IP already in access list

Explanation:

You specified an IP address with the load-balance allow access-to-servers command that had already been specified.

Recommended Action:

Check the IP address.

%LOADBAL-E-IPNOTINACCLIST specified IP addresses not found in access list of group <*group name*>

Explanation:

The access list for the group was removed or does not exist.

Recommended Action:

Use the **load-balance allow access-to-servers** command to specify the hosts that are allowed to access a group without address translation.

%LOADBAL-E-MAXVIPRANGE Cannot create a range with more than 254 Virtual IP's. Please try again with a lesser range.

Explanation:

A virtual IP address range cannot have more than 254 addresses. You can, however, create two or more separate virtual IP address ranges.

Recommended Action:

Specify a virtual IP address range of less than 254 addresses.

%LOADBAL-E-MSG Load Balance - < module > - memory allocation error

Explanation:

A memory allocation error occurred in the specified module.

Recommended Action:

%LOADBAL-E-NEEDACVREPLY Please specify an 'act-reply' to be checked for the 'acv-command'

Explanation:

While setting up the application checking options, the 'acv-command' was specified without specifying an "acv-reply.'

Recommended Action:

Try the command again and this time also specify the expected response from the server with the 'acv-reply' option.

%LOADBAL-E-NEEDPORT Host without a port cannot be added to a group associated with a specific port

Explanation:

You attempted to add a host without a port number to a load balancing group that has a port specified.

Recommended Action:

Specify a port number for the host you are adding to the group.

%LOADBAL-E-NEEDWILDPORT<0> <1> %s

Explanation:

While assigning a persistence-level of 'sticky' when creating a group, the user also specified the 'virtual-port' options. The 'sticky' persistence-level only works with Wildcard groups.

Recommended Action:

Try the command again without specifying the 'virtual-port' option while creating the group.

%LOADBAL-E-NOACVOPT4UDP Application Content Verification options cannot be set for UDP groups or their servers

Explanation:

ACV options cannot be set for UDP groups or their servers.

Recommended Action:

%LOADBAL-E-NOACVOPT4WILD Application Content Verification options cannot be set for Wildcard groups or their servers

Explanation:

ACV options cannot be set for wildcard groups or their servers.

Recommended Action:

Contact Enterasys Technical Support.

%LOADBAL-E-NOCHGFTPPORT Cannot change FTP Control port. FTP load balance group exists on port *port number>*

Explanation:

You created a group on the FTP control port. The FTP control port cannot be changed unless the group is removed first.

Recommended Action:

Remove the group before changing the FTP control port. Or, do no change the FTP control port.

%LOADBAL-E-NOCHGVPNPORTCannot change VPN Destination port. VPN load balance group exists on port cport_num>

Explanation:

The user previously created a group with persistence-level of 'VPN'.

Recommended Action:

Delete the group on the specified port number to be able to proceed.

%LOADBAL-E-NOFTPDATAGRP The Corresponding FTP data group of *<group name>* could not be found

Explanation:

You created a group on the FTP control port, which implicitly creates the FTP data group. However, the FTP data group cannot be found.

Recommended Action:

%LOADBAL-E-NOPORT Host with a port cannot be added to a group unassociated with ports

Explanation:

You attempted to add a host with a port number to a load balancing group that does not have a port specified.

Recommended Action:

Do not specify a port number for the host you are adding to the group.

%LOADBAL-E-NOSETOPTFTPDATAGRP Cannot set *<option>* for FTP data group. Set it for the corresponding FTP control group.

Explanation:

You created a group on the FTP control port, which implicitly created the FTP data group. You can only set options for the group on the FTP control port.

Recommended Action:

Specify the group name on the FTP control port.

%LOADBAL-E-NOSUCHGRP No such load-balance group *<group name>* exists

Explanation:

You specified a nonexistent load balancing group when adding servers to a group, specifying access lists, etc.

Recommended Action:

Use the **load-balance show virtual-hosts** command to see the created groups.

%LOADBAL-E-NOSUCHHOST Host < ipaddr> with port < port number> is not in server list of group < group name>

Explanation:

You attempted to either set the status of a server that does not belong to a load balancing group, delete a server that has already been deleted, or delete a server that was never added to a group.

Recommended Action:

Use the **load-balance show virtual-hosts** command to see the created groups and their servers.

%LOADBAL-E-NOSUCHVIPRANGE No such Virtual IP range name < vip range name >

Explanation:

You specified a nonexistent virtual IP range name when adding servers to groups, specifying access lists, etc.

Recommended Action:

Check the configuration for the specified virtual IP range name.

%LOADBAL-E-OPTSET4GRP < option name > already set for group < group name >. Please negate that command before proceeding

Explanation:

The specified option was already set to a certain value in a previous command.

Recommended Action:

Negate that command before proceeding.

%LOADBAL-E-OPTSET4SER *<option name>* already set for server *<ip of server>* on port *port num>*.Please negate that command before proceeding

Explanation:

The specified option was already set to a certain value in a previous command.

Recommended Action:

Negate that command before proceeding.

%LOADBAL-E-REMACVOPT4GRP Please remove the ACV options of Group <*group name*> before proceeding

Explanation:

The user modified the ACV options from their defaults and now wishes to delete that group.

Recommended Action:

Negate the ACV command before for that group before proceeding.

%LOADBAL-E-REMACVOPT4SER> Please remove the ACV options of Host *<ip of server>* with port *<port num>* before proceeding

Explanation:

The user modified the ACV options from their defaults and now wishes to delete that server.

Recommended Action:

Negate the server-ACV command for that server before proceeding.

%LOADBAL-E-REMOVEPOLICY Policy has been changed for group <*group name*>. Please remove that command before proceeding

Explanation:

You changed the load-balancing policy from the default policy for the specified group. You cannot remove the group unless the policy configuration command is removed first.

Recommended Action:

Remove the policy command before removing the group.

%LOADBAL-E-SAMEPOLICY Load Balance policy is already set to policy name>

Explanation:

You attempted to set the policy for distributing workload on the load balancing servers, but the specified policy was already in effect.

Recommended Action:

No action necessary.

%LOADBAL-E-SAMEVARIANT Load Balance Mappings Hash Index variant is already set to variant hash variant number>

Explanation:

You attempted to set the hash variant for calculating load-balancing mappings index, but the specified hash variant was already in effect.

Recommended Action:

No action necessary.

%LOADBAL-E-SPLITHOSTS Cannot add more than *limit>* hosts in one command. Please split them up

Explanation:

You need to use more than one command in order to add more hosts to the group. Note that this does *not* mean that no more hosts can be added to the group; you will need to use more than one command to add the hosts.

Recommended Action:

Use multiple commands to add hosts to the group.

%LOADBAL-E-STRINGTOOBIG Virtual IP range name is too big. With specified range, the range name can be only *<number>* characters.

Explanation:

The specified range name becomes the *base* group name; thus, the range name 'myrange' becomes the groups 'myrange1,' 'myrange2,' etc., for each virtual address in the specified range. Depending upon the number of virtual addresses in the range, one to three additional digits are appended to the base group name.

Recommended Action:

Use a range name with fewer characters.

%LOADBAL-E-USESAMERANGE Please use the same range of IP's for the destination server's as the Virtual IP range.

Explanation:

The number of servers in the specified range is not the same as the number of virtual IP addresses. If you specified 15 virtual IP addresses with the **load-balance create vip-range-name** command, then you must specify a range of 15 IP addresses in the **load-balance add host-to-vip-range** command.

Recommended Action:

Specify a range of IP addresses that is a one-to-one mapping to the virtual IP addresses.

%LOADBAL-E-VIPPORTUSED Virtual IP <*ipaddr>* and Virtual Port <*port number>* combination is already used

Explanation:

You specified a virtual IP address and virtual port number combination that has already been created.

Use a different virtual IP address-virtual port number combination.

%LOADBAL-E-VIPRANGENAMEUSED Virtual IP range name < range name > is already used

Explanation:

You specified a vip-range-name that already exists.

Recommended Action:

Use the **load-balance show virtual-hosts** command to see the created groups.

Chapter 31

Multicast Traceroute Error Messages

This chapter describes the error messages for the Multicast Traceroute facility.

Error Messages

%MT-E-NOINTERFACES No interfaces present

Explanation:

This message appears when there are no interfaces present in the switch

Recommended Action:

Create an interface so that the mtrace packet can be transmitted.

%MT-E-NOMEM processing error - insufficient memory

Explanation:

This message appears when unable to allocate memory.

Recommended Action:

This error is due to lack of resources. Contact Enterasys Technical Support.

Chapter 32

Mirroring Error Messages

This chapter describes the error messages for the Mirroring facility.

Informational Messages

%MIRRORING-I-MIRROR_INFO Mirroring on port <monitor-port> for <target-port> is enabled or disabled

Explanation:

This message indicates whether port mirroring has been enabled or disabled for the specified port.

Recommended Action:

Informational message. No action required.

Warning Messages

%MIRRORING-W-GCASTRLSE Cannot release gcast entry %d

Explanation:

This message is displayed when the group cast index cannot be released.

Contact Enterasys Technical Support.

%MIRRORING-W-L2APIFAIL Cannot mirror existing L2 traffic

Explanation:

This message is displayed when the Layer 2 traffic cannot be mirrored.

Recommended Action:

Check the mirrored/target port for correctness. Also if the port is already being mirrored, the above message will be displayed.

Error Messages

%MIRRORING-E-IPONLY ACL '%s' is a non-IP ACL. Only IP ACLs can be applied to flow mirroring

Explanation:

This message is displayed when the ACL specified is a non-IP ACL.

Recommended Action:

Non-IP ACLs cannot be used in flow mirroring.

%MIRRORING-E-MONITORING_SET %s '%s' is already being monitored

Explanation:

This message is displayed when the target port is already being monitored.

Recommended Action:

Check to make sure that the target port specified is not already being monitored.

%MIRRORING-E-MONITORPORT Port '%s' is a monitor port, cannot monitor a monitor port

Explanation:

This message is displayed when the monitor port specified is itself being monitored.

Disable monitoring on the desired port and then execute the command.

%MIRRORING-E-NO_CMTS_MIRRORING Port mirroring not allowed on cmts ports

Explanation:

This message is displayed when a CMTS port is specified as a monitor port.

Recommended Action:

Do not use a WAN/CMTS/POS port to monitor.

%MIRRORING-E-NO_POS_MIRRORING Port mirroring not allowed on SONET ports

Explanation:

This message appears when a POS port is specified as a monitor port.

Recommended Action:

Do not use a WAN/CMTS/POS port to monitor.

%MIRRORING-E-NO_WAN_MIRRORING Port mirroring not allowed on wan ports

Explanation:

This message is displayed when a WAN port is specified as a monitor port.

Recommended Action:

Do not use a WAN/CMTS/POS port to monitor.

%MIRRORING-E-NORULE Rule '%s' does not exist, cannot %s a non-existent rule

Explanation:

This message is displayed when the ACL name specified could not be found.

Recommended Action:

Check the ACL name for correctness.

Chapter 33

Multicast Error Messages

This chapter describes the error messages for the Multicast facility.

Error Messages

%MULTICAST-E-BADADDR Bad Address: '%s'

Explanation:

This message is displayed if the IP address specified does not correspond to a configured interface.

Recommended Action:

Verify the interface IP address.

%MULTICAST-E-BADGRP Bad Group Address: '%s'

Explanation:

This message is displayed if the multicast group specified is not a valid Group D address, for example, 224.0.0.0 to 239.255.255.255.

Recommended Action:

Verify the Group IP address.

%MULTICAST-E-IFNOTFOUND <interface ip_address/name>: no such interface address

Explanation:

This message appears when a nonexistent multicasting interface name or IP address has been specified.

Recommended Action:

Verify IP address and name.

%MULTICAST-E-MEMORY Could not allocate memory

Explanation:

This message is displayed when multicast service is unable to allocate system memory.

Recommended Action:

Contact Enterasys Technical Support.

%MULTICAST-E-NOCHILD Unable to create '%s' task

Explanation:

This message is displayed when the system is unable to create the DVMRP task.

Recommended Action:

Contact Enterasys Technical Support.

%MULTICAST-E-NOIGMP Igmp Not Running

Explanation:

This message is displayed when the DVMRP task is not running.

Recommended Action:

Verify DVMRP service.

%MULTICAST-E-SYSERR System Error in setting Static Group

Explanation:

This message is displayed when an internal system error occurred while trying to configure a static group.

Contact Enterasys Technical Support.

%MULTICAST-E-VPORT Port Not in Vlan: '%s'

Explanation:

This message is displayed when the port specified does not belong to the corresponding interface's VLAN.

Recommended Action:

Verify specified port.

Chapter 34

NAT Error Messages

This chapter describes the error messages for the Network Address Translation (NAT) facility.

Informational Messages

%NAT-I-CLNDYN Please wait while NAT removes the bindings and cleans up the existing NAT flows for these bindings...

Explanation:

NAT is removing the bindings and the flows for this dynamic binding.

Recommended Action:

Informational message. No action necessary.

%NAT-I-DYNCR NAT Dynamic binding created for local-acl: <acl_name> and global pool

Explanation:

A dynamic address binding has been created with the specified local ACL pool and the global pool.

Recommended Action:

%NAT-I-DYNRM NAT Dynamic binding removed for local-acl: <acl_name> and global pool

Explanation:

Dynamic address binding is removed with the negation of the dynamic binding command.

Recommended Action:

Informational message. No action necessary.

%NAT-I-DYNSESSTO Dynamic session time out for NAT set to: <value> (min)

Explanation:

The time-out for dynamic address bindings is set to the specified value.

Recommended Action:

Informational message. No action necessary.

%NAT-I-FLOWAGING NAT flow aging time-out is set to: <value> (min)

Explanation:

Flow aging for NAT is set to the specified value.

Recommended Action:

Informational message. No action necessary.

%NAT-I-FTPPRT FTP port for NAT set to:

Explanation:

The FTP control port for NAT is set to the specified value.

Recommended Action:

Informational message. No action necessary.

%NAT-I-FTPTO FTP session time-out for NAT set to: <value> (min)

Explanation:

The FTP session time-out for NAT is set to the specified value.

Informational message. No action necessary.

%NAT-I-INITDYN Please wait while NAT dynamic initializes the dynamic pools and cleans up any existing flows...

Explanation:

NAT is initializing the dynamic binding.

Recommended Action:

Informational message. No action necessary.

%NAT-I-STCR NAT Static binding created between local-ip: <ip_address> and global-ip: <ip_address> with protocol:

Explanation:

A static address binding has been created between the specified local and global addresses with the specified protocol (IP, TCP, or UDP).

Recommended Action:

Informational message. No action necessary.

%NAT-I-STRM NAT Static binding removed between local-ip range: <ip_address-ip_address:port(if any)> and global-ip range: <ip_address-ip_address:port(if any)> with protocol:

Explanation:

Static address binding is removed.

Recommended Action:

Informational message. No action necessary.

Error Messages

%NAT-E-COMPILE NAT support was not included at compile time.

Explanation:

NAT is not supported in this release.

Contact Enterasys Technical Support.

%NAT-E-DYNGBLLSTMAL NAT AllocateGlobalList - malloc error

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%NAT-E-DYNGBLTOLCL The Global pool does not correspond to the Local acl pool: <acl_name> it is binded for

Explanation:

The global pool that the user specified does not correspond to the local pool.

Recommended Action:

Check the correspondence of the local ACL pool and the global pool.

%NAT-E-DYNGBLUSED Given global IP is already being used with Local Acl pool <acl_name>

Explanation:

The global address pool is already defined for dynamic address binding with the specified ACL.

Recommended Action:

Specify a different global address pool for dynamic address binding with the specified ACL.

%NAT-E-HWCOMP Slot: <slot_number> is not NAT compliant

Explanation:

The hardware detected for the slot is not NAT compliant. New hardware is required for NAT.

Recommended Action:

%NAT-E-IFBOUND Could not get the modules for interface: <interface_name>

Explanation:

NAT could not get the modules attached to this interface.

Recommended Action:

Contact Enterasys Technical Support.

%NAT-E-IFHWCOMP Slot: <slot_number> of interface: <interface_name> is not NAT compliant

Explanation:

The slot of the interface has a line card which is not NAT compliant. New hardware is needed for NAT.

Recommended Action:

Contact Enterasys Technical Support.

%NAT-E-IFPRTDSTBASED The interface: <interface_name> has port: <port_number> of slot: <slot_number> which is set to destination based routing. This is not allowed with NAT

Explanation:

Destination based routing ports are not allowed with NAT.

Recommended Action:

Remove destination based routing from the port.

%NAT-E-IFPRTHSTMODE The interface: <interface_name> has port: <port_number> of slot: <slot_number> which is set to destination based routing. This is not allowed with NAT

Explanation:

Destination based routing ports are not allowed with NAT.

Recommended Action:

Remove destination based routing from the port.

%NAT-E-IPADDRMSK Not a valid address (broadcast address)

Explanation:

The specified address is not a valid IP address.

Recommended Action:

Specify a valid IP address.

%NAT-E-IPLIST Not a valid IP list

Explanation:

The specified list of IP addresses is not valid.

Recommended Action:

Specify a valid IP list.

%NAT-E-LCLACLNF Local acl set: <acl> not found

Explanation:

The ACL specified for the local address pool does not exist.

Recommended Action:

Specify a valid ACL.

%NAT-E-LCLACLPROTO Local ACL's protocol should be IP

Explanation:

The ACL specified for the local address pool is not an IP ACL.

Recommended Action:

Specify an IP ACL.

%NAT-E-MATCHIF NAT found that the local acl is defined previously without any matching interface. This is not allowed with NAT dynamic

Explanation:

You can specify multiple global pools for the same local-acl pool if you have more than one connection to the Internet on different interfaces. You must specify the interface to be used in all the commands that use that local-acl pool.

Recommended Action:

Specify a matching interface in all the configuration commands that use this local-acl pool.

%NAT-E-MAXGBL %s

Explanation:

With NAT dynamic, you can specify a maximum of 64K global addresses.

Recommended Action:

Specify no more than 65536 global addresses.

%NAT-E-MAXOVRGBL %s

Explanation:

With NAT dynamic overload, you can specify a maximum of 255 global addresses.

Recommended Action:

Specify no more than 255 global addresses.

%NAT-E-NOSUCHIF Invalid interface: <interface_name>

Explanation:

The specified interface does not exist.

Recommended Action:

Specify a valid interface.

%NAT-E-SLOTEMP Slot: <slot_number> is empty

Explanation:

There is no line card in the slot.

Recommended Action:

Check the slot that you have specified.

%NAT-E-STLCLEXSITS A mapping for the local-ip already exists

Explanation:

The specified local address is already being used for a static address binding.

Recommended Action:

Specify a different local address for the static address binding.

%NAT-E-STLCLGBL IP address: <ip_address> found both in local and global

Explanation:

The same IP address is specified for both the local and global address binding.

Recommended Action:

Specify a different address for either the local or global address binding.

%NAT-E-STPRT Ports cannot be used with protocol ip

Explanation:

The local-port or global-port parameters can only be used if tcp or udp is specified for the protocol in this static address binding.

Recommended Action:

Specify either tcp or udp for the protocol for the static address binding.

%NAT-E-STRNG Range of local and global ip should be same

Explanation:

There are different numbers of IP addresses in the local and global ranges.

Recommended Action:

You need to give exactly the same number of IP addresses in the local and global ranges.

%NAT-E-STRNGMAX Range of local and global ip should be less than 5000

Explanation:

You cannot specify more than 5000 IP addresses in the range.

Recommended Action:

Reduce the range to 5000 or less.

Chapter 35

NetFlow Error Messages

This chapter describes the error messages for the NetFlow facility.

Informational Messages

%NETFLOW-I-START started NETFLOW Service

Explanation:

NetFlow has been started

Recommended Action:

Informational message, no action necessary.

%NETFLOW-I-STOP stopped NetFlow Service

Explanation:

NetFlow Service has been stopped.

Recommended Action:

Informational message, no action necessary.

%NETFLOW-I-UPDATE updated NetFlow Service

Explanation:

NetFlow configuration has been updated.

Recommended Action:

Informational message, no action necessary.

Warning Messages

%NETFLOW-W-NO_SEND Could not send NetFlow information to NetFlow collectors

Explanation:

Attempts were made to send the NetFlow information to a NetFlow server but failed.

Recommended Action:

Check your network connection via ping or traceroute.

%NETFLOW-W-WORK_CREATED worker thread already created

Explanation:

This messages indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

Error Messages

%NETFLOW-E-CALLBACK_FAIL callback failed

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-CREATE_TASK NUE_Create_Task failed: %s

Explanation:

This message indicates that a system error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-DECREASE_MEMORY NetFlow must be off before decreasing the NetFlow memory value

Explanation:

You cannot change the NetFlow memory configuration if NetFlow is enabled.

Recommended Action:

Negate or *comment out* "NetFlow enable" before you change the memory size. Then add or *comment in* "netflow enable."

%NETFLOW-E-DIS_TIMER unable to disable timer: %d

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-EN_TIMER unable to enable timer: **%d**

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-INVALID_STATE invalid state in work loop, ignored, netflow_status=%d mask=%x

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-NO_CALLBACK no callback for timer: %d

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-NO_SERVER cannot change configuration if a server is not configured

Explanation:

A NetFlow server was not configured.

Recommended Action:

Configure a server using the NetFlow set server command.

%NETFLOW-E-NO_START cannot start **NETFLOW** Service if a server is not configured

Explanation:

A NetFlow server was not configured.

Recommended Action:

Configure a server using the NetFlow set server command.

%NETFLOW-E-NO_TIMERS no timers available

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-RMONENABLED, Cannot start NetFlow Service if RMON Professional is set.

Explanation:

NetFlow cannot run as long as RMON Professional is set.

Recommended action:

Disable RMON or do not configure RMON Professional. You cannot configure NetFlow Service and RMON Professional together because RMON Professional clears counters that NetFlow monitors.

%NETFLOW-E-SET_TEG_FLAG NUE_Set_TEG_Flag failed for ProcessWork Event

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%NETFLOW-E-TIMER_FAIL NU_Create_Timer failed: %s

Explanation:

This message indicates that an internal error occurred.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 36

Netstat Error Messages

This chapter describes the error messages for the Netstat facility.

Error Messages

%NETSTAT-E-NLIST Unknown error during NLIST - please contact Technical Support

Explanation:

This message appears when an internal system error has occurred.

Recommended Action:

Contact Enterasys Technical Support for information.

%NETSTAT-E-NONLIST No NLIST found - please contact Technical Support

Explanation:

This message appears when an internal system error has occurred.

Recommended Action:

Contact Enterasys Technical Support for information.

%NETSTAT-E-RTDUMP Internal Error while dumping the route table dump

Explanation:

This message is displayed when an internal system error has occurred.

Recommended Action:

Contact Enterasys Technical Support for information.

%NETSTAT-E-RTDUMPALLOC Could not allocate *<number>* bytes for the route table dump

Explanation:

This message appears when an internal system error has occurred.

Recommended Action:

Contact Enterasys Technical Support for information.

%NETSTAT-E-RTDUMPSIZ Internal Error while estimating route table dump size

Explanation:

This message is displayed when an internal system error has occurred.

Recommended Action:

Contact Enterasys Technical Support for information.

Chapter 37

Network Interface Driver Error Messages

This chapter describes the error messages for the Network Interface Driver facility.

Error Messages

%NI-E-DIAGQ Couldn't create DIAGNOSTIC Queue, sts=0x<hex_number>, qptr=0x<hex_number>

Explanation:

This message appears when the system failed to allocate resources for a queue used in diagnostics.

Recommended Action:

Increase Control Module memory. If problem persists, contact Enterasys Technical Support.

%NI-E-FBQ Couldn't initialize Free Buffer Queue

Explanation:

This message appears when the system could not properly initialize the free buffer queue.

Recommended Action:

Contact Enterasys Technical Support to resolve the problem.

Warning Messages

%NI-W-BAD_PORT Tried to reassemble packets for a wrong port type

Explanation:

This message appears when the NI driver tries to reassemble packets from ports that do not support oversized packets.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%NI-F-BADPRIO bad priority '<number>' in request

Explanation:

This message appears when the Control Module encountered an unknown priority in one of the packets.

Recommended Action:

Contact Enterasys Technical Support.

%NI-F-FREEQFULL free buffer is unexpectedly full at priority '<number>'

Explanation:

This message appears when the network interface asic's (NIA) free buffer queue was corrupted.

Recommended Action:

Contact Enterasys Technical Support.

%NI-F-HISRFAIL failed to create driver HISR, sts=0x<hex_number>

Explanation:

This message appears when the system failed to allocate resources for interrupt handling routines.

Recommended Action:

Increase Control Module memory. If problem persists, contact Enterasys Technical Support.

%NI-F-LISRFAIL failed to register driver LISR, sts=0x<hex_number>

Explanation:

This message appears when the system failed to allocate resources for interrupt handling routines.

Recommended Action:

Increase Control Module memory. If problem persists, contact Enterasys Technical Support.

%NI-F-NOSTKMEM not enough memory to allocate HISR stack

Explanation:

This message appears when the system failed to allocate resources for interrupt handling routines.

Recommended Action:

Increase Control Module memory. If problem persists, contact Enterasys Technical Support.

%NI-F-QSENDFAIL queue send failed, sts=0x<hex_number>

Explanation:

This message appears when the Control Module was unable to send another packet due to a problem with the NIA send queue.

Recommended Action:

Contact Enterasys Technical support.

Chapter 38

NoSuppress (WAN) Error Messages

This chapter describes the error messages for the NoSuppress facility used by the WAN software.

Informational Messages

%NOSUPPRESS-I-DOWN frame-relay|ppp on port <port> is down

Explanation:

The specified port is operationally down. This could be due to no cable being connected, the port was disabled by the user, or the frame relay or PPP connection has been lost.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-MP_DOWN PPP on <bundle> is up

Explanation:

The specified MLP bundle has gone down. All of the ports in the bundle are closed.

Recommended Action:

%NOSUPPRESS-I-MP_UP PPP on <bundle> is up

Explanation:

The specified MLP bundle has been opened (i.e., negotiation successfully completed). At least one port in the bundle is opened.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-PPP_MP_PROTOCOL_DOWN IP|IPX on <bundle> is down

Explanation:

The specified PPP protocol has closed the connection for the specified MLP bundle.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-PPP_MP_PROTOCOL_UP IP|IPX on <bundle> is up

Explanation:

The PPP protocol has been opened (i.e., negotiations successfully completed) for the specified MLP bundle.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-PPP_PROTOCOL_DOWN IP|IPX|Bridging on port <port> is down

Explanation:

The specified PPP protocol has closed the connection for the specified port.

Recommended Action:

%NOSUPPRESS-I-PPP_PROTOCOL_UP IP|IPX|Bridging on port <*port>* is up

Explanation:

The specified PPP protocol has been opened (i.e. negotiation successfully completed) for the specified port.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-PPP_UNKNOWN_PROTOCOL_DOWN ppp protocol <number> on port port> is down

Explanation:

An unknown protocol with the given protocol number is down on the specified port.

Recommended Action:

Informational message. No action required.

Explanation:

An unknown protocol with the given protocol number is up on the specified port.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-UP frame-relay|ppp on port <port> is up

Explanation:

The specified port is operationally up. Either frame relay or PPP was able to establish a connection.

Recommended Action:

%NOSUPPRESS-I-VC_DOWN VC < number > on port < port > is down

Explanation:

The message appears when the specified VC on the port is down.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-VC_RANGE_DOWN VCs < number > through < number > on port < port > are down

Explanation:

The message appears when all of the VCs in the range have gone down. This takes the place of individual "down" messages for each VC.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-VC_RANGE_UP VCs < number > through < number > on port < port > are up

Explanation:

The message appears when all of the VCs in the range have come up. This takes the place of individual "up" messages for each VC.

Recommended Action:

Informational message. No action required.

%NOSUPPRESS-I-VC_UP VC < number > on port < port > is up

Explanation:

The message appears when the specified VC on the port is up.

Recommended Action:

Chapter 39

NTP Error Messages

This chapter describes the error messages for the NTP (Network Time Protocol) facility.

Informational Messages

%NTP-I-TIMESYNC Time synchronized to *<time>*

Explanation:

This message appears when the XP successfully synchronizes its clock with an NTP server when the user executes the **ntp synchronize** command.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%NTP-W-CNOTIMEZONE Time will not be set until timezone is configured; use 'clock timezone' to configure

Explanation:

This warning message appears when the user is in Common CLI mode and attempts to configure an NTP server without first configuring the local timezone.

Recommended Action:

Configure the local timezone in Common CLI mode using the Configuration mode command **clock timezone**.

%NTP-W-NOTIMEZONE Time will not be set until timezone is configured; use 'system set timezone' to configure

Explanation:

This warning message appears when the user attempts to configure an NTP server without first configuring the local timezone.

Recommended Action:

Configure the local timezone using the Configuration mode command system set timezone.

%NTP-W-UNKWNHOST Unknown host: <hostname>

Explanation:

This message appears when the XP is unable to resolve the NTP server's hostname.

Recommended Action:

Check to make sure you typed in the correct NTP server name or DNS is configured correctly to resolve the name.

Error Messages

%NTP-E-BADSRCIP No such interface address: <ip-address>

Explanation:

This message appears when the user specifies a source IP address for NTP requests that doesn't belong to any known interface address on the XP. The source IP address for NTP is configured using the **ntp set server source** command.

Recommended Action:

Make sure the source IP address is one of the XP's interfaces.

%NTP-E-CNOTIMEZONE Timezone is not set; use 'clock timezone' to configure

Explanation:

This message appears when the user is in Common CLI mode and the XP attempts to synchronize time with a NTP server but the local timezone information is not configured.

Recommended Action:

Configure the local timezone in Common CLI mode using the Configuration mode command **clock timezone**.

%NTP-E-NORESPONSE No response from NTP server

Explanation:

The XP is not getting a response from the NTP server to synchronize its clock.

Recommended Action:

Check to make sure the NTP server is reachable from the XP.

%NTP-E-NOTIMEZONE Timezone is not set; use 'system set timezone' to configure

Explanation:

This message appears when the XP attempts to synchronize time with a NTP server but the local timezone information is not configured.

Recommended Action:

Configure the local timezone using the Configuration mode command system set timezone.

%NTP-E-SETTIME Unable to set system time

Explanation:

This message appears in the following situations:

- If the XP receives an NTP response packet with invalid time information. This usually means that the server is not ready to synchronize time with a client. For example, the NTP server just started or lost its connection with its peer or its next NTP server.
- If the user inputs invalid timezone or time offset information using the Configuration mode command "system set timezone."

Recommended Action:

If this error occurred because the NTP server just started, wait a few minutes for the server to stabilize. The message should disappear once the NTP server is responding correctly. If this error occurred because of using the command "system set timezone," check to make sure that you entered valid timezone or time offset information.

%NTP-E-STRATUM Bad stratum < number>, NTP server not ready to synchronize

Explanation:

The XP received an NTP response with a bad stratum. This usually means that the server is not ready to synchronize time with a client, for example, the NTP server just started or lost its connection with its peer or its next stratum NTP server.

Recommended Action:

If this error occurs because the NTP server just started, wait a few minutes for the NTP server to stabilize. The message should disappear once the NTP server is responding correctly.

%NTP-E-UNKWNHOST Unknown host: %s

Explanation:

This message appears when the XP attempts to synchronize time with an NTP server but the XP is unable to resolve the NTP server's hostname.

Recommended Action:

Check to see that the correct NTP server name is entered and DNS is configured correctly.

%NTP-E-VERSION, NTP version '%d' not supported

Explanation:

The XP received an NTP response packet with an invalid version number (i.e., smaller than 1 or larger than 3). This may result from the NTP server starting or by a corrupted packet received during transmission.

Recommended Action:

Wait a few minutes for the server to stabilize or try a different NTP server. If the problem persists, contact Enterasys Technical Support.

Chapter 40

OSPF Error Messages

This chapter describes the error messages for the Open Shortest Path First facility.

Informational Messages

%OSPF-I-RECFG Reconfiguring the router to restart OSPF.

Explanation:

This message informs the user that the XP routing process is being reinitialized to reconfigure OSPF.

Recommended Action:

Informational message. No action required.

Error Messages

%OSPF-E-AREAEXISTS Area < area_name > already exists.

Explanation:

An OSPF area was defined multiple times (e.g. "area backbone" and "area 0.0.0.0")

Recommended Action:

Remove one of the extra area definitions.

%OSPF_E_AREAIFOVFL No memory for creating interface in area.

Explanation:

This error message is displayed when the command to add a OSPF interface failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-AREANOTFOUND Area < area name > is not a known area.

Explanation:

An OSPF command refers to an undefined area.

Recommended Action:

Modify the command so that it refers to an existing area, or create the undefined area.

%OSPF-E-AREAOVFL No more free areas max < number > current < number >

Explanation:

The maximum number of areas has been reached.

Recommended Action:

If possible, remove unused areas.

%OSPF-E-BACKBONENOTCFGNumber of areas (*<number>*) with valid config greater than 1 but there are no virtual links or backbone with valid configuration.

Explanation:

An OSPF virtual link has been configured. There must be at least 2 valid areas configured (backbone and one or more non-backbone areas).

Recommended Action:

Verify configuration of OSPF areas.

%OSPF-E-BBONEZEROINTFSZero interfaces (including virtual links) in backbone area.

Explanation:

No interfaces have been added into the backbone (0.0.0.0) area.

Recommended Action:

Add at least one interface to the backbone (0.0.0.0) area.

%OSPF-E-DESTEXISTS Destination *<name>* exists.

Explanation:

This message appears when someone tries to add an OSPF-Monitor destination that already exists.

Recommended Action:

If you want to change the authentication key associated with an existing destination, then delete the existing destination and add the destination again with the new key.

If you want to query an OSPF router with a different authentication key, then simply specify the destination and authentication-key with the **ospf-monitor** command.

%OSPF-E-DESTMALLOC Malloc failed for dest *<name>*.

Explanation:

The OSPF monitor command failed due to a memory allocation error.

Recommended Action:

Try the command again. If problem persists, contact Enterasys Technical Support.

%OSPF-E-EXIT OSPF task terminated at < number >

Explanation:

This error message appears when the XP terminates an OSPF task and is unable to automatically rectify the problem through reinitialization/reconfiguration.

Recommended Action:

Ensure that the OSPF task in question is valid; that OSPF has been enabled for the XP; and that the XP has an appropriate router identification number.

%OSPF-E-FLTCHKFAIL Problem with LSA hash (id=0x<hex_number> hash=0x<hex_number>) at <number>.

Explanation:

This error message appears when an OSPF Link State Advertisement fails its checksum validation.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF-E-HASHPROB Problem with LSA hash (id=0x<hex_number> hash=0x<hex_number>) at <number>.

Explanation:

This error message appears when the XP experiences an internal error while computing the checksum for an OSPF Link State Advertisement.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF-E-IFEXISTS Interface <interface_name> exists in area <area_name>.

Explanation:

An interface has been configured that already exists in the specified area.

Recommended Action:

Verify interface name and re-enter command.

%OSPF-E-IFNEXISTS < interface_name > is not a known OSPF interface.

Explanation:

An OSPF parameter has been configured for an interface that does not exist.

Recommended Action:

Verify interface name and re-enter command.

%OSPF-E-IFNOTFOUND *<interface_name>* is not a known interface in area *<area_name>*.

Explanation:

An OSPF parameter has been configured for an interface that does not exist.

Recommended Action:

Verify interface name and re-enter command.

%OSPF-E-IMPBBONEFAIL Failed to implicitly create the backbone area.

Explanation:

This error message appears when the XP experiences an internal error while attempting to implicitly create a backbone area.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF-E-INSUFFAREASFORVLINK Vlinks present. Number of areas (*<number>*) with valid configuration less than 2.

Explanation:

An OSPF virtual link has been configured. There must be at least 2 valid areas configured (backbone and one or more non-backbone areas).

Recommended Action:

Verify configuration of OSPF areas.

%OSPF-E-INVASTAG AS Path tag (*<number>*) greater than 4095. tag_value and as options ignored.

Explanation:

This message appears when a tag value is out-of-range. A tag value must be between 0 and 4095, inclusive.

Recommended Action:

Adjust the tag value.

%OSPF-E-INVCFG OSPF cannot run because of invalid configuration.

Explanation:

This message appears when OSPF could not be started. A more detailed message is also displayed explaining the cause of the failure.

Recommended Action:

Refer to the more detailed message.

%OSPF-E-INVMD5KEY Invalid MD5 key < key_name > (len=<number>, max=<number>).

Explanation:

This message appears when the MD5 key assigned to one of the OSPF interfaces is invalid.

Recommended Action:

Make sure that the length of the key is within the valid range.

%OSPF-E-INVSIMPLEKEY Invalid simple key < key_name > (len=<number>, max=<number>).

Explanation:

This message appears when the simple key assigned to one of the OSPF interfaces is invalid.

Recommended Action:

Make sure that the length of the key is within the valid range.

%OSPF-E-INVTRANSAREA Transit area cannot be the backbone area.

Explanation:

An OSPF virtual link was misconfigured. The transit area defined is invalid (it cannot be the backbone area).

Recommended Action:

Select an area different from the backbone as the virtual link's transit-area.

%OSPF-E-MCASTFAIL Registration of address < address > failed for interface < interface_name >.

Explanation:

This error message appears when the XP's routing process fails to register addresses necessary for OSPF.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF_E_MD5KIDNOTSPEC MD5 key id not specified. Key id <*num>* used.

Explanation:

This error is displayed when the MD5 key ID to be used with OSPF interface is not specified. The system will select a value.

Recommended Action:

It is difficult to control which ID will be selected by the system. It is better to specify the key ID with interface configuration.

%OSPF-E-MD5NOTSUPP Authentication type MD5 not supported for OSPF.

Explanation:

This error message appears when the XP attempts to perform authentication using MD5, but MD5 is not currently supported for OSPF.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF-E-NBMANBREXISTS NBMA Nbr <*NBMA_name*> already exists for interface <*interface_name*>.

Explanation:

Multiple instances of the same NBMA neighbor have been added to an interface.

Recommended Action:

Remove one of the duplicate NBMA neighbors.

%OSPF-E-NBMANBROVFLNo more free nbma nbrs (max < number > current < number >) in interface < interface_name > .

Explanation:

The maximum number of NBMA neighbors that can be added to an interface has been reached.

Recommended Action:

If possible, remove unused NBMA neighbors from the interface.

%OSPF-E-NBRNOTFOUND <*NBMA_name*> is not a known nbma neighbor for interface <*interface_name*>.

Explanation:

Attempting to remove an NBMA neighbor from an interface. However, there aren't any records of this particular neighbor.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-NETNOTFOUND < network_name > is not a known network in area < area_name >.

Explanation:

Trying to disassociate a network from an area. However, the area has no previous knowledge about this network.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-NETWKOVFL No memory for creating networks in area.

Explanation:

The maximum number of networks that can be added to an area has been reached.

Recommended Action:

If possible, remove unused networks.

%OSPF-E-NETWORKEXISTS Network *<network_name>* already exists in area *<number>*.

Explanation:

Multiple instances of the same network were added to an area.

Recommended Action:

Remove one of the duplicate add network commands.

%OSPF-E-NOAUTHTYPENo authentication-method specified for interface (*<name>*) or area (*<number>*). No authentication being used.

Explanation:

In the case of OSPF, the user has the choice of specifying the authentication-method (Simple, MD5, None) in one of the following ways:

- At the Area and Interface level.
- At the Area level but not at the Interface level.
- At the Interface level but not at the Area level.

If an authentication-method is *not* specified at either the Area Level or the Interface Level, and an authentication-key is specified, then this message is displayed. The XP would proceed with the configuration as though the authentication were not needed.

Recommended Action:

If you want to have authentication, then an authentication-method needs to be specified in one of the ways mentioned above.

%OSPF-E-NOROUTERID Router ID is not defined.

Explanation:

This error message appears when the XP attempts to use a router identification number that is undefined or otherwise invalid. Normally, the XP will automatically derive the correct identification number from one of the IP addresses associated with an active network interface. If it is unable to do so, then this message will appear.

Recommended Action:

If no network interfaces are in an active state and the OSPF task exists, specify the router ID explicitly then resume normal operation.

%OSPF-E-NOSUCHTASK OSPF task does not exist.

Explanation:

This error message appears when the XP encounters an OSPF task that is undefined.

Recommended Action:

Ensure that the OSPF task in question is valid; that OSPF has been enabled for the XP; and that the XP has an appropriate router identification number.

%OSPF-E-NOTSTUBBBONE Backbone cannot be a stub area. Stub option ignored.

Explanation:

This error message is displayed when the user attempts to set up the XP as a stub area when it is already [part of] the backbone.

Recommended Action:

Ensure that you are specifying the correct stub attribute for the correct backbone area and re-enter the command(s) for the appropriate area.

%OSPF-E-NOVALIDAREA No OSPF Areas with valid configuration. Number of areas configured (*<number>*).

Explanation:

This message appears when the user could not start OSPF because all areas were misconfigured.

Recommended Action:

A more detailed error message is also displayed for each area's misconfiguration. Refer to the more detailed messages.

%OSPF-E-NUMOFBIFERR Number of ifs mismatch (bcast < number > nbcast < number > tot < number > in area < area_number >.

Explanation:

The software component that manages OSPF area resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-NUMOFNBIFERR Number of ifs mismatch (bcast < number > nbcast < number > tot < number > in area < area_number > .

Explanation:

The software component that manages OSPF area resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-OBJMISS OSPF object to be displayed must be specified.

Explanation:

Insufficient information provided while executing the **ospf show** CLI command.

Recommended Action:

Choose a valid option while executing the **ospf show option** command.

%OSPF-E-ONEKEYONLY Current MD5 implementation supports only one key. Key <name> is being used.

Explanation:

This message is displayed when multiple MD5 keys are encountered.

Recommended Action:

Contact Enterasys Technical Support.

%OSPF-E-RTRIDCHANGED Router ID changed.

Explanation:

This error message informs the user that the router identification number has changed. Normally, the XP will automatically derive the correct identification number from one of the IP addresses associated with an active network interface. If it is unable to do so, then this message will appear.

Recommended Action:

If no network interfaces are in an active state and the OSPF task exists, specify the router ID explicitly, then resume normal operation.

%OSPF-E-RTRIFOVFL No memory for creating interface.

Explanation:

This error message is displayed when the command to add a OSPF interface failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-SHOSTEXISTS Stub host < name > already exists in area < area_number > .

Explanation:

Multiple instances of the same stub-host have been added to an area.

Recommended Action:

Remove one of the duplicate stub-host commands.

%OSPF-E-SHOSTNOTFOUND <stub-host_name> is not a known stub host in area <area_name>.

Explanation:

Attempting to remove a stub-host from an area. However, there aren't any records of the stub-host in this area.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-SHOSTOVFL No more free stub hosts (max < number > cur < number >) in area < area_number >

Explanation:

The maximum number of stub hosts that can be added to an area has been reached.

Recommended Action:

If possible, remove unused stub-hosts from the area.

%OSPF-E-TRANSAREANOTFOUND Transit area *<area_name>* is not a known area.

Explanation:

An OSPF virtual link was misconfigured. The transit area defined is invalid.

Recommended Action:

Select a valid transit-area when defining the virtual-link.

%OSPF-E-TSKDELETED OSPF Task is in deleted state (flags=0x%x)

Explanation:

This message is displayed when the user enters one of the OSPF show commands but the OSPF task is not running. The OSPF task may not be running because of one of the following reasons.

- OSPF is not enabled on the box.
- The OSPF configuration is invalid.
- Because the router-id was not explicitly specified, and there are no interfaces whose state is up.

Recommended Action:

Depending on the reason for the non-existence of the OSPF task, the user would have to rectify one of the three causes.

%OSPF-E-VLINKEXISTS VLink with nbr <name> trans_area <area_name> already exists (id <name>).

Explanation:

Multiple virtual links using the same transit-area and going to the same neighbor have been configured.

Recommended Action:

Remove one of the duplicate virtual links, or specify a different transit-area/neighbor.

%OSPF-E-VLINKIDEXISTS VLink with id < name > already exists (trans_area < area_number > nbr < name >).

Explanation:

Multiple virtual links using the same id have been created.

Recommended Action:

Use a unique id per virtual link.

%OSPF-E-VLINKNOTFOUND Virtual link with id *<name>* is not found.

Explanation:

The software component that manages OSPF area resources has detected an internal error.

Recommended Action:

If this message displays repeatedly, contact Enterasys Technical Support.

%OSPF-E-VLINKOVFL No more free virtual links (max <*number>* cur <*number>*).

Explanation:

The maximum number of virtual links that can be configured has been reached.

Recommended Action:

If possible, remove unused virtual links.

%OSPF-E-ZEROAREAS No OSPF Areas configured.

Explanation:

This message appears when a user attempted to start OSPF without any configured areas.

Recommended Action:

Configure at least one OSPF area before starting.

%OSPF-E-ZEROINTFSNo interfaces configured in area (<area_number>). Area (<area_number>) ignored.

Explanation:

An OSPF area was defined, but there aren't any interfaces associated with it.

Recommended Action:

Remove unused OSPF area, or add interfaces to it.

IP Policy Error Messages

This chapter describes the error messages for the IP policy facility.

Informational Messages

%PBR-I-CREATED Policy < name > has been successfully created for ACL(s) < acl list >

Explanation:

The IP policy has been created for the specified ACL(s).

Recommended Action:

Informational message. No action necessary.

%PBR-I-DELETED Policy < name > has been successfully deleted for ACL(s) < acl list >

Explanation:

The IP policy has been deleted for the specified ACL(s).

Recommended Action:

Informational message. No action necessary.

%PBR-I-INTERFACE Policy < name > has been successfully attached to/attached from < interface > interface

Explanation:

The IP policy has been applied to the specified interface.

Recommended Action:

Informational message. No action necessary.

%PBR-I-NOALL No policy applied to all IP interfaces

Explanation:

There is no policy that is applied to all IP interfaces.

Recommended Action:

Informational message. No action necessary.

%PBR-I-PINGER_ADD Adding addresses for policy <name> to pinger <string>

Explanation:

Pinger has been enabled for this policy.

Recommended Action:

Informational message. No action necessary.

Error Messages

%PBR-E-ACLEXISTS Profile <acl> already exists in policy <name>

Explanation:

The specified ACL is already part of this policy. Multiple instances of the same ACL are not allowed.

Recommended Action:

Check the ACL name.

%PBR-E-ACLNOTFOUND Rule *<acl>* not present

Explanation:

The specified ACL is not found.

Recommended Action:

Check the ACL name and make sure it exists.

%PBR-E-APPLIED Policy has other commands attached -- negate these commands first

Explanation:

The policy that is being negated has other commands applied to it. This policy cannot be deleted before the other applied commands.

Recommended Action:

Negate the other commands that are applied to this policy before deleting this policy.

%PBR-E-INVLD_IPADDR Invalid IP address < address > specified

Explanation:

The IP address specified is invalid.

Recommended Action:

Specify a valid IP address.

%PBR-E-IPONLY Policy can be applied to IP ACLs only -- ignoring <acl>

Explanation:

Only IP ACLs can be specified for the policy.

Recommended Action:

Specify an IP ACL.

%PBR-E-NOMEM Processing error -- out of memory <string>

Explanation:

The system is out of memory.

Recommended Action:

Expand existing memory and try again. If problem persists, contact Enterasys Technical Support.

%PBR-E-NONIPIF Cannot apply policy to non IP interface < name >

Explanation:

The interface to which the policy is being applied is a non-IP interface.

Recommended Action:

Apply the policy to an IP interface.

%PBR-E-NOPOLICY: No Policy applied to interface %s

Explanation:

There is no policy applied to the interface

Recommended Action:

Use the correct interface name.

%PBR-E-NOSUCHIF Interface < name > does not exist

Explanation:

The specified interface does not exist.

Recommended Action:

Check the interface name and make sure it exists.

%PBR-E-NOSUCHRULE Could not find policy <name>

Explanation:

The specified policy name does not exist.

Recommended Action:

Make sure that the policy name is valid.

%PBR-E-POLICYEXISTS: Load Policy for %s already set to %s --- negate previous policy

Explanation:

Cannot change the load policy of a policy without negating the policy

Recommended Action:

Negate the policy and re-apply with the new load policy

%PBR-E-TOOMANY Maximum of < number > next-hops can be specified

Explanation:

Too many next hops are specified.

Recommended Action:

A maximum of four next hops can be specified in a single instance of the next hop list. Make sure that four or fewer next hops are specified.

%PBR-E-TOOMANYACLS Maximum of <number> ACLs can be specified

Explanation:

Too many ACLs are specified.

Recommended Action:

A maximum of 20 ACLs can be specified in a single policy statement. Make sure that less than 20 ACLs are specified.

Ping Error Messages

This chapter describes the error messages for the Ping facility.

Error Messages

%PING-E-BADVALUE invalid value (must be between *<number>* and *<number>*)

Explanation:

This message is displayed when the user specified a value that is out of range.

Recommended Action:

Type the value within the range specified in this error message.

POLICY Error Messages

This chapter describes the error messages for the POLICY facility.

Warning Messages

%POLICY-W-PROTOMETIGN Invalid metric value (*<number>*) for *<address>* is ignored.

Explanation:

This message is displayed when the user specifies a metric for the export-source or filter that does not coincide with the given protocol. The metric assignment has been ignored.

Recommended Action:

If you desire a different behavior on the export-source or filter in question, re-enter the command with a metric that coincides with the given protocol.

Error Messages

%POLICY-E-ASPATHALLOCFAIL Malloc failed for aspath.

Explanation:

This error message is displayed when the XP routing process is unable to allocate the necessary memory for autonomous system path (Aspath) specification.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-ASPATHNULL AS Path is null.

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-ATTRIBUTEEXISTS Attribute < name > exists in attribute list < name >.

Explanation:

An attribute of the same type and value already exists in the indicated Attribute List.

Recommended Action:

Delete the existing attribute entry from the indicated Attribute List and add the updated attribute entry.

%POLICY-E-ATTRIBUTEOVFL No more free attributes max *<number>* current *<number>* in list *<name>*

Explanation:

The maximum number of entries is already present in an attribute list.

Recommended Action:

Delete an existing attribute entry from the indicated Attribute List and add the new attribute entry.

%POLICY-E-ATTRLISTIDEXIST Attribute list < name > already exists.

Explanation:

An attempt was made to create an Attribute List with an identifier that is the same as an existing Attribute List.

Recommended Action:

Delete the existing attribute list or give the new attribute list a different identifier.

%POLICY-E-ATTRLISTNOTFOUND Attribute list with id *<number>* not found.

Explanation:

A reference was made to a non-existent attribute list.

Recommended Action:

Create a new attribute list and add the needed entries into it.

%POLICY-E-ATTRLISTOVFL No more free attribute lists max < number > current < number >

Explanation:

Maximum number of attribute lists have already been created.

Recommended Action:

Delete an existing attribute list. Add the new attribute list.

%POLICY-E-BGPEXPDSTEXIST: BGP Export destination %s and %s have identical contents

Explanation:

Two BGP Export destinations are of the same kind.

Recommended Action:

Use the previously defined BGP Export Destination.

%POLICY-E-BGPIMPSRCIDEXIST, BGP import sources <name1> and <name2> have identical contents.

Explanation:

This error message is received when trying to create two bgp import sources for one autonomous system.

Recommended Action:

Remove one of the commands from the configuration.

%POLICY-E-EXPDSTIDEXIST Export destination *<name>* already exists.

Explanation:

Multiple export destination policies have been created, and at least 2 of them were assigned the same identifier.

Recommended Action:

Use a unique identifier for each export destination entry.

%POLICY-E-EXPDSTNOTFOUND Export destination *<name>* not found.

Explanation:

A routing policy command refers to an invalid (non-existent) export-destination identifier.

Recommended Action:

Select a valid identifier.

%POLICY-E-EXPDSTOVFL No more free export destinations max < number > current < number >

Explanation:

The maximum number of export-destination policy entries has been reached.

Recommended Action:

If possible, remove unused export-destination policy entries.

%POLICY-E-EXPPOLICYOVFL No more free export policies (max < number > current < number >).

Explanation:

The maximum number of export policies has been reached.

Recommended Action:

If possible, remove unused export policy entries.

%POLICY-E-EXPSRCFLTROVFL No more free route filters for this exported source max *<number>*

Explanation:

The maximum number of route filters being exported from a single source (e.g. from RIP) has been reached

Recommended Action:

If possible, remove unused route filters.

%POLICY-E-EXPSRCIDEXIST Export source < name > already exists.

Explanation:

Multiple export-source policies have been created, and at least 2 of them were assigned the same identifier.

Recommended Action:

Use a unique identifier for each export-source entry.

%POLICY-E-EXPSRCNOTFOUND Export source *<name>* not found.

Explanation:

A routing policy command refers to an invalid (non-existent) export-source identifier.

Recommended Action:

Select a valid identifier.

%POLICY-E-EXPSRCOVFL No more free export sources max < number > current < number >

Explanation:

The maximum number of export-source policy entries has been reached.

Recommended Action:

If possible, remove unused export-source policy entries.

%POLICY-E-FILTERIDEXIST Route Filter < name > already exists.

Explanation:

Multiple route filters using the same identifier have been configured.

Recommended Action:

Use a unique identifier per route filter entry.

%POLICY-E-FILTERNOTFOUND Filter with id <*name>* not found.

Explanation:

A routing policy command refers to an invalid (non-existent) filter identifier.

Recommended Action:

Select a valid filter identifier.

%POLICY-E-FILTEROVFL No more free filters max < number > current < number >

Explanation:

The maximum number of route filters that can be configured has been reached.

Recommended Action:

Add multiple routes/networks to a single filter. When the maximum number of routes that can be added to one filter is reached, then create a new filter and add new routes to the new filter.

%POLICY-E-FILTRDSRCOVFL No more free export-sources for this policy max <number> current <number>

Explanation:

The maximum number of export-source policy entries has been reached.

Recommended Action:

If possible, remove unused export-source policy entries.

%POLICY-E-IMPFLTNOTFOUND Implicit filter < name > not found

Explanation:

This error message is displayed when the user attempts to specify an implicit filter name that is unrecognizable or undefined.

Recommended Action:

Ensure that you are specifying the appropriate filter name and/or the syntax is correct.

%POLICY-E-IMPFLTROVFL No more free implicit filters max *<number>* current *<number>*

Explanation:

The maximum number of implicit filters that can be configured has been reached.

Recommended Action:

Add multiple routes/networks to a single filter. When the maximum number of routes that can be added to one filter is reached, then create a new implicit filter and add new routes to the new implicit filter.

%POLICY-E-IMPPOLICYOVFL No more free import policies max <*number>* current <*number>*

Explanation:

The maximum number of import policies has been reached.

Recommended Action:

If possible, remove unused import policy entries.

%POLICY-E-IMPSRCFLTROVFL No more free route filters for this imported source max *<number>* current *<number>*.

Explanation:

The maximum number of route filters being imported from a single source (e.g., from RIP) has been reached.

Recommended Action:

If possible, remove unused route filters.

%POLICY-E-IMPSRCIDEXIST Import source *<name>* already exists.

Explanation:

Multiple import sources have been created. At least two of them were assigned the same identifier.

Recommended Action:

Use a unique identifier when creating import sources.

%POLICY-E-IMPSRCNOTFOUND Import source *< name > not found.*

Explanation:

A routing policy command refers to an invalid (non-existent) import-source identifier.

Recommended Action:

Select a valid identifier.

%POLICY-E-IMPSRCOVFL No more free import sources max < number > current < number > .

Explanation:

The maximum number of import-source policy entries has been reached.

Recommended Action:

If possible, remove unused import-source policy entries.

%POLICY-E-INVEXPPLCYIDX Invalid export policy index (max <number> index <number>).

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-INVFLTRDSRCIDX Invalid filtered-source index (max <number> index <number>).

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-INVIMPFLTIDX Invalid implicit filter index (max <number> index <number>).

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-INVIMPFLTRIDX Invalid source-filter index (max < number > index < number >).

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-INVIMPPLCYIDX Invalid import policy index (max < number > index < number >).

Explanation:

An internal error has occurred in the XP routing process.

Recommended Action:

Contact Enterasys Technical Support.

%POLICY-E-INVPROTOMET: Invalid metric value used (%d) for %s

Explanation:

The value of metric used is beyond the bounds allowed by the protocol.

Recommended Action:

Use a metric value which is allowed by the protocol.

%POLICY-E-INVSRCFLTRIDX Invalid source-filter index (max < number > index < number >).

Explanation:

The maximum number of route filters that can be configured has been reached.

Recommended Action:

Add multiple routes/networks to a single filter. When the maximum number of routes that can be added to one filter is reached, then create a new filter and add new routes to the new filter.

%POLICY-E-NETWKOVFL No more free networks max < number > current < number > in filter < name >

Explanation:

The maximum number of networks that can be added to a filter has been reached.

Recommended Action:

Create a new filter and then add the desired network to the new filter.

%POLICY-E-NETWORKEXISTS Network < network_name > exists in filter < filter_name >.

Explanation:

Multiple networks have been added to a filter. Some of the configured networks are duplicates.

Recommended Action:

Remove one of the duplicate networks.

%POLICY-E-NOASNUMEXPDST AS number required for exporting routes to BGP. Routes will not be exported to BGP.

Explanation:

This error message is displayed when the user attempts to export routes to BGP with an undefined or otherwise invalid AS number association.

Recommended Action:

Ensure that you have associated a valid AS number with the routes you wish to export to BGP, then try again.

%POLICY-E-NOASNUMEXPSRC AS number required for exporting BGP routes. BGP routes will not be exported.

Explanation:

This error message is displayed when the user attempts to export BGP routes with an undefined or otherwise invalid AS number association.

Recommended Action:

Ensure that you have associated a valid AS number with the BGP routes you wish to export, then try again.

%POLICY-E-NOTRSVDCOMM Community $0x < hex_vlaue >$ is not a reserved community.

Explanation:

Community attribute values in the ranges 0x0000FFFF-0x00000000 and 0xFFFFFFFF-0xFFFF0000 are reserved. Specified community is not a reserved community.

Recommended Action:

Enter a valid value for a reserved community.

%POLICY-E-NUMOFEXPFLTERR Numof export filters mismatch (max < number > cur < number >).

Explanation:

The software component that manages policy resources has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%POLICY-E-NUMOFEXPPLCYERR Numof export policy mismatch (max < number > cur < number >).

Explanation:

The software component that manages policy resources has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%POLICY-E-OSPFEXPDSTEXIST: OSPF Export destination %s and %s have identical contents

Explanation:

Two OSPF Export destinations are of the same kind.

Recommended Action:

Use the previously defined OSPF Export Destination.

%POLICY-E-OSPFIMPSRCIDEXIST, OSPF import sources <name1> and <name2> have identical contents.

Explanation:

This error message is received when trying to create two ospf import sources without specifying distinct tags.

Recommended Action:

Remove one of the commands from the configuration.

%POLICY-E-RIPEXPDSTEXIST: RIP Export destination %s and %s have identical contents

Explanation:

Two RIP Export destinations are of the same kind.

Recommended Action:

Use the previously defined RIP Export Destination.

%POLICY-E-RIPIMPSRCIDEXIST, RIP import sources <name1> and <name2> have identical contents.

Explanation:

This error message is received when trying to create two rip import sources for one interface.

Recommended Action:

Remove one of the commands from the configuration.

%POLICY-E-RSVDCOMMWKN Reserved community 0x<hex_value> is Well Known.

Explanation:

The reserved community value specified is well known.

Recommended Action:

Use the well-known community option to specify well-known communities.

Phy_POLL Error Messages

This chapter describes the error messages for the Phy_POLL facility.

Fatal Messages

%PHY_POLL-F-EVWAIT event wait failed with error '%d'

Explanation:

The specified event failed.

Recommended Action:

Contact Enterasys Technical Support.

%PHY_POLL-F-TMRCREATFAIL timer creation failed with error '%d'

Explanation:

The timer creation failed.

Recommended Action:

Contact Enterasys Technical Support.

$\mbox{\ensuremath{\%}PHY_POLL-F-TMRSTARTFAIL}\ \ \, failed to start timer '0x%x', error '%d'$

Explanation:

The indicated event failed to start the timer.

Recommended Action:

Contact Enterasys Technical Support.

PPP Messages

This chapter describes the error messages for the Point-to-Point Protocol (PPP) facility.

Informational Errors

Example:

PPP debug has been turned off on port so.4.2

Explanation:

This is an informational message. It is displayed when PPP debugging is enabled or disabled on POS port.

Recommended Action:

Informational message. No action required.

Example:

Port so.3.1: PPP event NETWORK LAYER UP for protocol IP.

Explanation:

This is an informational message. It is displayed when the PPP protocol running on a POS port receives an event. For example, it is displayed when the PPP IPCP protocol layer receives the Network Layer Up event.

Recommended Action:

Informational message. No action required.

Error Messages

Explanation:

PPP could not initialize a POS port due to insufficient memory.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-BINDFAILED-Could not bind PPP protocol to port

Explanation:

PPP failed to bind the PPP protocol to a POS port, due to an internal error.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-NOMEM-Could not allocate memory while initializing PPP on port ort-name>

Example:

Could not allocate memory while initializing PPP on port so.5.1

Explanation:

PPP could not initialize a POS port due to insufficient memory.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-NOPORTCONFIG- No PPP Port Configuration on port *<port-name>*

Explanation:

This error message is displayed when a PPP control packet is received on a port which is not configured for PPP.

Recommended Action:

Note message and contact Enterasys Technical Support.

Explanation:

This error message is displayed when the system attempts to initialize PPP on a port which has been removed on a system.

Recommended Action:

This message is not expected and is included as an extra precaution. Note message and contact Enterasys Technical Support.

%PPP-E-NOPORTFORPPP- Attempting to set up PPP on port port-number> which does not exist.

Explanation:

This error message is displayed when the system attempts to initialize PPP on a port which has been removed on a system.

Recommended Action:

This message is not expected and is included as an extra precaution. Note message and contact Enterasys Technical Support.

%PPP-E-NOPORTFORPROTO-Attempting to bring up col-name> on port col-name>

Explanation:

This error message is displayed when a PPP event is received on a port which has been removed from the system.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-OUTOFBUFFERS- PPP could not allocate a network buffer

Explanation:

This error message is displayed when PPP fails to obtain a network buffer required by it to transmit a PPP packet.

Recommended Action:

Contact Enterasys Technical Support.

%PPP-E-QFULL-Failed to send message to PPP queue. Reason: queue full.

Explanation:

This error message represents an internal error in PPP processing.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-QSENDFAILED- Failed to send message to PPP queue. Reason: <code in hexadecimal>

Explanation:

This error message represents an internal error in PPP processing.

Recommended Action:

Note message and contact Enterasys Technical Support.

%PPP-E-RCVDLOOPBACK-Received looped-back packet on port port-name>

Explanation:

This error message is displayed when a loopback connection is detected on a POS port by the PPP protocol.

Recommended Action:

Please check the port for inadvertent loopback configuration.

PTY Error Messages

This chapter describes the error messages for the PTY facility.

Warning Messages

%PTY-W-EVGBAD PTY read or write tasks woke up but the event bits were not set.

Explanation:

Tasks woke up but corresponding event bits were not set.

Recommended Action:

Contact Enterasys Technical Support.

%PTY-W-OVERFLOW pty ring overflowed while interrupts were disabled

Explanation:

Output was lost because interrupts were disabled.

Recommended Action:

Enable interrupts.

Fatal Messages

%PTY-F-EVGCREAT failed to create driver event group, sts=0x%x

Explanation:

Memory resources unavailable.

Recommended Action:

Release memory resources.

%PTY-F-EVGGET failed to get events, sts=0x%x

Explanation:

Memory resources unavailable.

Recommended Action:

Release memory resources.

%PTY-F-EVGSET failed to set events, sts=0x%x

Explanation:

Memory resources unavailable.

Recommended Action:

Release memory resources.

%PTY-F-RINGGONE ring buffer vanished

Explanation:

Memory resources unavailable.

Recommended Action:

Release memory resources.

QOS Error Messages

This chapter describes the error messages for the Quality of Service facility.

Informational Messages

%QOS-I-MATCHINGENTRY Matching entry with equal priority exists

Explanation:

This message appears when a matching flow exists with the same priority.

Recommended Action:

Informational message. No action necessary.

%QOS-I-NOENTRY Entry does not exist

Explanation:

This message appears when a matching flow does not exist.

Recommended Action:

Informational message. No action necessary.

%QOS-I-NOOP No action taken.

Explanation:

This message appears when no action was taken.

Recommended Action:

Informational message. No action necessary.

%QOS-I-PRECEDENCEDEFAULT Precedence fields set to default

Explanation:

Precedence fields set to default settings profile.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%QOS-W-NOREDSUPPORT RED is not supported on ports <port_names>

Explanation:

RED is not supported on the specified ports.

Recommended Action:

Obtain hardware that supports RED.

%QOS-W-VCNOTALLOWED VC is not allowed on this command

Explanation:

You cannot specify a VC when specifying a WAN port for this command.

Recommended Action:

Specify a WAN port without any VCs.

Error Messages

%QOS-E-DSTNETWORKNOTSPCFYDSpecify a destination network for the destination mask

Explanation:

This message appears when a destination network was not specified for the destination mask to apply.

Recommended Action:

Specify a destination network for the destination mask.

%QOS-E-FLOWEXISTS Another policy with same flow specifications already exists

Explanation:

Another policy with the same flow specification exists

Recommended Action:

None.

%QOS-E-IFNOTFOUND <interface_name>: no such interface

Explanation:

This message appears when the specified interface does not exist.

Recommended Action:

Create the interface before specifying it.

%QOS-E-IPDSTMODEON IP destination based mode is on, qos profiles will not be set

Explanation:

IP destination based mode is on, QOS profile will not be set. This is because source ip address or sockets are specified in the QOS profile.

Recommended Action:

Specify a QOS profile without sockets and source ip address.

%QOS-E-IPHOSTFLOWMODEON IP host flow based mode is on, qos profiles will not be set

Explanation:

IP host flow based mode is on, QOS profile will not be set. This is because sockets are specified in the QOS profile.

Recommended Action:

Specific a QOS profile without sockets.

%QOS-E-IPXDSTMODEON IPX destination based mode is on, qos profiles will not be set

Explanation:

IPX destination based mode is on, QOS profile will not be set. This is because source socket or source network is specified in the QOS profile.

Recommended Action:

Specify a QOS profile without sockets and source network address.

%QOS-E-MAXQLEMINQ Maximum queue threshold is less than minimum queue threshold.

Explanation:

The value entered for WRED max-queue-threshold is less than the value selected for the minqueue-threshold.

Recommended Action:

Enter the correct values.

%QOS-E-NEGATEBWALLOC Negate the line QOS set weighted-fair control <number> high <number> medium <number> low <number> for port <port> before negating this line.

Explanation:

The command line **QOS** set queueing-policy weighted-fair cannot be negated.

Recommended Action:

Negate the line **QOS set weighted-fair control** *<number>* **high** *<number>* **medium** *<number>* **low** *<number>* before negating the line **QOS set queueing-policy weighted-fair**.

%QOS-E-NOMEM processing error - insufficient memory

Explanation:

This message appears when QOS is unable to allocate memory.

Recommended Action:

Try deleting old flows before trying to create new ones.

%QOS-E-NOREDSUPPORT RED is not supported on any of the ports

Explanation:

RED is not supported on the port.

Recommended Action:

Get hardware that supports RED.

%QOS-E-NOTANIPINTF Not an IP interface

Explanation:

The interface specified for the QOS IP flow is not an IP interface.

Recommended Action:

Specify an IP interface for the QOS IP flow.

%QOS-E-NOTANIPXINTF Not an IPX interface

Explanation:

The interface specified for the QOS IPX flow is not an IPX interface.

Recommended Action:

Specify an IPX interface for the QOS IPX flow.

%QOS-E-NOTINL4BDGVLAN Port port_name does not belong to an L4 bridged VLAN. Cannot apply QOS to it.

Explanation:

The indicated port is not a member of a Layer 4 bridging VLAN.

Recommended Action:

Remove the port from the port list.

%QOS-E-NOTIPVLAN Port '%s' does not belong to an IP vlan

Explanation:

Port is not a member of an IP vlan, but is specified as a part of an IP QOS profile.

Recommended Action:

Add the port to an IP vlan.

%QOS-E-NOTIPXVLAN Port '%s' does not belong to an IPX vlan

Explanation:

Port is not a member of an IPX vlan, but is specified as a part of an IPX QOS profile.

Recommended Action:

Add the port to an IPX vlan.

%QOS-E-SAME_PRECE No two fields can have the same precedence.

Explanation:

Two of the fields entered for 'set qos precedence' command have the same priority.

Recommended Action:

Enter different precedence for each field.

%QOS-E-SPCFYFLOWFIELDS Specify flow fields

Explanation:

This message appears when no flow fields were specified.

Recommended Action:

Specify at least one flow field.

%QOS-E-SRCNETWORKNOTSPCFYDSpecify a source network for the source mask

Explanation:

This message appears when a source network was not specified for the source mask to apply.

Recommended Action:

Specify a source network for the source mask.

%QOS-E-VCNOTALLOWED VC is not allowed on this command

Explanation:

You cannot specify a VC when specifying a WAN port for this command.

Recommended Action:

Specify a WAN port without any VCs.

%QOS-E-WFQNOTENABLED Weighted Fair Queuing policy not enabled on port

Explanation:

This message appears when the Weighted Fair Queuing policy was not enabled on the specified port.

Recommended Action:

Enable the Weighted Fair Queuing policy before setting bandwidth.

%QOS-E-WFQVALUESINCORRECTWeighted Fair Queuing bandwidth allocation values incorrect

Explanation:

This message appears when the Weighted Fair Queuing bandwidth allocation values are incorrect.

Recommended Action:

The bandwidth allocation for the control, high, medium, and low queues should total 100.

%QOS-E-WRONGPRIOVALUE 1Q priority cannot be applied to interface

Explanation:

This message appears when an invalid 802.1q priority is specified using the CLI.

Recommended Action:

Correct the CLI-specified priority value.

Chapter 48

RARPD Error Messages

This chapter describes the error messages for the RARPD facility.

Informational Messages

%RARPD-I-MAPNOTFOUND No mapping found for:

<hardware_address>:<IP_address>

Explanation:

An RARP request came to the XP and no mapping was found that mapped the hardware address to an IP address.

Recommended Action:

Informational message. No action required.

%RARPD-I-REPLY Reply sent on interface: %s, to %02X%02X%02X:%02X%02X%02X, IP address: %s, server-ip: %d.%d.%d.%d

Explanation:

This message appears when the XP replies to an RARP request, for example when it found a mapping and sent a reply.

Informational message. No action required.

Warning Messages

%RARPD-W-BADETHERSIP Bad ip address entry in ethers file: %

Explanation:

If an ethers file exists on the boot flash, RARPD will read it. The ethers file consists of hardware address to ip-mappings. If there is a bad IP address, for example the format of it is wrong, this message is displayed.

Recommended Action:

Make sure the ethers file is correct.

%RARPD-W-BADETHERSMAC Bad mac address entry in ethers file: %s

Explanation:

If an ethers file exists on the boot flash, RARPD will read it. The ethers file consists of hardware address to ip-address mappings. If there is a bad hardware address, for example the format of it is wrong, this message is displayed.

Recommended Action:

Make sure the ethers file is correct.

%RARPD-W-IFNOTENABLED rarp request received from %02X%02X%02X:%02X%02X%02X on non-RARPD enable interface: %s

Explanation:

An RARP request was received by the XP on an interface in which RARPD is not enabled.

Recommended Action:

Enable RARP on the specific IP interfaces or all IP interfaces as part of the configuration.

%RARPD-W-NOHWADDR Hardware address, %02X%02X%02X:%02X%02X%02X, already deleted.

Explanation:

When deleting or negating an rarpd add hardware-address, this warning appears if the hardware address was not found in the internal list of added entries.

Recommended Action:

Verify that the current mappings are correct 'rarpd show mappings.'

Error Messages

%RARPD-E-ALLCONFIGURED Command not allowed. RARPD enabled on all interfaces.

Explanation:

This error message is displayed when RARPD is already enabled on all interfaces and an attempt is made to enable it on an additional interface.

Recommended Action:

Either negate the line where RARPD has been enabled on all interfaces and reapply to all interfaces (or to a single interface).

%RARPD-E-ALLNOTALLOWED Command not allowed because RARPD is already enabled on at least one interface.

Explanation:

This error message is displayed if RARPD is already enabled on at least one interface and an attempt is made to enable RARPD on all interfaces.

Recommended Action:

Negate the command just attempted, then negate the existing RARPD set interface commands. Once all RARPD set interface commands are negated, you may enter the RARPD set interface all command.

%RARPD-E-IFNOTFOUND Interface not found or not IP interface.

Explanation:

This error message is displayed when, the user is trying to set RARPD on an IP interface and the interface either doesn't exist, or it is not an IP interface. RARP operates on IP interfaces only.

Verify that the interface being set is an IP interface.

%RARPD-E-NOMEM Unable to add new mapping. Not enough memory.

Explanation:

This error message is displayed when the user is trying to add an RARP mapping via the CLI and/or the ethers file and there isn't any memory left on the XP.

Recommended Action:

Release memory used by other facilities where possible.

%RARPD-E-SANITYCHK Failed rarp sanity check.

Explanation:

This error message is displayed when there is an error in the original RARP packet.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 49

Rate Limit Error Messages

This chapter describes the error messages for the rate limit facility.

Informational Messages

%RL-I-CREATED Rate limit policy < name > has been successfully created for ACL(s) < acl list >

Explanation:

The rate limit policy has been created for the specified ACL(s).

Recommended Action:

Informational message. No action necessary.

%RL-I-DELETED Rate limit policy <name> has been successfully deleted for ACL(s) <acl list>

Explanation:

The rate limit policy has been deleted for the specified ACL(s).

Recommended Action:

Informational message. No action necessary.

%RL-I-INTERFACE Rate limit policy < name > has been successfully attached to/attached from < interface > interface

Explanation:

The rate limit policy has been applied to the specified interface.

Recommended Action:

Informational message. No action necessary.

%RL-I-LL_CREATED Port level rate limit policy '%s' has been successfully created.

Explanation:

Port level rate limit policy successfully created.

Recommended Action:

Informational message. No action necessary.

%RL-I-LL_DELETED Port level rate limit policy '%s' has been successfully deleted.

Explanation:

Port level rate limit policy successfully deleted.

Recommended Action:

Informational message. No action necessary.

%RL-I-NOALL No Rate limit policy applied to all IP interfaces

Explanation:

There is no rate limit policy that is applied to all IP interfaces.

Recommended Action:

Informational message. No action necessary.

%RL-I-VLAN_CREATED Vlan rate limit policy <name> has been successfully created for VLAN <name>.

Explanation:

Informational message only.

Recommended Action:

No action necessary.

%RL-I-VLAN_DELETED Vlan rate limit policy <name> has been successfully deleted for VLAN <name>.

Explanation:

Informational message only.

Recommended Action:

No action necessary.

Warning Messages

%RL-W-IPONLY Rate limit policy can be applied to IP ACLs only -- ignoring <acl list>

Explanation:

One or more specified ACLs are not IP ACLs.

Recommended Action:

Specify IP ACLs only.

Error Messages

%RL-E-ACLNOTFOUND Rule <acl> not present

Explanation:

The specified ACL is not found.

Recommended Action:

Check the ACL name and make sure it exists.

%RL-E-ALREADY_APPLIED The policy is already applied to the interface

Explanation:

A rate limiting policy being applied to an interface is already applied to the same interface. A policy is applied to an interface explicitly using CLI command.

Recommended Action:

Make sure that the policy or one of its children policies is not applied to the interface to which the policy is being applied.

%RL-E-AGGRSUPPORTED Module on which Interface exists supports Aggregate rate limiting, you must use this instead of flow-aggregate

Explanation:

The module on which the interface exists supports Aggregate rate limiting. When the hardware supports Aggregate rate limiting, you may not implement a Flow-aggregate rate limiting policy.

Recommended Action:

Create and apply an Aggregate rate limiting policy for this interface.

%RL-E-APPLIED Rate limit policy has other commands attached -- negate these commands first

Explanation:

The rate limit policy that is being negated has other commands applied to it. This policy cannot be deleted before the other applied commands.

Recommended Action:

Negate the other commands that are applied to this policy before deleting this policy.

%RL-E-APS_PROTECTION Port level rate limit policy cannot be specified on APS Protection port(s) port<>. Please specify only the APS Working port(s).

Explanation:

Port level rate limiting is not allowed on APS Protection port(s).

Recommended Action:

Use the APS Working port(s) for the policy.

%RL-E-BADINTF Parent applied on a port not in this interface

Explanation:

One of the parent policies, of the policy being applied on an interface, is a link level policy configured on a port that is not in the interface to which this policy is being applied. If a child policy having link level as parent is being applied to an interface then port, on which the link level policy is configured, should be in the interface on which child policy is being applied.

Recommended Action:

Make sure that if this policy has a parent policy as link level policy or parent's parent is a link level policy then that policy is configured on a port that is in the interface to which this policy is being applied.

%RL-E-BKTA_INUSE Input Port Level Rate Limiting resources are in use by Aggregate Rate Limiting policies on modules *<module_name>*. Please detach some aggregate policies from the modules.

Explanation:

Resources needed for input port level rate limiting are being used by aggregate rate limiting policies on the specified modules.

Recommended Action:

Detach some aggregate policies from the modules.

%RL-E-BKTUSED All resources (bucket) required by the policy <name> are in use.

Explanation:

Resources needed, for this aggregate or default rate limiting policy to work, are already in use by some other rate limit policy.

Recommended Action:

Resources are shared among various link level and aggregate rate limit policies. If the resource is already in use then new aggregate or default rate limit policy can not be made to work. Please read Rate Limiting documentation to learn more about how it works and what its restrictions are.

%RL-E-CHILDEXISTS One or more children of this policy exist

Explanation:

A rate limiting policy being deleted already has an existing child. All children policies need to be deleted before a policy can be deleted.

Make sure that you delete all the children policies of this policy before deleting this policy.

%RL-E-CHILDRATE_ERR Incorrect rate. It should be less than or equal to parent's rate minus the sum of all peer's rate

Explanation:

A child rate limiting policy is being created with a rate limit that is more than (parent's rate - sum of all peer's rate). Sum of rates of all children of the same policy should be less than or equal to parent's rate.

Recommended Action:

Make sure that the rate of policy being created is less than or equal to (parent's rate - sum of all peer's rate). Set rate of this policy so that when added to other children of the parent policy does not exceed rate of the parent policy.

%RL-E-DSTMODE One of the ACLs in this policy has src socket, dst socket or src address specified and *<interface>* has a port in Destination Flow Mode.

Explanation:

Filters cannot be applied to ports in IP destination flow mode.

Recommended Action:

Change the mode for the offending port(s).

%RL-E-DUPLICATE Policy policy_name<already exists with the same acl and action.</pre>

Explanation:

A duplicate policy was detected and the command was ignored.

Recommended Action:

Negate the duplicate policy.

%RL-E-HASAPARENT This policy already has <name> as a parent.

Explanation:

A Flow level rate limit policy that is being assigned a parent, already has a parent. A policy can have only one parent.

Do not assign a parent to this flow level policy as it already has one.

%RL-E-HSTMODE One of the ACLs in this policy has src socket or src address specified and *<interface>* has a port in Host Flow Mode.

Explanation:

Filters cannot be applied to ports in IP host flow mode.

Recommended Action:

Change the mode for the offending port(s).

%RL-E-INAGGRMODE Cannot change rate limiting mode to 'Per Flow' (default mode) as there are Input Port Level policies or Aggregate rate limiting policies attached to interface/ports on modules <module_name>. Please delete them before changing the mode.

Explanation:

There are input port level policies or aggregate rate limiting policies attached to interface(s)/port(s) on the specified modules, so the rate limiting mode cannot be changed to per flow.

Recommended Action:

Remove the port level policy/aggregate rate limit from the interface(s)/port(s).

%RL-E-INFLOWMODE Cannot change rate limiting mode to 'Aggregate' as there are Per Flow rate limiting policies configured. Please delete them before changing the mode.

Explanation:

The XP currently has some 'Per Flow' rate limiting policies configured and user is trying to change the mode. This is not allowed. Before changing the mode, all the policies in current mode should be deleted.

Recommended Action:

Delete all 'Per Flow' rate limiting policies before changing the mode to 'Aggregate'.

%RL-E-INTF_ERROR Please check that interface <name> is working correctly

Explanation:

Interface, to which a rate limiting policy is being applied, is not working properly.

Recommended Action:

Make sure that the interface, to which this policy is being applied, is up and working properly.

%RL-E-INVALIDTYPE Policy policy_name> already exists as a different type.

Explanation:

A policy cannot be redefined to a different type.

Recommended Action:

Use a unique name for the new policy.

%RL-E-LEVEL_ERR Parent policy for default policy should be at level 1

Explanation:

A default policy is being created with a parent policy that is not at level 1. Only policies that are at level 1 or root can be parent of a default policy.

Recommended Action:

Make sure that the parent policy, of this default policy, is a level 1 or a root policy.

%RL-E-LL_EXISTS Rate limit policy <name> already exists

Explanation:

User is trying to create a rate limit policy using a name by which another policy already exists.

Recommended Action:

Make sure that the name used for the new rate limit policy is not the same as that of another rate limit policy.

%RL-E-MORECHAN Aggregate or Default rate limit policy can not be applied on interface that spans across multiple channels.

Explanation:

Aggregate and default rate limit policies can not be applied to an interface that is configured on vlan or ports that are on more than one channel (slots).

Recommended Action:

Make sure that the interface, to which a policy is being applied, is configured on a vlan or ports that are on the same slot.

%RL-E-NO_AGGR_ON_TRUNK Aggregate rate limiting not allowed on trunk port *<port>*.

Explanation:

Aggregate rate limiting is not allowed on trunk ports.

Recommended Action:

Remove the port from the smart trunk.

%RL-E-NOAGGRAPPLY Aggregate rate limiting policy can not be applied to all interfaces.

Explanation:

An aggregate rate limiting policy can not be applied to all IP interfaces. It can be applied to only a specific IP interface.

Recommended Action:

Make sure that you are not applying an aggregate rate limiting policy to all IP interfaces.

%RL-E-NOAGGRPARENT One of the parents is aggregate rate limiting policy and can not be applied to all interfaces

Explanation:

Parent or parent's parent policy of the policy being applied to all interfaces is an aggregate rate limiting policy and can not be applied to all interfaces. Aggregate policies can not be applied to all interfaces.

Recommended Action:

If a policy is being applied to an interface then make sure that its parent or its parent's parent is not an aggregate rate limiting policy.

%RL-E-NOAGGRSUPPORT Modules, <module_name> do not have support for Aggregate Rate Limiting.

Explanation:

The specified modules do not support aggregate rate limiting.

Recommended Action:

Use per flow based rate limiting if appropriate.

%RL-E-NODEFAPPLY Default rate limiting policies can not be applied to all interfaces.

Explanation:

A default rate limiting policy can not be applied to all IP interfaces.It can be applied to only a specific IP interface.

Recommended Action:

Make sure that you are not applying a default rate limiting policy to all IP interfaces.

%RL-E-NOINTF No interfaces exist.

Explanation:

There are no IP interfaces configured in the system.

Recommended Action:

When a rate limit policy is applied to ALL interfaces, make sure that at least one IP interface exists.

%RL-E-NOMEM Processing error -- out of memory <string>

Explanation:

The system is out of memory.

Recommended Action:

Expand existing memory and try again. If problem persists, contact Enterasys Technical Support.

%RL-E-NONIPIF Cannot apply rate limit policy to non IP interface <name>

Explanation:

The interface to which the rate limit policy is being applied is a non-IP interface.

Apply the rate limit policy to an IP interface.

%RL-E-NOPARENT No parent to take remaining rate from

Explanation:

A default rate limiting policy is being created without a parent. Default policies need to have parents to borrow the remaining rate from.

Recommended Action:

Specify a parent policy for the default policy being created.

%RL-E-NOPOLICY No rate limit policy applied to interface < name >

Explanation:

No rate limit policy is applied to the specified interface.

Recommended Action:

Specify an interface to which a rate limit policy is applied.

%RL-E-NOPORTINFO No information for interface < name >

Explanation:

There is no information available for the specified interface.

Recommended Action:

Make sure that the interface exists.

%RL-E-NOPORTSVLAN There are no ports currently tied to vlan <name>.

Explanation:

User is trying to apply a vlan rate limit policy to a vlan that has no ports tied to it.

Recommended Action:

Make sure that the specified vlan has active ports tied to it.

%RL-E-NOSUCHIF Interface < name > does not exist

Explanation:

The specified interface does not exist.

Recommended Action:

Check the interface name and make sure it exists.

%RL-E-NOSUCHMODULE Invalid or unoccupied module number specified: <module_number>.

Explanation:

The specified module number is invalid or contains no module.

Recommended Action:

None.

%RL-E-NOSUCHRULE Could not find rate limit policy < name >

Explanation:

The specified rate limit policy name does not exist.

Recommended Action:

Make sure that the rate limit policy name is valid.

%RL-E-NOSUCHVLAN Vlan <name> does not exist.

Explanation:

The specified VLAN is not found.

Recommended Action:

Check the VLAN name and make sure it exists.

%RL-E-NOTINAGGRMODE Modules on which Interfaces/Ports exist are not in 'Aggregate' Rate Limiting mode. To change the mode use the 'system enable aggregate-rate-limiting' command.

Explanation:

Modules for aggregate rate limited interfaces must be in aggregate rate limiting mode.

Use the 'system enable aggregate-rate-limiting' command.

%RL-E-NOTAGGRORFLOW Policy < name > is not an aggregate or a flow or a default policy

Explanation:

Rate limiting policy that is being applied to an interface is not an aggregate or a flow or a default policy. Only these type of policies can be applied to an interface.

Recommended Action:

Make sure that the policy being applied to an interface is one of the above types.

%RL-E-NOTAPARENT Policy < name > can not be a parent. Only aggregate and input link level policies can be parents.

Explanation:

In hierarchical rate limiting, policies that can become parents are either aggregate policies or input link level policies.

Recommended Action:

Make sure that policy specified as parent is either of the two types.

%RL-E-NOTINFLOWMODE System is not in 'Per Flow' Rate Limiting mode. To change the mode negate 'system enable aggregate-rate-limiting' command.

Explanation:

The XP is currently not in 'Per Flow' mode of rate limiting. There are two modes of rate limiting: 'Per Flow' and 'Aggregate'. In 'Per Flow' XP does rate limiting on per flow basis and in 'Aggregate' mode XP does Port Level and Aggregate rate limiting. This error is given if user tries to crete Per Flow rate limiting policies when in 'Aggregate' rate limiting mode.

Recommended Action:

Change XP's rate limiting mode to 'Per Flow' by negating the command 'system enable aggregate-rate-limiting.' 'Per Flow' mode is the default mode.

%RL-E-NOTINLINKMODE System is not in 'Aggregate' rate limiting mode. To change the mode use 'system enable aggregate-rate-limiting command.

Explanation:

The XP is currently not in 'Aggregate' mode of rate limiting. This error would be given when user tries to create Aggregate or Input Port Level rate limiting policies while the XP is in 'Per Flow' mode. There are two rate limiting modes. 'Per Flow' which is default and does per flow rate limiting. The other 'Aggregate' mode does Aggregate and Input Port Level rate limiting. To create Aggregate or Input Port Level rate limiting policies user should first change the rate limiting mode to 'Aggregate'.

Recommended Action:

Before creating any Aggregate or Input Port Level rate limiting policies, change the XP's rate limiting mode to 'Aggregate' by using 'system enable aggregate-rate-limiting' command.

%RL-E-NOTLINKLEVEL Policy <name> is not a Link Level Policy

Explanation:

User is trying to display a non link level rate limit policy using rate-limit show link-level policy-name <name> command.

Recommended Action:

Make sure that policy name given in the command is a link level policy.

%RL-E-PARENT_MORECHAN One of the parents can not be applied on interface that spans across multiple channels.

Explanation:

A rate limit policy, whose parent or parent's parent is an aggregate or default policy, is being applied to an interface that is configured on a vlan or ports that belong to more than one channels (slots). Aggregate and default rate limit policies can not be applied to an interface that is configured on a vlan or ports that are on different channels (slots).

Recommended Action:

Make sure that if one of the parents of this policy, is an aggregate or default policy, then the interface to which this policy is being applied, is not configured on a vlan or ports that belong to different channels (slots).

%RL-E-PORTBKTUSED Rate limiting resources for ports *<name>* are already in use. Ignoring all.

Explanation:

Resource needed, for a link level policy to work, is already in use by some other rate limit policy. Ignoring all the ports in the command.

Recommended Action:

Resources are shared among various link level and aggregate rate limit policies. If the resource is already in use then new link level policy can not be configured. Please read Rate Limiting documentation to learn more about how it works and what its restrictions are.

%RL-E-PORTLEVEL_ALREADYDISABLED Input Port Level Rate Limiting is already disabled on modules *<module_name>*.

Explanation:

Input port level rate limiting is already disabled for the specified module.

Recommended Action:

None.

%RL-E-PORTLEVELPOLICIES Cannot disable Input Port Level Rate Limiting as there are Input port level policies on modules <module_name>.

Explanation:

Cannot disable input port level rate limiting because there are port level policies on the modules.

Recommended Action:

Remove the input port level rate limiting policies before disabling input port level rate limiting.

%RL-E-PORTNOTINVLAN Port <port-name> is not a member of vlan <name>.

Explanation:

User is trying to create a vlan rate limit policy on a port that is not currently tied to the specified vlan.

Recommended Action:

Make sure the specified port is a member of the specified vlan.

%RL-E-RATE_UNAVAIL No rate available with parent

Explanation:

A default rate limiting policy is being create wherein all of the rate of the parent policy is already consumed by other children of the parent policy.

Recommended Action:

Reduce rate of one of the children policies of the parent policy that is being made parent of this default policy.

%RL-E-TOOMANYACLS Too many acls specified

Explanation:

Too many ACLs are specified.

Recommended Action:

A maximum of 20 ACLs can be specified in a single rate limit policy statement. Make sure that less than 20 ACLs are specified.

%RL-E-VLANNOTL4BDG Vlan <name> is not in L4 bridging mode.

Explanation:

User is trying to create a vlan rate limit policy using a vlan that does not have L4 bridging enabled on it.

Recommended Action:

Make sure that the vlan, to which the policy is being applied, has L4 bridging enabled.

%RL-E-VRL_EXISTS Vlan rate limit policy <name> already exists.

Explanation:

User is trying to create a vlan rate limit policy using a name by which another policy already exists.

Recommended Action:

Make sure that the name used for the new vlan rate limit policy is not the same as that of another vlan rate limit policy.

%RL-E-WRONG_RATE Hardware rate restriction, 10/100: min=1.5M, max=100M; Gig min=6M, max=1G; for ports '%s'

Explanation:

The rate given for the policy does not fall within the restrictions for the specified port(s). Due to a hardware restriction in SIPP v2.0 and v2.1, rate limiting on cards containing these asics is restricted to a range of 1.5M - 100M for 10/100 and 6M - 1G for Gig.

Recommended Action:

Confine rate limiting to these ranges.

Chapter 50

RCP Error Messages

This chapter describes the error messages for the RCP facility.

Informational Messages

%RCP-I-STATUS RCP <status_code>

Explanation:

This message appears to display the status of the RCP data transfer.

Recommended Action:

Informational message. No action necessary.

%RCP-I-TRANS Nothing to transfer from < name>

Explanation:

This message appears when there was nothing in the active or transient database to transfer.

Recommended Action:

Informational message. No action necessary.

%RCP-I-XFERRATE <string> <number> bytes in <number>.<number> seconds

Explanation:

This message appears to display the rate of data transfer.

Informational message. No action necessary.

Warning Messages

%RCP-W-DIFF_USERNAME TACACS username < name > differs from the CLI username < name >, using TACACS username.

Explanation:

This error message appears when the user specifies an RCP username that is different from the original TACACS or RADIUS login username.

Recommended Action:

This warning message is merely informational, letting you know that the XP will use the specified TACACS/RADIUS username rather than the RCP username. No action is required unless you wish to specify a different name.

%RCP-W-INVLD Invalid <username>: <username>

Explanation:

This message appears when the username entered contains illegal characters (non_alphanumeric characters except '-' and '_').

Recommended Action:

Verify the username.

%RCP-W-NORESP No response from <server_name>

Explanation:

This message appears when the RCP server stops responding.

Recommended Action:

Verify operation of RCP server.

Error Messages

%RCP_E_ALLUSE RCMD: All sockets are in use

Explanation:

This message is displayed when the RCP connection failed because all the sockets allocated for RCP are in use.

Recommended Action:

Try again. If this message displays repeatedly, contact Enterasys Technical Support.

%RCP-E-BADFILE Bad file name: <filename>

Explanation:

This message appears when a bad file name is given to be copied.

Recommended Action:

Check the file name.

%RCP-E-BADRCPURL Bad RCP URL '<url_type>:/ /<url_name>'

Explanation:

This message appears when the RCP command (URL form) contains an invalid format.

Recommended Action:

Check the format and try again.

%RCP-E-BADTARGET Ambiguous Target

Explanation:

This message appears when you passed bad parameters for copying.

Recommended Action:

Check parameters and try again.

%RCP-E-CONN RCMD: Could not connect to address: <address>

Explanation:

This message appears when the XP could not connect to the RCP server.

The RCP server is busy, try again later.

%RCP-E-CONNECTION Lost connection *<number>*

Explanation:

This message appears when you lost the connection with the RCP server while transferring data.

Recommended Action:

Check if the RCP server is responding. If it is responding, try again.

%RCP-E-CTRL Error in control packet <string>

Explanation:

This message appears when an internal protocol error occurred.

Recommended Action:

Please try RCP again.

%RCP-E-FILE Could not <string> file <filename>

Explanation:

This message appears when the XP could not open a file on the local file system for writing.

Recommended Action:

Check permissions and file system space available.

%RCP-E-FORMAT <filename> name format error <error_type>

Explanation:

This message appears when a file name contains a colon (:).

Recommended Action:

Remove the colon (:) from the file name.

%RCP-E-FSTAT File (<filename>) not found

Explanation:

This message appears when the local file to be copied could not be found on the file system.

Check if file exists, or file name is correct.

%RCP-E-NAME < filename > not specified

Explanation:

This message appears when the file to be copied was not specified.

Recommended Action:

Give the name of the file to be transferred.

%RCP-E-PERM Permission denied

Explanation:

This message appears when the user does not have access to copy files on the remote or local file system.

Recommended Action:

Use the correct user name and/or check permissions on the server.

%RCP-E-PROTO Protocol error: <error_type>

Explanation:

This message appears when some RCP protocol error occurred.

Recommended Action:

Please try RCP again.

%RCP-E-RCMD rcmd failed

Explanation:

This message appears when the XP could not establish connection with the RCP server. This could be caused if the server is not present, there is no route to the server, server does not respond.

Recommended Action:

Verify that we have a route to the server, and the server is responding.

%RCP-E-REMOTE Remote error <*error_type>*

Explanation:

This message appears when some error occurred on the RCP server. Mostly this should occur if the file specified on the RCP server does not exist, or there were permission problems. The error should be printed out along with the message.

Recommended Action:

Check if file exists on the RCP server and/or permissions are OK.

%RCP-E-SOCK RCMD: Socket: <message>

Explanation:

This message is displayed when the RCP connection failed because of an error in socket.

Recommended Action:

Try again. If this message displays repeatedly, contact Enterasys Technical Support.

%RCP-E-TXFR Error while transferring data

Explanation:

This message appears when some error occurred during data transfer (TCP broken pipe).

Recommended Action:

Verify server is responding, and try again.

%RCP-E-UNKNOWN_SERV Unknown service: '<service-name>'/tcp

Explanation:

Port for the specified TCP service could not be found. You should never see this message.

Recommended Action:

Contact Enterasys Technical Support.

%RCP-E-UNREACH Host < host_name > unreachable

Explanation:

This message appears when we do not have a route to the RCP server.

Check if the RCP server is reachable.

%RCP-E-WRITE RCMD: Write (setting up stderr): <message>

Explanation:

This message is displayed when there is an error writing to the RCP socket.

Recommended Action:

Try again.

Chapter 51

RDISC Error Messages

This chapter describes the error messages for the RDISC facility.

Error Messages

%RDISC-E-ADDREXISTS: Address < address > already exists

Explanation:

The address has already been added to the rdisc configuration.

Recommended Action:

Specify a different address.

%RDISC-E-ADDRNOTFOUND: <address> is not a known address

Explanation:

The address that has been specified does not exist.

Recommended Action:

Check the address and try again.

%RDISC-E-ADDROVFL: No memory for creating addresses

Explanation:

The maximum number of addresses that can be configured for RDISC has been reached or the system is out of memory. (By default, all addresses on an RDISC-enabled interface are included in router advertisements.)

Recommended Action:

Delete any addresses that should not be included in router advertisements.

%RDISC-E-BADADVLIFETIME: Advertisement lifetime - invalid value (must be between *<number>* and *<number>*).

Explanation:

The configured value of the Advertisement Lifetime parameter exceeds the operation limits.

Recommended Action:

Use a value that is within the specified range.

%RDISC-E-BADMAXINTERVAL: Maximum advertisement interval invalid value (must be between < number > and < number >).

Explanation:

The configured value of the Maximum Advertisement Interval parameter exceeds the operation limits.

Recommended Action:

Use a value that is within the specified range.

%RDISC-E-BADMININTERVAL: Minimum advertisement interval invalid value (must be between *<number>* and *<number>*).

Explanation:

The configured value of the Minimum Advertisement Interval parameter exceeds the operation limits.

Recommended Action:

Use a value that is within the specified range.

%RDISC-E-IFEXISTS: Interface < name > already exists.

Explanation:

The interface name has already been added to the rdisc configuration.

Recommended Action:

Specify a different interface name.

%RDISC-E-IFNOTFOUND: < name > is not a known interface.

Explanation:

The interface name that has been specified does not exist.

Recommended Action:

Check the name and try the again.

%RDISC-E-IFOVFL: No memory for creating interfaces

Explanation:

The maximum number of interfaces that can be configured for RDISC has been reached or the system is out of memory.

Recommended Action:

Delete any interfaces on which router advertisement does not need to be enabled.

%RDISC-E-INVCFG: RDISC cannot run because of invalid configuration

Explanation:

You have specified conflicting RDISC parameters in the configuration.

Recommended Action:

Correct the configuration and restart RDISC.

%RDISC-E-NOSUCHTASK: RDISC Task does not exist

Explanation:

RDISC has not started.

Recommended Action:

Start RDISC using the 'rdisc start' command.

%RDISC-E-OBJMISS: RDISC object to be displayed must be specified

Explanation:

No RDISC object was specified with the 'rdisc show' command.

Recommended Action:

Specify an address or an interface name along with the show command.

%RDISC-E-TSKDELETED: RDISC Task is in deleted state (flags=0x)

Explanation:

RDISC has not started. Flags indicate the state of the task:

bit 1 = waiting for accepts

bit2 = waiting for connects

bit 3 = task has been deleted

bit4 = low priority reads enabled.

Recommended Action:

Start RDISC using the 'rdisc start' command.

Chapter 52

Resolver Error Messages

This chapter describes the error messages for the Resolver facility.

Informational Messages

%RES-I-BADARCRD gethostbyaddr: A record of <name>!= PTR record [<name>]

Explanation:

This message appears when the host address is not found.

Recommended Action:

Check to make sure DNS is configured properly.

%RES-I-QUERY1 gethostby*.getanswer: asked for "<name>", got "<name>"

Explanation:

This message appears when an informational message denoting QUERY1 has been received.

Recommended Action:

Informational message. No action necessary.

%RES-I-QUERY3gethostby*.getanswer: asked for "<name> <name> <name>", got type "<name>"

Explanation:

This message appears when an informational message denoting QUERY3 has been received.

Recommended Action:

Informational message. No action necessary.

Error Messages

%RES-E-BADAF bad address family '<number>'

Explanation:

This message appears when you have entered a bad address family.

Recommended Action:

Check to make sure DNS is configured properly.

%RES-E-BADQTYPE bad query type '<number>'

Explanation:

This message appears when you have entered a bad query type.

Recommended Action:

Check to make sure DNS is configured properly.

%RES-E-BASE64 output is not in base-64

Explanation:

This message appears when the output from DNS is not base-64.

Recommended Action:

Check to make sure DNS is configured properly.

%RES-E-FAILED DNS resolver failed: <name>(<name>)

Explanation:

This message appears when the Domain Name Server resolver failed.

Recommended Action:

Check name for DNS. Check to make sure DNS is configured properly.

Chapter 53

RIP Error Messages

This chapter describes the error messages for the Routing Information Protocol facility.

Error Messages

%RIP-E-IFEXISTS Interface <interface_name> already exists.

Explanation:

A RIP parameter has been configured for an interface that does not exist.

Recommended Action:

Use a valid interface.

%RIP-E-IFNOTFOUND <interface_name > is not a known interface.

Explanation:

A RIP parameter has been configured for an interface that does not exist.

Recommended Action:

Use a valid interface.

%RIP-E-IFOVFL No more free interfaces max < number > current < number >.

Explanation:

The maximum number of interfaces that can be added to RIP has been reached.

Recommended Action:

If possible, remove unused interfaces.

%RIP-E-NOSUCHTASK RIP Task does not exist.

Explanation:

The user attempted to display RIP information. However, RIP is not running.

Recommended Action:

Either RIP has not been started, or RIP was started but the routing configuration is invalid. Refer to error messages that were displayed after the configuration changes were made active.

%RIP-E-OBJMISS RIP object to be displayed must be specified.

Explanation:

Insufficient information provided while executing the **rip show** CLI command.

Recommended Action:

Choose a valid option while executing the **rip show option** command.

%RIP-E-SGWAYEXISTS Source Gateway < name > already exists.

Explanation:

A RIP source-gateway has been defined multiple times.

Recommended Action:

Remove the duplicate source-gateway entries.

%RIP-E-SGWAYOVFL No more free source gateways max < number > current < number >.

Explanation:

The maximum number RIP source-gateways that can be configured has been reached.

Recommended Action:

If possible, remove unused source-gateways.

%RIP-E-TGWAYEXISTS Trusted Gateway < name > already exists.

Explanation:

A RIP trusted-gateway has been defined multiple times.

Recommended Action:

Remove the duplicate trusted-gateway entries.

%RIP-E-TGWAYOVFL No more free trusted gateways max < number > current < number >.

Explanation:

The maximum number RIP trusted-gateways that can be configured has been reached.

Recommended Action:

If possible, remove unused source-gateways.

%RIP-E-TSKDELETED RIP Task is in deleted state

(flags=0x<hex_value>)

Explanation:

The user attempted to display RIP information. However, RIP is not running.

Recommended Action:

RIP was started but the routing configuration is invalid. Refer to error messages that were displayed after the configuration changes were made active.

Chapter 54

RMON Error Messages

This chapter describes the error messages for the Remote Network Monitoring facility.

Note: See the SNMP chapter for additional RMON messages.

Informational Messages

%RMON-I-ADD_MEM A total of < number > bytes has been allocated for RMON

Explanation:

The number of bytes of memory shown is allocated to RMON.

Recommended Action:

Informational message. No action required.

%RMON-I-DISABLED RMON has been disabled.

Explanation:

RMON has been disabled on the XP.

Recommended Action:

Informational message. No action required.

%RMON-I-ENABLED RMON has been enabled.

Explanation:

RMON is enabled on the XP.

Recommended Action:

Informational message. No action required.

%RMON-I-IS_DISABLED RMON is disabled.

Explanation:

RMON must be enabled. By default, RMON is disabled on the XP.

Recommended Action:

Issue the rmon enable command.

%RMON-I-LITE_DEF Lite default tables have been enabled.

Explanation:

Default control tables for the Lite group are enabled.

Recommended Action:

Informational message. No action required.

%RMON-I-LITE_DEL_DEF Lite default tables have been deleted.

Explanation:

Default control tables for the Lite group have been turned off and collected data has been dropped from the tables.

Recommended Action:

You can create more precise control table rows from the management station or by using CLI commands.

%RMON-I-LITE_NON_DEF Manual CLI Lite commands have been enabled.

Explanation:

RMON is enabled with Lite groups.

Recommended Action:

Informational message. No action required.

%RMON-I-LITE_OFF Lite has been disabled.

Explanation:

RMON Lite groups have been disabled.

Recommended Action:

Informational message. No action required.

%RMON-I-MARKED_DEL RMON additional RMON memory has been marked for deletion.

Explanation:

Memory has been freed from RMON. When memory is marked for deletion, it is returned to the system.

Recommended Action:

Informational message. No action required.

%RMON-I-PRO_DEF Professional default tables have been enabled.

Explanation:

Default control tables for the Professional group are enabled.

Recommended Action:

Informational message. No action required.

%RMON-I-PRO_DEL_DEF Professional default tables have been deleted.

Explanation:

Default control tables for the Professional group have been turned off and collected data has been dropped from the tables.

Recommended Action:

You can create more precise control table rows from the management station or by using CLI commands.

%RMON-I-PRO_NON_DEF Manual CLI Professional commands have been enabled.

Explanation:

RMON is enabled with Professional groups.

Recommended Action:

Informational message. No action required.

%RMON-I-PRO_OFF Professional has been disabled.

Explanation:

RMON Professional groups have been disabled.

Recommended Action:

Informational message. No action required.

%RMON-I-STD DEF Standard default tables have been enabled.

Explanation:

Default control tables for the Standard group are enabled.

Recommended Action:

Informational message. No action required.

%RMON-I-STD_DEL_DEF Standard default tables have been deleted.

Explanation:

Default control tables for the Standard group have been turned off and collected data has been dropped from the tables.

Recommended Action:

You can create more precise control table rows from the management station or by using CLI commands.

%RMON-I-STD_NON_DEF Manual CLI Standard commands have been enabled.

Explanation:

RMON is enabled with Standard groups.

Recommended Action:

Informational message. No action required.

%RMON-I-STD_OFF Standard has been disabled.

Explanation:

RMON Standard groups have been disabled.

Recommended Action:

Informational message. No action required.

Warning Messages

%RMON-W-BUCKETS < name > index < number > - < number > buckets out of < number > were allocated.

Explanation:

Buckets are used in history tables to collect a serial of data (number of buckets) over a certain interval.

Recommended Action:

No action required.

%RMON-W-CONTROL_INDEX < group > Control Index < number > does not exist. Cannot add index entry.

Explanation:

Configuring the RMON Host-Top-N group requires that you specify an index for the Host table, while configuring the Al-Matrix-Top-N and NL-Matrix-Top-N groups require that you specify an index for the HL-Matrix table. The index specified does not exist.

Recommended Action:

Check the index that you specified for the Host or HL-Matrix table. If necessary, you must configure the index entry in the Host or HL-Matrix table first.

%RMON-W-LITE_OFF RMON Lite is disabled.

Explanation:

The RMON groups Alarm, Event, History, and Etherstats are disabled. RMON will not gather data for these groups.

Recommended Action:

Make sure that you want these groups disabled.

%RMON-W-MAX_ROWS Cannot add < name > row for port < port > - maximum number of rows < number > reached.

Explanation:

A maximum of 65535 rows can be specified for the RMON group.

Recommended Action:

Do not configure more than 65535 rows for the group.

%RMON-W-MEM_RANGE Memory requested is less than presently allocated. Restart RMON to take effect.

Explanation:

The memory allocation specified with the rmon set memory command is less than the amount of memory allocated when RMON was enabled.

Recommended Action:

Restart RMON to use the new memory allocation.

Explanation:

The index number uniquely identifies a row in a table. Some RMON commands refer to other commands by the index number.

Recommended Action:

Check the RMON configuration.

%RMON-W-RMON_MEM, RMON memory max'ed out. You may want to add more memory to RMON.

Explanation

RMON has reached its maximum allocated memory and can not fill any more entries in its tables.

Recommended action

Allocate more memory with the RMON set memory command, limit the number of entries in the tables, or reduce the number of ports that you are collecting data on. Verify the memory with the RMON show status command.

%RMON-W-OID_BIND Cannot add <name> index <number> row - could not bind oid for ifIndex <number>.

Explanation:

The index number uniquely identifies a row in a table. Some RMON commands refer to other commands by the index number.

Recommended Action:

Check the RMON configuration.

%RMON-W-PRO_OFF RMON Professional is disabled.

Explanation:

The RMON 2 groups are disabled. RMON will not gather data for these groups.

Recommended Action:

Make sure that you want these groups disabled.

%RMON-W-REBOOT_NOW RMON coldBoot command accepted from <name>.

Explanation:

The XP has accepted a reboot request via SNMP from the specified host IP system.

Recommended Action:

No action required.

%RMON-W-SNMPOFF SNMP is disabled. Cannot turn on RMON.

Explanation:

SNMP must be enabled for RMON to function.

Recommended Action:

Enable SNMP.

%RMON-W-STD_OFF RMON Standard is disabled.

Explanation:

The RMON groups Host, Matrix, Matrix-Top-N, Filter, and Channel are disabled. RMON will not gather data for these groups.

Recommended Action:

Make sure that you want these groups disabled.

Error Messages

%RMON-E-ALIGN Request for unaligned memory of size <number> bytes rounded up.

Explanation:

Internal error.

Recommended Action:

Contact Enterasys Technical Support.

%RMON-E-DS_BIND Cannot add <name > index <number > row - could not bind data source ifIndex <number >.

Explanation:

A system error occurred.

Recommended Action:

Contact Enterasys Technical Support.

%RMON-E-ENABLE_FAILURE Cannot enable RMON without enabling either Lite, Std, or Pro.

Explanation:

You must configure the Lite, Standard, or Professional RMON groups before enabling RMON.

Recommended Action:

Specify an rmon set lite|standard|professional command in your configuration.

%RMON-E-FILTER_ID_EXISTS Filter Id < number >, is already taken.

Explanation:

The specified filter ID is already being used.

Recommended Action:

Use a different identifier when creating the filter.

%RMON-E-FILTER_ID_NOTEXISTS Filter Id < number >, does not exist.

Explanation:

The specified filter ID does not exist.

Recommended Action:

Check the existing filters for the correct ID.

%RMON-E-INVALID_OID Object identifier is not an integer or doesn't exist. Index: <number>

Explanation:

A command attempted to set a control for a port that does not exist.

Recommended Action:

Check the object identifier and make sure that it references an existing port.

%RMON-E-NETFLOWENABLED, Cannot set RMON Professional if NETFLOW Service is enabled.

Explanation:

This error message appears when you try to configure the XP with RMON Professional and NetFlow Service is enabled, or when you try to enable RMON when RMON Professional is configured and NetFlow is enabled.

Recommended action:

Disable NetFlow Service. You cannot configure NetFlow Service and RMON Professional together because RMON Professional clears counters that NetFlow monitors.

%RMON-E-NOMEM Reached max of <*number*> Meg, <?> - Index(<*index*>).

Explanation:

The XP is out of memory and RMON cannot get what it needs.

Recommended Action:

Use the system show capacity memory command to see memory usage.

%RMON-E-NOSYSMEM No more memory available on system.

Explanation:

The system is out of memory and RMON cannot get what it needs.

Recommended Action:

Use the system show capacity memory command to see memory usage.

%RMON-E-PROTOCOL Protocol < name >, not found.

Explanation:

The probe does not support the requested protocol in the protocol directory.

Recommended Action:

Use the rmon show protocol-directory to see supported protocols.

%RMON-E-SYNTAX_ERR A Syntax Error occurred while specifying an RMON filter.

Explanation:

There was a syntax error in the command to specify an RMON filter.

Recommended Action:

Check and correct the configuration command to specify a filter.

%RMON-E-TMR_BIND Cannot add < name > index < number > row - timerbind call failed.

Explanation:

A system error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 55

Serial Input/Output Driver Error Messages

This chapter describes the error messages for the Serial Input/Output port of a control module. These messages could apply to either the front panel serial port or the internal debug serial port.

Fatal Messages

%SIO-F-EVGBAD unexpected events seen, expected 0x%x, seen 0x%x

Explanation:

Unexpected events seen while waiting for serial i/o device to either read or write.

Recommended Action:

Contact Enterasys Technical Support

%SIO-F-EVGCREAT failed to create driver event group, sts=0x%x

Explanation:

Failed to create an event flag group for blocking reads to make scanf() and getchar() work correctly by blocking until data is available. Failure occurred during initialization of the serial port i/o driver.

Recommended Action:

Check control module's serial port.

%SIO-F-EVGGET failed to get events, sts=0x%x

Explanation:

Failed to retrieve events from serial i/o devices. Either waiting for transmit or device write.

Recommended Action:

Contact Enterasys Technical Support

%SIO-F-EVGSET failed to set events, sts=0x%x

Explanation:

Failed to set flags or events during serial i/o high level interrupt service routine or while writing to physical interface chip.

Recommended Action:

Contact Enterasys Technical Support

%SIO-F-HISRFAIL failed to create driver HISR, sts=0x%x

Explanation:

Failed to create high level interrupt service routine for serial i/o port, either front panel serial port[0] or debug serial port[1].

Recommended Action:

Contact Enterasys Technical Support

%SIO-F-LISRFAIL failed to register driver LISR, sts=0x%x

Explanation:

Failed to register low level interrupt service routine while initializing serial i/o driver.

Recommended Action:

Contact Enterasys Technical Support

%SIO-F-NOBUFMEM not enough memory to allocate typeahead buffer

Explanation:

Couldn't allocate memory for the serial i/o queue.

Recommended Action:

Check control module's serial port. Review system memory requirements.

%SIO-F-NOSTKMEM not enough memory to allocate stack

Explanation:

Could not allocate memory for the high level interrupt service routine's stack. Failure occurred during initialization of the serial port i/o driver.

Recommended Action:

Check control module's serial port. Review system memory requirements.

Chapter 56

Serial (WAN) Error Messages

This chapter describes the error messages for the Serial facility used by the WAN software.

Informational Messages

%SERIAL-I-FRCOMP_UP Compression is up on port *<port>* vc *<number>*

Explanation:

The message appears when Frame Relay compression (FRF.9) was successfully negotiated and is now up.

Recommended Action:

Informational message. No action required.

%SERIAL-I-PPP_SHUTDOWN PPP on port *<port>* was shutdown due to ECP negotiation failure

Explanation:

The PPP encryption protocol (ECP) was not successfully negotiated on the specified port. Instead of sending unencrypted traffic over the link, the link is shut down.

Recommended Action:

Check the ECP configuration.

Warning Messages

%SERIAL-W-CTL_PKT_LOOPBACK frame-relay LMI|PPP LCP packet was looped back on port *<port>*

Explanation:

A frame relay LMI packet or a PPP Link Control Protocol packet on the specified port was looped back.

Recommended Action:

If this message appears only a few times immediately following boot up, no action is required. If this message continues to appear, check the CSU/DSU connection with the specified port to ensure it is not in loopback mode.

%SERIAL-W-DEC_DRIVER <*text*>

Explanation:

Generic warning message from the serial card's ethernet driver.

Recommended Action:

If this message appears repeatedly, contact Enterasys Technical Support.

%SERIAL-W-EGRESS_DEC_SEND dec_send (wan to xp) failed

Explanation:

The WAN card could not send a packet to the main XP.

Recommended Action:

If this message appears repeatedly, contact Enterasys Technical Support.

%SERIAL-W-EGRESS_ERROR_INARP egress: inarp error

Explanation:

Could not resolve the inarp request.

Recommended Action:

If this message appears, one should check for IP or IPX addresses on both local and remote routers.

%SERIAL-W-EGRESS_ERROR_INARP_ADDR error: src and dst address are not on the same network(src <name>, dst <name>, netmask <number>)

Explanation:

This message appears when local and peer IP addresses configured for a VC or PPP port are on different subnets.

Recommended Action:

Check configuration to make sure local IP address is correct.

%SERIAL-W-EGRESS_FR_FORMAT egress; wrong PDU format from vc <number> on port <name>

Explanation:

WAN card received packets with unrecognized protocol data unit format.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_FR_NLPID egress: invalid nlpid(**%**x) or proto from vc <*number>*

Explanation:

Egress path received a packet with invalid nlpid of protocol ID.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_FR_OUI egress: invalid fr oui from vc < number > on port < port >

Explanation:

Egress path has received a packet with invalid organization unique ID of frame relay header.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_FR_PID egress: invalid fr L3 pid(%x0 from vc <number> on port <port>

Explanation:

Egress path has received a frame relay packet with unrecognized protocol ID.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_FR_VC_DISABLED egress: VC < number > is not up on port < port >

Explanation:

Frame relay VC is operationally/administratively disabled.

Recommended Action:

Enable the frame relay VC or check if LMI is running.

%SERIAL-W-EGRESS_FR_VC_NOTCONF egress: VC < number > is not configured on port < name >

Explanation:

This message appears when receiving packets on a non-configured VC.

Recommended Action:

Configure the frame relay VC.

%SERIAL-W-EGRESS_MAC_TYPE egress: invalid MAC type on port <name>

Explanation:

Incoming packet does not have the 802.3 MAC type.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_PORT_DISABLED egress: PPP port is not up

Explanation:

PPP port is operationally or administratively disabled.

Recommended Action:

Enable the PPP port or check LCP/NCP.

%SERIAL-W-EGRESS_PPP_MP_PID egress: received mlp frames on port <*name*> which is not configured for mlp, discarding

Explanation:

The egress data path is not configured for MLP, but received an MLP packet.

Recommended Action:

Check the configuration.

%SERIAL-W-EGRESS_PPP_PID egress: invalid PPP proto id(**%**x) on port <*name*>

Explanation:

Received packets with unrecognized PPP protocol ID.

Recommended Action:

Check if the peer router is sending out packets using RFC1483 encapsulation.

%SERIAL-W-EGRESS_ERROR_INARP_DSTADDR inarp error: could not find any L3 entry which is on the same subnet as the given peer address(<ipaddr>)

Explanation:

Could not find L3 address which is on the same subnet as specified in the inarp request.

Recommended Action:

Check local and remote router's L3 address.

%SERIAL-W-EGRESS_ERROR_INARP_IPX_ADDR error: src and dst address(<ipxaddr>) are not on the same network(src <ipxaddr>, dst <ipxaddr>)

Explanation:

This message appears when local and peer IPX addresses configured for a VC or PPP port are on different subnets.

Recommended Action:

Make sure both local and peer addresses are on the same network.

%SERIAL-W-EGRESS_ERROR_INARP_RESOLVE inarp error: peer address(<ipaddr>) is the same as local address(<ipaddr>)

Explanation:

This message appears when the source address of inarp request/response is the same as the local address.

Recommended Action:

Make sure both local and peer addresses are on the same network.

%SERIAL-W-HDLC_DRIVER <*text*>

Explanation:

Generic warning message from the serial card's HDLC driver.

Recommended Action:

If this message appears repeatedly, contact Enterasys Technical Support.

%SERIAL-W-HIFN_DRIVER <*text*>

Explanation:

Generic warning message from the serial card's HIFN driver.

Recommended Action:

If this message appears repeatedly, contact Enterasys Technical Support.

%SERIAL-W-PORT_CABLE_BAD Port <*name>*: External clocks are unstable: Try reseating the cable

Explanation:

The external clock supplied to the serial card is unstable.

Recommended Action:

Try reseating the serial cable. If problem persists, contact Enterasys Technical Support.

%SERIAL-W-PPPSHIM_DUP_IPADDR ppp shim: Cannot update peer IP address on port *<port>*: local and peer addresses are the same

Explanation:

During IP PPP negotiation, the IP addresses for the local and peer routers are the same.

Recommended Action:

Check the configuration.

%SERIAL-W-PPPSHIM_NO_DST ppp shim: Cannot update peer IP|IPX address on port *<port>*: peer does not have an address

Explanation:

During PPP IP/IPX negotiation for the specified port, the peer did not supply its IP/IPX address.

Recommended Action:

Statically specify peer IP/IPX address on the **interface create** CLI command for the specified port.

%SERIAL-W-PPPSHIM_SUBNET_MISMATCH ppp shim: Cannot update peer IP address on port *<port>*: not on same subnet as source(src *<ipaddr>*, dst *<ipaddr>*)

Explanation:

During PPP IP negotiation for the specified port, the local and peer IP addresses were not on the same subnet.

Recommended Action:

Check the configuration. Both the XP and the peer should be on the same IP subnet.

Error Messages

%SERIAL-E-CLI_ERROR_SEND_FAIL cli command was not sent to due to IPC failure

Explanation:

Failed to communicate with WAN module.

Recommended Action:

Attempt to execute CLI command again. If command fails, hotswap the WAN module. If problem persists, contact Enterasys Technical Support.

%SERIAL-E-CLI_MAX_COMPENCR cli: Reached maximum number of ports/vc's with compression/encryption.

Explanation:

The maximum number of ports/vc's with compression and/or encryption enabled has been exceeded.

Recommended Action:

Disable encryption and/or compression on some vc's or ports until you are below the limit. The command "frame-relay|ppp show stats port <*port*>" can be used to see whether or not it is disabled on a port.

%SERIAL-E-CLI_VCCOMP cli: port %d vc %d already has compression enabled.

Explanation:

Attempt to apply compression on a vc with compression already enabled.

Recommended Action:

Check the configuration to ensure that there is no duplication of enabling compression. For example, you would see this message if you have set compression on se.5.1.100 and then you try and save the command "frame-relay set payload-compress ports se-5.1.(100-105)." Warning: if you get this message, the command that you tried to save may not have been executed. You may wish to use "frame-relay show stats port<*port*>" to check which vc's have compression enabled or disabled.

%SERIAL-E-EGRESS_FR_DEC_FAIL egress: failed to forward from vc <*number>* on port <*name>*

Explanation:

Frame relay packet received can't be forwarded.

Recommended Action:

Contact Enterasys Technical Support.

%SERIAL-E-EGRESS_PPP_DEC_FAIL egress: failed to forward on port <name>

Explanation:

PPP packet received can't be forwarded.

Recommended Action:

Contact Enterasys Technical Support.

%SERIAL-E-IPC_SEND_FAILED IPC send failed in routine *<name>* with code *<number>*

Explanation:

XP failed to communicate with WAN module.

Recommended Action:

Hotswap the WAN module.

%SERIAL-E-IPDSTADDR_REUSE_PORT peer address < ip-address > is already used by interface on slot: < number > port: < port > and can't be reassigned to slot: < number >, port: < port >

Explanation:

This message appears when trying to assign the same IP peer address to different ports.

Recommended Action:

Use different peer addresses for different interfaces.

%SERIAL-E-IPDSTADDR_REUSE_VC peer address < ip-address > is already used by interface on slot: < number > port: < port > and can't be reassigned to slot: < number > , port: < port > , vc: < number >

Explanation:

This message appears when trying to assign the same IP peer address to different frame relay VCs.

Recommended Action:

Use different peer addresses for different interfaces.

%SERIAL-E-IPXDSTADDR_REUSE_PORT peer address < ipx-address > is already used by interface on slot: < number > port: < port > and can't be reassigned to slot: < number > , port: < port >

Explanation:

This message appears when trying to assign the same IPX peer address to different ports.

Recommended Action:

Use different peer addresses for different interfaces.

%SERIAL-E-IPXDSTADDR_REUSE_VC peer address < ipx-address > is already used by interface on slot: < number > port: < port > vc: < number > and can't be reassigned to slot: < number >, port: < port >, vc: < number >

Explanation:

This message appears when trying to assign the same IPX peer address to different frame relay VCs.

Recommended Action:

Use different peer addresses for different interfaces.

%SERIAL-E-MLP_PORT_SET port %d is a member of %s which already has %s enabled.

Explanation:

The message appears when you try to set a feature (such as encryption) on a port, but the feature is already enabled on the bundle which contains that port.

Recommended Action:

Check the configuration to ensure that a feature is enabled only once on a port.

%SERIAL-E-MLPASSEMBLY received a new frame on *<port>* before the previous frame was assembled

Explanation:

The frame cannot be assembled because one or more fragments were lost.

Recommended Action:

None.

%SERIAL-E-MLPCREATIONFAILED failed to create mp group (<group>) since slot <slot> can only have <number> mp groups

Explanation:

An attempt was made to create more MP groups than the number of available physical ports.

Recommended Action:

Check the configuration and make sure that the number of MP bundles are less than the number of physical ports on the module.

%SERIAL-E-PHY_PORT_SET %s member port %d already has %s enabled.

Explanation:

An attempt was made to enable a feature on a bundle which contains a port with that feature already enabled. You can enable features only once on a port.

Recommended Action:

Check the configuration and make sure that if you want to enable a feature on a bundle (e.g., compression or encryption), the bundle does not contain ports with that feature already enabled.

%SERIAL-E-SAMEADDR local address (%s) and peer address (%s) are the same.

Explanation:

An attempt was made to use the same address for the local address and the peer address.

Recommended Action:

Check the configuration and make sure that the peer address and local address on the WAN interface are not the same.

%SERIAL-E-WAN_FRVLAN port (%d) vc (%d) could not be added to vlan (%d) since it is already assigned to vlan (%d).

Explanation:

An attempt was made to add a frame relay port and vc to a vlan when it was already assigned to a different vlan.

Recommended Action:

Check the configuration and make sure that the frame relay port is assigned to only one vlan. The vlan show command can be used to see which vlan the port is assigned to.

%SERIAL-E-WAN_NO_MEM can't allocate memory on wan card

Explanation:

Ran out of memory on WAN card.

Recommended Action:

Contact Enterasys Technical Support.

%SERIAL-E-WAN_PPPVLAN port (%d) could not be added to vlan (%d) since it is already assigned to vlan (%d).

Explanation:

An attempt was made to add a ppp port to a vlan when it was already assigned to a different vlan.

Recommended Action:

Check the configuration and make sure that the ppp port is assigned to only one vlan. The vlan show command can be used to see which vlan the port is assigned to.

Chapter 57

SmartTRUNK Error Messages

This chapter describes the error messages for the SmartTRUNK facility.

Informational Messages

%STRNK-I-CREATED SmartTRUNK(s) < name > are successfully created

Explanation:

This message is displayed when a SmartTRUNK has been successfully created.

Recommended Action:

Informational message. No action necessary.

%STRNK-I-PORTSADDED Ports port_name> added to SmartTRUNK

Explanation:

This message is displayed when ports have been added to a SmartTRUNK.

Recommended Action:

Informational message. No action necessary.

%STRNK-I-PORTSREMOVED Ports < port_name > removed from SmartTRUNK < name >

Explanation:

This message is displayed when ports have been removed from a SmartTRUNK.

Recommended Action:

Informational message. No action necessary.

%STRNK-I-REMOVED SmartTRUNK < name > removed

Explanation:

This message is displayed when a SmartTRUNK has been removed.

Recommended Action:

Informational message. No action necessary.

%STRNK-I-STATUS SmartTRUNK status change detected: st.<name> - <status>

Explanation:

This message is displayed when a SmartTRUNK operational status has changed.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%STRNK-W-ADDED Port port_name> already part of SmartTRUNK

Explanation:

This error message is displayed when the user attempts to add a port to a SmartTRUNK and the port is already a member of the same SmartTRUNK.

Recommended Action:

Verify the port specified is not a member of the specified SmartTRUNK.

%STRNK-W-AGINGERROR SmartTRUNK <*name>* aged out due to <*string>*, probable misconfiguration

Explanation:

This message is displayed when the Hunt Group protocol receives an invalid control message or does not receive a hello message within a specific period. The SmartTRUNK is brought down as a result of this.

Recommended Action:

Check connection and remote switch state.

%STRNK-W-INVLD Received ctrl pkt on <port_name> port <port_number> not part of hunt group

Explanation:

This message is displayed when a SmartTRUNK control packet was received on a SmartTRUNK port which does not have the Hunt Group protocol enabled.

Recommended Action:

Verify SmartTRUNK has Hunt Group protocol enabled.

%STRNK-W-MISCONFIG SmartTRUNK < name > misconfigured on port <port_name >

Explanation:

This message is displayed when SmartTRUNK is misconfigured, e.g. 2 ports of a SmartTRUNK are connected to 2 different remote switches. Seen only if the Hunt Group protocol is enabled.

Recommended Action:

Verify SmartTRUNK connections/configuration.

%STRNK-W-TIMEOUTIGNORED Timeout <seconds> ignored for SmartTRUNKs <name> as no protocol is enabled, using default timeout of 1 second

Explanation:

This message is displayed when the timeout is specified for a SmartTRUNK in a no-protocol mode.

Recommended Action:

No action required, timeout is ignored.

Error Messages

%STRNK-E-CREATEQ Error creating LGRP queue

Explanation:

This message is displayed when a queue for the link group cannot be created due to lack of resources.

Recommended Action:

Contact Enterasys Technical Support.

%STRNK-E-DIFFGRP Port(s) port_name> already part of a different SmartTRUNK

Explanation:

This error message is displayed when the user attempts to add a port to a SmartTRUNK and the port is already a member of an existing SmartTRUNK group.

Recommended Action:

Verify the port specified is not a member of another SmartTRUNK.

%STRNK-E-DIFFHASH Hash Function for port_name is different than%s

Explanation:

The hash mode of this mode does not match that of the other ports belonging to the SmartTRUNK.

Recommended Action:

Check the has mode of the ports belonging to the SmartTRUNK and set the port's hash mode appropriately.

%STRNK-E-DIFFMEDIA Media type of port '<*port_name*> does not match that of all other ports

Explanation:

The media type of the port being added is not the same as the media type of the other ports belonging to the SmartTRUNK.

Check the media type of the ports belonging to the SmartTRUNK and use the appropriate media type.

%STRNK-E-DIFFNEGOTIATION Port <code>port_name></code> auto-negotiation setting does not match %s setting

Explanation:

The auto negotiation setting of the port being added is not the same as that of the other ports in the same trunk.

Recommended Action:

Change the auto negotiation setting of the port to that of the other ports in the SmartTRUNK.

%STRNK-E-DIFFSPEED Port speed of port_name does not match speed of other STRNK ports

Explanation:

The speed of the port being added is to the same as that of the other ports already part of the SmartTRUNK.

Recommended Action:

Check the speed of the ports belonging to the SmartTRUNK and use a port of the appropriate speed.

%STRNK-E-DISABLED SmartTRUNK is disabled, cannot transmit data

Explanation:

This message is displayed when a SmartTRUNK has been administratively disabled or all ports of a SmartTRUNK are inactive.

Recommended Action:

Enable SmartTRUNK or check for misconfiguration of SmartTRUNK.

%STRNK-E-DUPX Port *<port_name>* is not full-duplex, cannot add to SmartTRUNK

Explanation:

The port being added to the SmartTRUNK should be full duplex. A half duplex port cannot be added to the SmartTRUNK.

Check the settings of the port and make it full duplex.

%STRNK-E-EXISTS SmartTRUNK < name > already exists

Explanation:

This message is displayed when the SmartTRUNK being created already exists.

Recommended Action:

Verify the name of the SmartTRUNK being created.

%STRNK-E-FAILED SmartTRUNK(s) < name > could not be created

Explanation:

This message is displayed when an error is encountered while creating a SmartTRUNK because system memory is insufficient.

Recommended Action:

Upgrade memory on Control Module.

%STRNK-E-FAILREGMCASTADDR Failed to register multicast address

Explanation:

The register groupcast call to the kernel failed.

Recommended Action:

Contact Enterasys Technical Support.

%STRNK-E-MCASTREG Cannot register huntgroup mcast address

Explanation:

This message is displayed when the link group task is unable to register the hunt group multicast address.

Recommended Action:

Contact Enterasys Technical Support.

%STRNK-E-NEGFAILED SmartTRUNK(s) < name > could not be deleted

Explanation:

This message is displayed when a SmartTRUNK is being deleted and if the SmartTRUNK has member ports on it or the SmartTRUNK has other actions created on it.

Recommended Action:

Remove all member ports. Verify no other action is present on the SmartTRUNK.

%STRNK-E-NOMEM Out of memory, cannot transmit control packets

Explanation:

The link group task cannot allocate memory.

Recommended Action:

Contact Enterasys Technical Support.

%STRNK-E-NON_ENET Cannot add non ethernet port to SmartTRUNK

Explanation:

This message is displayed when a non ethernet port, WAN HSSI or Serial, is added to a SmartTRUNK. SmartTRUNK only supports Ethernet, Fast Ethernet or Gigabit Ethernet ports.

Recommended Action:

Verify the port being added to a SmartTRUNK is an ethernet port.

%STRNK-E-OTHERCMDS Remove other commands for *<name>* before deleting SmartTRUNK

Explanation:

This message is displayed when SmartTRUNK is deleted and there are actions on SmartTRUNK that have not been removed.

Recommended Action:

Remove command enable on SmartTRUNK before negating SmartTRUNK.

%STRNK-E-PORTSATTACHED Remove member ports from <name> before deleting SmartTRUNK

Explanation:

This message is displayed when a SmartTRUNK is deleted before the member ports are deleted.

Recommended Action:

Delete ports from SmartTRUNK before deleting SmartTRUNK.

%STRNK-E-STNOTFOUND SmartTRUNK <*name>* not found

Explanation:

This message is displayed when a non-existent SmartTRUNK is specified for any SmartTRUNK command.

Recommended Action:

Verify SmartTRUNK has been created.

%STRNK-E-TIMER Cannot create STRNK global timer

Explanation:

The timer call to the kernel failed.

Recommended Action:

Contact Enterasys Technical Support.

%STRNK-E-XMTQFULL Cannot send packet, transmit Q full

Explanation:

This message is displayed when the queue for sending control packets is full and SmartTRUNK control packets cannot be transmitted.

Recommended Action:

None.

Chapter 58

SNMP Error Messages

This chapter describes the error messages for the Simple Network Management Protocol facility.

Information Messages

%SNMP-I-DS_REGISTERED RMON Data Source registered.

Explanation:

RMON data source is registered on the XP.

Recommended Action:

Informational message. No action required.

$\% SNMP\text{-}I\text{-}DS_UNREGISTERED\ RMON\ Data\ Source\ un\text{-}registered.}$

Explanation:

RMON data source is un-registered on the XP.

Recommended Action:

Informational message. No action required.

%SNMP-I-ENABLED SNMP Agent enabled

Explanation:

The SNMP Agent on the XP has started.

Recommended Action:

Informational message. No action required.

%SNMP-I-RMON_ENABLED RMON agent enabled.

Explanation:

RMON is enabled on the XP.

Recommended Action:

Informational message. No action required.

%SNMP-I-SENT_TRAP Sending SNMPv1 trap < trap > to management station

Explanation:

The SNMP Agent sent the specified Trap to the Management Station.

Recommended Action:

Informational message. No action required.

Warning Messages

%SNMP-W-GENERAL_WARNING <General warning message>

Explanation:

The SNMP Agent detected an unexpected condition while processing a request or sending a trap.

Recommended Action:

Contact Enterasys Technical Support

%SNMP-W-RMON_DISABLED RMON Agent resource allocation failure.

Explanation:

RMON agent resource allocation has failed.

Recommended Action:

Contact Enterasys Technical Support.

%SNMP-W-RMON_MEM, RMON memory max'ed out. You may want to add more memory to RMON.

Explanation

RMON has reached its maximum allocated memory and can not fill any more entries in its tables.

Recommended action

Allocate more memory with the RMON set memory command, limit the number of entries in the tables, or reduce the number of ports that you are collecting data on. Verify the memory with the RMON show status command.

Error Messages

%SNMP-E-ADD_COMM_FAIL Add community failed reason=<reason>

Explanation:

Adding an SNMP community failed.

Recommended Action:

Verify that the community string is correct and reenter command.

%SNMP-E-ADD_TARGET_FAIL Add target failed reason=<reason>

Explanation:

Adding an SNMP target failed.

Recommended Action:

Verify that the target parameters are correct and reenter command.

%SNMP-E-DS_REG_FAILED Internal Error Data Source NOT registered.

Explanation:

The XP is out of memory and RMON cannot get what it needs.

Recommended Action:

Use the system show capacity memory command to see memory usage.

%SNMP-E-GENERAL_ERROR < General error message>

Explanation:

The SNMP Agent detected an error while processing a request or sending a trap.

Recommended Action:

Contact Enterasys Technical Support

%SNMP-E-MIB_LOCKED <mib-name> is locked and cannot be enabled or disabled

Explanation:

User attempted to disable a MIB which controls access to the SNMP agent. This is not allowed.

Recommended Action:

Select a different MIB name.

%SNMP-E-MIB_NOT_IMPLEMENT <mib-name> is not implemented

Explanation:

User attempted to disable/enable a MIB which in not implemented.

Recommended Action:

Select a different MIB name and try the command again.

%SNMP-E-NO_ENABLED_TARGETS No configured managers are enabled to receive SNMPv1 traps

Explanation:

Even though an agent has been configured to send SNMP Traps to a manager, a trap cannot be sent by the XP because the configuration has them all disabled.

Recommended Action:

Enable the Management Station to receive SNMPv1 traps in the config file.

%SNMP-E-NO_TARGETS No managers defined to receive SNMPv1 traps

Explanation:

The SNMP Agent cannot send a Trap because the user did not define a Management Station to receive the trap.

Recommended Action:

Specify a Management Station to receive SNMPv1 traps.

%SNMP-E-REM_COMM_FAIL Remove community failed reason=<reason>

Explanation:

Removing an SNMP community failed.

Recommended Action:

Verify that the community string is correct and reenter command.

%SNMP-E-REM_TARGET_FAIL Remove target failed reason=<reason>

Explanation:

Removing an SNMP target failed.

Recommended Action:

Verify that the target parameters are correct and reenter command.

%SNMP-E-STOPTIMER Internal Error stop timer failed code <number>

Explanation:

This message is displayed when a system software error has occurred.

Contact Enterasys Technical Support.

%SNMP-E-TRAP send trap pdu to host "<host_name>" failed: <error>

Explanation:

This message is displayed when a system software error has occurred.

Recommended Action:

Check your network connection via ping or traceroute.

%SNMP-E-TRAP_DISABLED This trap type has been disabled

Explanation:

The specified trap cannot be sent because this trap type has been disabled.

Recommended Action:

Enable the sending of this trap type in the configuration file.

%SNMP-E-WRITECONFIG Internal Error writing startup file code < number >

Explanation:

This message is displayed when a system software error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 59

Packet-Over-Sonet Error Messages

This chapter describes the error messages for the Packet-Over-Sonet facility.

Informational Messages

%SONET-I-SONETAPS_SWITCH %s EVENT CAUSED AN APS SWITCH FROM %s TO %s

Explanation:

This is an informational message which is displayed when an external event causes the Automatic Protection Switching (APS) function to switch from the working port to the protection port.

Recommended Action:

Informational message. No action required.

Warning Messages

%SONET-W-GCASTRLSE Cannot release gcast entry %d

Explanation:

This message is displayed as a result of an internal error

Contact Enterasys Technical Support.

Error Messages

%SONET-E-APS_CFG_INVALID The working port and protecting port cannot be the same.

Explanation:

This message is displayed when a user tries to configure a port as both a protecting port and a working port.

Recommended Action:

Check to see that the port being configured is the one intended.

%SONET-E-APS_CFG_PRESENT Invalid port %s. This port is already configured as '%s'

Explanation:

This message is displayed when a command tries to configure a port as a protecting port, but the port has already been configured as an APS working port (or vice versa).

Recommended Action:

The command probably specified a different port than was intended. Please check the port being configured and make sure that it is the one intended.

%SONET-E-APS_HIGHERPRIO Bridge request <string> was not executed. Higher Priority requests exists on port port>

Explanation:

This error message is displayed when an attempt to execute an APS Bridge request on a port and the port already has a higher priority bridge request on it.

Recommended Action:

This may be a temporary condition. Retry.

applicable only to the Protecting port. Negate the other commands or apply them to the Protecting port *<port>*.

Explanation:

This message is displayed when configuring APS. The port that is being configured as a Working port has conflicting commands in the config.

Recommended Action:

Negate those commands or reapply those commands to the Protecting port.

%SONET-E-APS_INVALIDOPER Invalid bridge request'string on port <port_number>

Explanation:

This error message is displayed when an attempt to execute an APS Bridge request on a port that was not configured for APS was made.

Recommended Action:

Call Enterasys Technical Support.

%SONET-E-APS_MISMATCH Unable to configure APS.

Explanation:

This message is displayed when configuring APS. The port being configured has some other command that has been applied. The Protecting port inherits the configurative values from the Working port.

Recommended Action:

Negate the commands that have been applied to the Protecting port and apply them on the Working port.

%SONET-E-APS_PROTSW_EXISTS A protection switch command already exists on the **%s** port -- **%s**. The protection switch command can only be applied to either the working port or the protecting port at any given time.

Explanation:

A protection switch command already exists on either the working port or the protecting port.

If you want to change the port to which you applied a protection switch, you must first disable the switch, then can apply it to the new port.

%SONET-E-APS_SINGLEPORT Option '%s' requires a single Sonet port

Explanation:

This message appears when multiple ports are specified as working or protecting ports.

Recommended Action:

For APS, only one port can be specified in a given command.

%SONET-E-APS_UNAVAILABLE Error initializing EPT table. APS was not configured on port %s

Explanation:

This message appears as a result of an internal error while configuring APS.

Recommended Action:

Note message and actions performed which caused it, and contact Enterasys Technical Support.

%SONET-E-OPTIONNOTALLOWEDONPORT Port **%s**, this option is not allowed for this type of port.

Explanation:

The operation attempted is not allowed for ports of this type.

Recommended Action:

Check to see that the port on which you attempted the operation is the port you intended.

%SONET-E-SONET_APSPROTONLY This option requires a port that has been already configured as a Protecting port.

Explanation:

This message is displayed when a certain APS command has specified a port and the port is not already configured as a Protecting port.

Configure the port as a Protecting port or apply the command on a port that has been configured as a Protecting port.

%SONET-E-VALUE_TOO_LONG Value in CLI command is too long

Explanation:

The value specified for CIRCUIT ID is too long.

Recommended Action:

Specify a value of 64 characters or less.

Fatal Messages

%SONET-F-SONET_NOMEM Memory allocation failed: %s

Explanation:

The router has run out of memory.

Recommended Action:

Call Enterasys Technical Support.

Chapter 60

SR Error Messages

This chapter describes the error messages for the SR facility.

Informational Messages

%SR-I-CLOCK_TEMPOKAY Clock card temperature is within %s

Explanation:

The temperature of the clock card is within tolerance.

Recommended Action:

None.

%SR-I-CPU0_TEMPOKAY CM-0 temperature is within %s

Explanation:

The temperature of the control module in slot 0 is within tolerance.

Recommended Action:

None.

%SR-I-CPU1_TEMPOKAY CM-1 temperature is within %s

Explanation:

The temperature of the control module in slot 1 is within tolerance.

None.

%SR-I-FABRIC1_TEMPOKAY Fabric-1 card temperature is within %s

Explanation:

The temperature of the fabric-1 card is within tolerance.

Recommended Action:

None.

%SR-I-FABRIC2_TEMPOKAY Fabric-2 card temperature is within %s

Explanation:

The temperature of the fabric-2 card is within tolerance.

Recommended Action:

None.

%SR-I-SLOT_TEMPOKAY Slot %d temperature is within %s

Explanation:

The temperature of the specified module is within tolerance.

Recommended Action:

None.

Warning Messages

%SR-W-CLOCK_TEMPTOOHIGH Clock card temperature has exceeded **%s**

Explanation:

The temperature of the clock card is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-CPU0_TEMPTOOHIGH CM-0 temperature has exceeded %s

Explanation:

The temperature of the control module in slot 0 is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-CPU1_TEMPTOOHIGH CM-1 temperature has exceeded %s

Explanation:

The temperature of the control module in slot 1 is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-FABRIC1_TEMPTOOHIGH Fabric-1 card temperature has exceeded **%s**

Explanation:

The temperature of the clock card is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-FABRIC2_TEMPTOOHIGH Fabric-2 card temperature has exceeded %s

Explanation:

The temperature of the clock card is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-QSENDFULL queue full

Explanation:

This message is displayed when an internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-W-RESTART_TIMER_FAILED Debounce, NUE_Restart_

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-W-SLOT_TEMPTOOHIGH Slot %d temperature has exceeded %s

Explanation:

The temperature of the specified module is too high.

Recommended Action:

Turn off equipment. Verify that the room temperature is not greater than the allowed maximum of 104 F. Contact Enterasys Technical Support.

%SR-W-SPURIOUSINT spurious interrupt, unknown reason

Explanation:

This message is displayed when something interrupts system operation. This message is often caused by thermal conditions.

Recommended Action:

Check for fan failure.

%SR-W-START_TIMER_FAILED Debounce, NUE_Start_Timer

Explanation:

An internal error has occurred.

Contact Enterasys Technical Support.

%SR-W-STOP_TIMER_FAILED Debounce, NUE_Stop_Timer

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-W-WAIT_TEG_EVENTS Debounce, NUE_Wait_For_TEG_Events

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

Error Messages

%SR-E-DIAGQ Couldn't create DIAGNOSTIC Queue

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%SR-F-CREATE_TIMER_FAILED NU_Create_Simple_Timer failed, sts=%d

Explanation:

An internal error has occurred.

Contact Enterasys Technical Support.

%SR-F-HISRFAIL failed to create driver HISR, sts=%d

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-F-LISRFAIL failed to register driver LISR, sts=%d

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-F-NOSTKMEM not enough memory to allocate HISR stack

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

%SR-F-QSENDFAIL queue send failed, sts=%d

Explanation:

An internal error has occurred.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 61

STATIC Error Messages

This chapter describes the error messages for the STATIC facility.

Error Messages

%STATIC-E-DUPLICATEGWAYS Route to destination %s has gateway <*name*> specified multiple times.

Explanation:

This message is displayed when the command to add a static route failed because duplicate gateways are specified with gate-list option.

Recommended Action:

Do not specify duplicate gateway addresses in gate-list option.

%STATIC-E-GLISTALLOCFAIL Calloc failed for Gateway List.

Explanation:

The command to add a static route failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If problem persists, contact Enterasys Technical Support.

%STATIC-E-GLISTEXISTS Gateway List exists with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route for a Gateway List, but the given static route already exists.

Recommended Action:

Specify a different static route and/or associated Gateway List.

%STATIC-E-GWAYALLOCFAIL Calloc failed for Gateway.

Explanation:

The command to add a static route failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If problem persists, contact Enterasys Technical Support.

%STATIC-E-GWAYEXISTS Gateway exists with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route for a Gateway but the given static route already exists.

Recommended Action:

Specify a different static route and/or associated Gateway.

%STATIC-E-GWAYIFLISTEXISTS Gateway or Interface list option specified with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route with interface or gateway option but the given static route already exists with either intf-list or gate-list option.

Recommended Action:

Specify a different static route or remove the existing route with intf-list or gate-list option and later add static route with interface or gateway option.

%STATIC-E-GWAYNULL Nonexistent Gateway for static route.

Explanation:

The software component that manages static route resources has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%STATIC-E-GWAYREACHEN0 Gateway *<name>* for the default route is only reachable through en0 interface.

Explanation:

This message is displayed when the command to add a static route failed because the gateway is reachable only through the en0 interface.

Recommended Action:

Specify the proper gateway address. The gateway should be reachable through an interface other than en0.

%STATIC-E-IFLISTALLOCFAIL Calloc failed for Interface List.

Explanation:

The command to add a static route failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If problem persists, contact Enterasys Technical Support.

%STATIC-E-IFLISTEXISTS Interface List exists with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route for an Interface List, but the given static route already exists.

Recommended Action:

Specify a different static route and/or associated Interface List.

%STATIC-E-ILLGWAYVAL Gateway address cannot be zero or multicast address.

Explanation:

This message is displayed when the command to add a static route failed because of invalid gateway address.

Recommended Action:

Specify the proper gateway address. It should not be zero or a multicast address.

%STATIC-E-INTFALLOCFAIL Calloc failed for Interface.

Explanation:

The command to add a static route failed due to a memory allocation error.

Recommended Action:

Try re-executing the command. If problem persists, contact Enterasys Technical Support.

%STATIC-E-INTFEXISTS Interface exists with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route for an interface, but the given static route already exists.

Recommended Action:

Specify a different static route and/or associated interface.

%STATIC-E-INTFNULL Nonexistent Interface for static route.

Explanation:

The software component that manages static route resources has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%STATIC_E_MAXGATESXCEEDED Maximum number of gateways <*number>* exceeded.

Explanation:

This message is displayed when the command to add a static route failed because the number of maximum gateways for gate-list option is exceeded.

Recommended Action:

Specify gateways only up to maximum gateways in gate-list option.

%STATIC_E_MAXINTFSXCEEDED Maximum number of interfaces < number > exceeded.

Explanation:

This message is displayed when the command to add a static route failed because the number of maximum interfaces for intf-list option is exceeded.

Recommended Action:

Specify interfaces only up to maximum interfaces in intf-list option.

%STATIC-E-ROUTEEXISTS Static route to network *<name>* already exists.

Explanation:

A static route has been added multiple times.

Recommended Action:

Remove the duplicate static route entries.

%STATIC-E-ROUTENOTFOUND Static route to destination *<name>* not found.

Explanation:

The software component that manages static route resources has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%STATIC-E-ROUTEOVFL No more free routes max *<number>* current *<number>*.

Explanation:

The maximum number of static routes that can be configured has been reached.

Recommended Action:

If possible, remove unused static routes.

%STATIC-E-SNGLGWAYIFEXISTS Gateway or Interface option specified with this static route.

Explanation:

This error message is displayed when the user attempts to specify a static route with intf-list or gate-list option but the given static route already exists with either interface or gateway option.

Recommended Action:

Specify a different static route or remove the existing route with interface or gateway option and later add static route with gate-list or intf-list option.

Chapter 62

STP Error Messages

This chapter describes the error messages for the STP facility.

Informational Messages

%STP-I-BPDU_FILTER BPDU filter on port <number> has been <"disabled" or "enabled">

Explanation:

This message is displayed to inform the user whether the BPDU filter on the given port has been enabled or disabled.

Recommended Action:

This message is displayed for the user's benefit. No action is required.

%STP-I-PORT_STATUS Port status change detected: <number> - <text>

Explanation:

The link state of the port has changed.

Recommended Action:

This message is displayed for the user's benefit. No action is required.

%STP-I-STP_VERSION STP version changed to <version>

Explanation:

This message is displayed when the STP version is changed.

Recommended Action:

No action is required.

Warning Messages

%STP-W-BADMLPTYPE Attempt to create MLP on unknown module type = <type>

Explanation:

This message is displayed when an MLP bundle is being created on an unknown WAN module.

Recommended Action:

Verify that the WAN module in question supports MLP. Contact Enterasys Technical Support.

%STP-W-NOWAN Spanning Tree is not supported on WAN modules.

Explanation:

You cannot enable STP on a WAN port because it is not a supported operation. However, other ports entered will be added to the spanning tree.

Recommended Action:

None.

%STP-W-NOWAN_FILTER BPDU filtering is not supported on WAN modules.

Explanation:

This message is displayed because you cannot filter out BPDUs on WAN modules. However, other ports entered will have filtering enabled.

Recommended Action:

None.

%STP-W-PORTSTATE port state value '<*number>*' not valid

Explanation:

This message is displayed when the port state is not valid.

Recommended Action:

Verify port's operational state.

%STP-W-RSTPNOWAN RSTP is not supported on WAN ports. Please disable RSTP first.

Explanation:

This message is displayed when the user attempts to add a WAN port to a spanning tree running RSTP.

Recommended Action:

Disable RSTP and retry this command. Otherwise, only the non-WAN ports will be added to the spanning tree.

Error Messages

%STP-E-APS_ENABLED It is invalid to Enable/Configure STP on cportnumber> as it is configured as a Protecting port. If you wish, you may enable/configure STP on the Working port cportnumber>

Explanation:

This message is displayed when the user attempts to enable STP on a protecting port.

Recommended Action:

Negate the command and configure STP on the working port instead.

%STP-E-BADMLPSLOT Attempt to create MLP on an invalid slot = <number>

Explanation:

This message is displayed when the user attempts to create an MLP bundle on an invalid module.

Recommended Action:

Correct the module number and try again.

%STP-E-BADWANPROTO Spanning Tree not supported for the WAN protocol on port %s

Explanation:

STP is not supported for the WAN protocol specified.

Recommended Action:

None.

%STP-E-CANTADDDFLT Cannot add DEFAULT vlan to spanning tree

Explanation:

This message is displayed when the user tries to create a PVST instance on the default VLAN.

Recommended Action:

A PVST instance cannot be created on the default VLAN. The default VLAN has a default spanning tree associated with it.

%STP-E-CMDDEPRECATED This command is deprecated. <text>

Explanation:

This message is displayed when a deprecated STP command is called.

Recommended Action:

None.

%STP-E-COSTSETCANTDELLG Port cost is set for the *<text>*, negate the stp port cost and then delete the *<text>*.

Explanation:

This message is displayed when the port cost has been set on a SmartTRUNK and the user tries to delete the SmartTRUNK.

Recommended Action:

Negate the port set cost command before deleting the SmartTRUNK.

%STP-E-COSTSETCANTDELMLP Port cost is set for the MLP bundle, negate the stp port cost and then delete the MLP bundle.

Explanation:

This message is displayed when the user tries to remove an MLP bundle with STP port cost assigned.

Recommended Action:

Negate the "stp set port" command and try again.

%STP-E-CREATEQ error creating '<name>' queue - error=<error_code>

Explanation:

This message is displayed when there was an error creating STP queue.

Recommended Action:

The error could be due to a lack of resources (-32) or an invalid event was specified (-8).

%STP-E-DFLTNOTALWD User STP facility for accessing default spanning tree

Explanation:

This message is displayed when PVST config facility is used to access the default spanning tree.

Recommended Action:

Use the STP config facility to access the default spanning tree.

%STP-E-DFLTSTPCFLCT One or more access ports in the vlan <name> have default stp enabled the spanning tree first.

Explanation:

This message is displayed when the user tries to create a PVST instance for a VLAN with STP already enabled.

Recommended Action:

Disable STP on all of the VLAN ports and try again.

%STP-E-EVENTWAIT error in wait for events

Explanation:

This message is displayed when any of the resources required for the full operation of the STP protocol could not be created.

Recommended Action:

This error could be because the STP timer could not be created or the bridge group management address could not be registered or the BPDUs receive queue could not be created. This could be due to a lack of resources. Contact Enterasys Technical Support.

%STP-E-FAILREGMGMTADDR failed to register bridge group address

Explanation:

This message is displayed when bridge group address is not registered.

Recommended Action:

This error is due to an invalid bridge management group address or VLAN or port number.

%STP-E-IPCFAIL IPC failure with module '%d' - '%s'

Explanation:

Control Module fails to communicate with the WAN module. This usually happens if the firmware loaded does not support WAN.

Recommended Action:

Contact Enterasys Technical Support.

%STP-E-MCASTREG error registering multicast address - error = <*error_code*>

Explanation:

This message is displayed when the bridge group management address could not be registered.

Recommended Action:

The error could be due to the registration table being full (-51) or the address is not a multicast address (-55).

%STP-E-MISMATCH Port < number > cannot be added to < st.number > because of attribute mismatch

Explanation:

The current mode or status of a port will not permit it to be added to a smarttrunk. A common cause of this problem is all ports being put into the administrative *down* state when the XP boots without a startup configuration file.

Recommended Action:

This problem can be fixed in one of two ways. First, you can configure something such as name and location on the XP and then reboot. Second, you can issue a 'port disable <number>' command from config mode, save this to the active config, and then negate it. This will bring the port into the administratively *up* state, after which you can continue with the smarttrunk configuration.

%STP-E-MPNOTFOUND MLP bundle <mp-number> not found

Explanation:

This message is displayed when the specified MLP bundle cannot be found.

Recommended Action:

Create the MLP bundle specified before trying the command again.

%STP-E-NOFLOWFORCESTP Can't enable flow-bridging-mode and force-STP-state simultaneously on port <*number>*

Explanation:

This error message is displayed when the user attempts to issue the **stp force** command for a port that is already assigned flow-bridging-mode.

Recommended Action:

Remove the port from the flow-bridging-mode and then issue the **stp force** command for the desired port.

%STP-E-NOMEM processing error - insufficient memory

Explanation:

This message is displayed when memory could not be allocated.

Recommended Action:

Contact Enterasys Technical Support.

%STP-E-NOPVST Unable to access STP port information

Explanation:

This message is displayed when the STP task is not able to determine the STP information for the port.

Recommended Action:

Check that the port is correct. Contact Enterasys Technical Support.

%STP-E-NOSTP STP should be enabled on port < number > for force-STP-state to succeed

Explanation:

This error message is displayed when the user attempts to issue the **stp force** command for a port that has not had STP enabled.

Recommended Action:

Enable STP on the desired port and then issue the **stp force** command for the port.

%STP-E-NOSUCHPVST The Spanning Tree for vlan *<name>* does not exist

Explanation:

This message is displayed when a PVST instance does not exist for the specified VLAN.

Recommended Action:

Check the VLAN name for correctness, if a spanning tree instance has not been created for the desired VLAN, create one.

%STP-E-NOSUCHVLAN VLAN '<name>' does not exist

Explanation:

This error message is displayed when the user attempts to specify an invalid VLAN name.

Recommended Action:

Ensure that you are properly specifying a valid VLAN name and try again.

%STP-E-NOTMEMBOFPVST The Port is not a member of this spanning tree

Explanation:

This message is displayed when the user is trying to configure STP parameters for a port which does not belong to the PVST instance specified.

Recommended Action:

Either the port or the PVST instance specified is incorrect. Adjust parameters as appropriate.

%STP-E-NOTMEMOFVLAN Port is not a member of vlan < name >

Explanation:

This message is displayed when the user tries to enable PVST on a port for a particular VLAN and the port is not part of the VLAN.

Recommended Action:

Check that the command is correct and try again.

%STP-E-NOVC Unable to access VC information

Explanation:

No VC information can be found in STP-enabled WAN ports, possibly due to internal errors.

Recommended Action:

Verify that the VC in question is set up correctly. Contact Enterasys Technical Support if problem persists.

%STP-E-NOWAN Spanning Tree is not supported on WAN modules

Explanation:

You cannot enable STP on a WAN port because it is not a supported operation.

Recommended Action:

None.

%STP-E-NOWAN_FILTER BPDU filtering is not supported on WAN modules.

Explanation:

Command fails because BPDU filtering is not supported on WAN ports.

Recommended Action:

None.

%STP-E-PORTDISABLEDBYMGMT Unable to set vlan <*VLAN_name*> to state <*state_name*> because port is administratively disabled

Explanation:

This error message is displayed when the user attempts to issue the **stp force** command on a given port that had been previously disabled by the network administrator using a "port disable" command.

Recommended Action:

Negate (delete) the "port disable" designation on the desired port and then issue the **stp force** command to set the port state.

%STP-E-PORTNO port no ''rort_number>' is invalid

Explanation:

This message is displayed when the port number is invalid.

Recommended Action:

Verify that the port exists before trying again.

%STP-E-PRISETCANTDELLG Priority is set for the <text>, negate stp set priority and then delete the <text>

Explanation:

This message is displayed when the user has configured a priority for the SmartTRUNK and tries to delete the SmartTRUNK.

Recommended Action:

Negate the port set priority command before deleting the SmartTRUNK.

%STP-E-PRISETCANTDELMLP Priority is set for the MLP bundle, negate stp set priority and then delete the MLP bundle.

Explanation:

This message is displayed when the user tries to remove an MLP bundle with port priority assigned.

Recommended Action:

Negate the "stp set port" command and try again.

%STP-E-PROTIDINV Invalid Protocol ID

Explanation:

This message is displayed when a BPDU with an invalid protocol identifier (i.e., a non-zero protocol identifier) is received.

Recommended Action:

Make sure other bridges are running STP and the packets received are not corrupted.

%STP-E-PVST_RSTPENBLD Please disable RSTP on this spanning tree first

Explanation:

This message is displayed when the user attempts to remove the spanning tree instance when it is running RSTP.

Recommended Action:

Disable RSTP before deleting the spanning tree instance.

%STP-E-PVSTENBLD Disable STP on all ports for this spanning tree first

Explanation:

This message is displayed when the user tries to delete ports from a VLAN or when the user tries to negate the PVST create command on a VLAN, while PVST is enabled on some of the ports belonging to the VLAN.

Recommended Action:

Disable PVST on the ports before negating any of the above commands.

%STP-E-RSTPNOWAN RSTP is not supported on WAN ports. Please disable RSTP first.

Explanation:

This message is displayed when the user attempts to add a WAN port to a spanning tree running RSTP.

Recommended Action:

Disable RSTP and retry this command.

%STP-E-RSTPWANEXISTS Cannot enable RSTP when WAN exists. Please remove all WAN ports from the spanning tree first.

Explanation:

This message is displayed when the user attempts to enable RSTP on a spanning tree with WAN ports.

Recommended Action:

Remove all WAN ports from the spanning tree before enabling RSTP.

%STP-E-STATESETCANTDELLG < text> state has been administratively disabled, negate the disabled line and then delete the < text>.

Explanation:

This message is displayed when the SmartTRUNK state has been administratively disabled and the user tries to delete the SmartTRUNK.

Recommended Action:

Negate the disabled command before deleting the SmartTRUNK.

%STP-E-STATESETCANTDELMLP MLP bundle state has been administratively disabled, negate the disabled line and then delete the MLP bundle.

Explanation:

This message is displayed when the user tries to remove an MLP bundle disabled by management.

Recommended Action:

Negate the corresponding "port disable" command and try again.

%STP-E-STNOTFOUND <3> <text> <port_number> not found

Explanation:

This message is displayed when the STP task cannot find the SmartTRUNK specified.

Recommended Action:

Check the SmartTRUNK instance specified and try the command again.

%STP-E-STPSETCANTDELLG STP is enabled on <text>, negate the stp enable command and then delete the <text>.

Explanation:

This message is displayed when STP is enabled on a SmartTRUNK and the user tries to delete the SmartTRUNK.

Recommended Action:

Disable STP on the SmartTRUNK and then negate the SmartTRUNK.

%STP-E-STPSETCANTDELMLP STP is enabled on MLP bundle, negate the STP enable command and then delete the MLP bundle.

Explanation:

This message is displayed when the user tries to remove an MLP bundle with STP still configured on it.

Recommended Action:

Negate the "stp enable" command and try again.

%STP-E-STRTTIMER error starting '<stp>' timer - error=<error_code>

Explanation:

This message is displayed when the STP timer could not be started.

Recommended Action:

The STP timer was not created and therefore could not be started.

%STP-E-TIMER error creating '<stp>' timer - error=<error_code>

Explanation:

This message is displayed when an STP timer could not be created.

The error could be due to a lack of resources (-32) or an invalid parameter was passed to the timer creation routine (-13).

%STP-E-UNABLETOSETSTATE Unable to set vlan <*VLAN_name>* to state <*state_name>*

Explanation:

This error message is displayed when the user attempts to issue the **stp force** command on a port to which this sort of assignment has already been made. (The new **stp force** designation cannot overwrite the old one.)

Recommended Action:

Negate (delete) the original **stp force** command and then try to set the appropriate state for the given port again.

%STP-E-VCPRI The parameter '<number>' exceeds valid VC priority range between 0, and 15 inclusive

Explanation:

This message is displayed when the VC priority specified is greater than 15.

Recommended Action:

Try again with a VC priority value of less than 16.

%STP-E-VNAMINVALID Vlan Name < name > is Invalid

Explanation:

This message is displayed when the VLAN name supplied in the command is invalid.

Recommended Action:

Check the VLAN name for correctness and try the command again.

%STP-E-WANEEPTFAIL WAN EEPT program failure with module '<number>' - error = <error-code>

Explanation:

This is an internal error.

Contact Enterasys Technical Support.

%STP-E-XMTQFULL unable to send frame xmit queue full

Explanation:

This message is displayed when the STP BPDUs could not be sent. This could be because the transmit queue is full or there is indication that the STP frame is to be dropped.

Recommended Action:

None.

Chapter 63

SYS Error Messages

This chapter describes the error messages for the SYS facility.

Informational Messages

%SYS-I-ACTIVEBKPLANE switching fabric in slot *<number>* is currently active

Explanation:

This message shows which switching fabric on an XP is currently active.

Recommended Action:

Follow the error message output for an appropriate resolution to the problem.

%SYS-I-ADDFAILED Image '<name>' not added

Explanation:

This message is displayed when the system is unable to add the specified XP system address.

Recommended Action:

Follow the error message output for an appropriate resolution to the problem.

%SYS-I-ARPADDED, ARP: entry added for <ipaddress>

Explanation:

This message is displayed when an ARP entry is added from the "Config" mode.

Informational message. No action necessary.

%SYS-I-BKPLANEINSERTED < name > module inserted in slot < number >

Explanation:

This message appears when a switching fabric is hotswapped into the XP-8600.

Recommended Action:

Informational message. No action required.

%SYS-I-BKPLANEOFFLINED < name > module in slot < number > off-lined by operator

Explanation:

This message appears when a switching fabric is hotswapped out of the XP-8600.

Recommended Action:

Informational message. No action required.

%SYS-I-BKPLANEREMOVED < name > module removed from slot < number >

Explanation:

This message appears when a switching fabric is hotswapped out of the XP-8600.

Recommended Action:

Informational message. No action required.

%SYS-I-BOOTADDED Image '<name>' added

Explanation:

This message appears when the specified XP system image has been successfully added to the external flash.

Recommended Action:

Informational message. No action required.

%SYS-I-CFGTOBACKUP Configuration file updated on backup control module

Explanation:

The Configuration file has been updated on the Backup Control Module.

Recommended Action:

None.

%SYS-I-CFGUPDATED configuration file updated from active control module in slot *<slot_id>*

Explanation:

This message applied to the Backup Control Module. It indicates that the configuration file on the Backup Control Module was updated from the Primary Control module in the other slot.

Recommended Action:

None.

%SYS-I-CHS_BACKUP_OK <0> <0> image successfully chosen on Backup CM

Explanation:

This message is displayed when you have successfully chooses an image on the backup control module for the next reboot.

Commands:

To choose an image on the backup control module only use:

system image choose <imagename> backup-cm

To choose same image on both the primary and backup control modules.

system image choose <imagename>

Recommended Action:

None.

%SYS-I-CHS_NONE_BACKUP_OK <0> <0> Backup CM-no image chosen for reboot

Explanation:

This message is displayed when you have successfully chosen no image on the backup control module for the next reboot.

Commands:

To choose no image on the backup control module only use:

system image choose none backup-cm

To choose no image on both the primary and backup control modules.

system image choose none

Recommended Action:

None.

%SYS-I-CHS_NONE_PRIMARY_OK <0> <0> Primary CM-no image chosen for reboot

Explanation:

This message is displayed when you have successfully chosen no image on the primary control module for the next reboot.

Commands:

To choose no image on the primary control module only use:

system image choose none backup-cm

To choose no image on both the primary and backup control modules.

system image choose none

Recommended Action:

None.

%SYS-I-CHS_PRIMARY_OK <0> <0> image successfully chosen on Primary CM

Explanation:

This message is displayed when you have successfully chooses an image on the primary control module for the next reboot.

Commands:

To choose an image on the primary control module only use:

 $system\ image\ choose\ {\it < imagename}{\it >}\ primary-cm$

To choose same image on both the primary and backup control modules.

system image choose <imagename>

Recommended Action:

None.

%SYS-I-DEL_BACKUP_OK <0> <1> system image %s deleted from Backup CM

Explanation:

This message is displayed when you have successfully deleted an image on the backup control module.

Commands:

To delete image on backup control module, use:

system image delete <imagename> backup-cm

To delete same image from both the primary and backup control modules, use: system image delete <i magename>

Recommended Action:

None.

%SYS-I-DELETED_DIRECTORY_ONLY <0> <1> directory %s was deleted.

Explanation:

This message is displayed when an image has not been correctly added to the flash card of either the primary or backup control modules. For example, this happens when the XP is accidentally powered off during a "system image add" process. If this happens an imagename is resident on the flash card that contains no actual image data. This image will NOT appear under the "system image list" commands. But if you try to add the same image again, the add will fail and a message appears saying "That image is already present".

Recommended Action:

Delete the empty imagename using the system image delete <imagename> command.

%SYS-I-DSCVMOD discovered '<name>' module in slot <number>

Explanation:

This message specifies the type of hardware module detected during the XP's startup sequence.

Recommended Action:

Informational message. No action required.

%SYS-I-FANSOKAY system fans are operational

Explanation:

This is an informational message only.

None.

%SYS-I-FLASHCRD Mounting *<number> MB* Flash card

Explanation:

This message indicates that the XP is attempting to mount an external PCMCIA Flash Module.

Recommended Action:

Informational message. No action required.

%SYS-I-FLASHMNTD < number > MB Flash card mounted

Explanation:

This message indicates that the XP has successfully mounted a PCMCIA Flash Module.

Recommended Action:

Informational message. No action required.

%SYS-I-HOTSWAP_INQUEUED Hotswap busy, request for hotswap - in slot 12 queued

Explanation:

This message appears when you attempt to hotswap a module while another module is being hotswapped.

Recommended Action:

Informational message. No action required.

%SYS-I-HOTSWAPIN module in slot < number > is hotswapped in

Explanation:

This message appears when a module is hotswapped in to the XP.

Recommended Action:

Informational message. No action required.

%SYS-I-HOTSWAPOUT module in slot *<number>* is hotswapped out

Explanation:

This message when a module is hotswapped out of the XP. The module can be hotswapped out either by pushing the hotswap button on the module or by issuing the system hotswap out command.

Recommended Action:

Informational message. No action required.

%SYS-I-INITPORT initialized slot < number >, port < number >

Explanation:

This message indicates that the specified port in the given slot number has been initialized.

Recommended Action:

Informational message. No action required.

%SYS-I-INITSLOTS Initializing system slots - please wait

Explanation:

This message is displayed when the XP is initializing the system slots.

Recommended Action:

Informational message. No action required.

%SYS-I-INITSYS initializing system <name>

Explanation:

This message is displayed when the XP is initializing.

Recommended Action:

Informational message. No action required.

%SYS-I-MODPROBE Detecting installed media modules - please wait

Explanation:

This is an informational message only.

None.

%SYS-I-MULTICPU additional CPU Module(s) detected in slot: < number >

Explanation:

This message appears when the XP has detected an additional CPU module.

Recommended Action:

Informational message. No action required.

%SYS-I-NETSTART network interfaces are now enabled

Explanation:

This message indicates that the network interfaces are up and the XP is ready to send and receive traffic.

Recommended Action:

Informational message. No action required.

%SYS-I-NEWBAUD Console baud rate changing from *<number>* to *<number>*

Explanation:

This message indicates that the XP console's baud rate has assumed a new value.

Recommended Action:

Informational message. No action required.

%SYS-I-NOBOOTIMAGES No boot images available

Explanation:

This message informs the user that there is no XP boot image stored in the current PCMCIA Flash card.

Recommended Action:

Informational message. No action required.

%SYS-I-NOPWRSPLY power supply in slot *<slot>* not present or not turned on

Explanation:

This is an informational message only.

Recommended Action:

None.

%SYS-I-PORT_AUTONEG Port < number > - Speed: < number > - Duplex: < number > - Auto-Negotiation: < number > - Input Encap: < number >

Explanation:

This message displays the autonegotiating characteristics (if any exist) for the given port.

Recommended Action:

Informational message. No action required.

%SYS-I-PWROKAY power supply in slot *<slot>* is operational

Explanation:

This is an informational message only.

Recommended Action:

None.

%SYS-I-PWRSPLY

Explanation:

This message indicates which power supply is present or not present, whether it is ON or OFF, Over Temperature, or not and Over Current or not.

Recommended Action:

Depending on the content of the message, you may need to replace the power supply.

%SYS-I-SLAVECPU Redundant CPU Module going into standby mode

Explanation:

This message only appears on the console of the slave CPU. It identifies the slave CPU as working in standby mode.

Informational message. No action required.

%SYS-I-SYSIMGTOBACKUP <0> <0> system image sent to backup control module.

Explanation:

This message is displayed when the system image sent to backup control module

- The following CLI commands can be used to perform the indicated system image copy:
 - To add the system image to the backup control module only:
 system image add <tftp server ip address> <imagename> backup-cm
 - To add a system image to both the primary control module and the backup control module:
 system image add <tftp server ip address> <imagename> or
 system image add tftp://<tftp server ip address>/<imagename>

Recommended Action:

Before you send another command to the backup control module, please wait for the final message. After the image is successfully downloaded to the backup control module, the following final message is sent to the console of the primary control module, i.e., the CLI, by the backup control: "System image stored on backup control module- complete."

%SYS-I-TEMPOKAY system temperature is within operating parameters

Explanation:

This is an informational message only.

Recommended Action:

None.

%SYS-I-WAN_SYNCH_SUCCESS Successfully synchronized with WAN card on channel <number>

Explanation:

This message appears when the Control Module on the XP communicates successfully with the specified WAN module during system initialization.

Recommended Action:

Informational message. No action required.

Warning Messages

%SYS-W-CLI_ERROR_SEND_FAIL cli command was not sent to slot **%d** due to IPC failure: **%s**

Explanation:

Communication between the Main CPU module and the WAN module failed.

Recommended Action:

Re-enter cli command. If problem persists, contact Enterasys Technical Support.

%SYS-W-CLI_NO_WAN_PROTO No protocol specified for port port set' command to specify the WAN encapsulation

Explanation:

No protocol specified for the port.

Recommended Action:

Use the port set command to specify the WAN port encapsulation protocol.

%SYS-W CLI_NON_PPP_PORT card <id> port port_number is not a PPP port

Explanation:

An unrecognized opcode was received.

Recommendation:

Retry the command. If problem persists, contact Enterasys Technical Support.

%SYS-W-CLI_NON_WAN_PORT Port < port > is not a wan port

Explanation:

Not a WAN port.

Recommended Action:

Specify a WAN port.

%SYS-W-CLI_RECV_FAIL error on receiving msg from wan card, err code <code>

Explanation:

There was an error receiving a message from the wan card.

Recommendation:

Retry the command. If problem persists, contact Enterasys Technical Support.

%SYS-W-CLI_RECVQ_FAIL create receive queue failed, can't receive msg from wan card

Explanation:

Creation of the receive queue failed.

Recommendation:

Retry the command. If problem persists, contact Enterasys Technical Support.

%SYS-W-CLI_WAN_WRONG_PPP_PORT_NAME Wrong PPP port name

Explanation:

The wrong PPP port was specified.

Recommended Action:

Specify the correct PPP port name.

%SYS-W-HEAP75FULL heap is at 75 percent of maximum usage

Explanation:

System is running low on DRAM.

Recommended Action:

Upgrade the amount of DRAM DIMM memory to the next highest recommended amount.

%SYS-W-HEAP85FULL heap is at 85 percent of maximum usage

Explanation:

System is running low on DRAM.

Upgrade the amount of DRAM DIMM memory to the next highest recommended amount.

%SYS-W-HEAP95FULL heap is at 95 percent of maximum usage

Explanation:

System is running low on DRAM.

Recommended Action:

Upgrade the amount of DRAM DIMM memory to the next highest recommended amount.

%SYS-W-HEAPDEPLETED heap depleted, requested %d but returning %d

Explanation:

Cannot allocate enough memory for request.

Recommended Action:

Upgrade to next higher amount of system memory if problem persists.

%SYS-W-IPC_FAILURE ipc failure, slot <*slot_id*> port <*port*>

Explanation:

An IPC failure indicates that the card in the specified slot had a hardware fault.

Recommendation:

Verify that the card is seated properly in the chassis. If problem persists the card needs to be replaced.

%SYS-W-L3CANTADDFLOW All the flows in the hash bin %d are No Age or Control going to the CPU.

Explanation:

Flows are installed into the L3 table via a hashing function. Hashing the flow will point to a slot with bins. If all the bins in a slot are full, the oldest one is bumped out to make room. If all the bins are full of entries that are intended to be permanent for any number of reasons, you will see this error.

Recommended Action:

There are several options:

Remove unwanted static entries that hash to the specified bin.

Clear the L3 table.

Change the hashing function so that the slot will not keep getting hit.

%SYS-W-L4BDG L4 bridging configuration error: receive <string> packet

Explanation:

The Control Module received a non-IP/IPX packet. The packet has been dropped.

Recommended Action:

If this message appears repeatedly, contact Enterasys Technical Support.

%SYS-W-NIAFREETMOUT network interface not responding to packet free requests

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-W-NIAXMTMOUT network interface not responding to packet transmit requests

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-W-NOBKPLANES One or more module are required to operate system

Explanation:

There are no module installed.

Recommended Action:

Install modules.

%SYS-W-NO_COMP module *<module>* in slot *<slot>* does not support compression

Explanation:

The specified module does not support compression.

Recommendation:

Retry the command. If problem persists, contact Enterasys Technical Support.

%SYS-W-NO_ENCR module <*id*> in slot <*slot_id*> does not support encryption

Explanation:

The specified module does not support encryption.

Recommendation:

Contact Enterasys Technical Support.

%SYS-W-NOCONFIG no configuration file

Explanation:

This message appears when the XP cannot detect any startup configuration file.

Recommended Action:

Ensure that a startup configuration file exists and that the XP is able to access that file.

%SYS-W-NOENHCAP < facility > capability not available for <system_name >

Explanation:

The requested facility is not available.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-W-NOPASSWD no password for <system_name>, use 'system set password' to add one

Explanation:

This is simply a warning informing the user that the system has no security.

Recommended Action:

Enter Configure mode and set a system password using the 'system set password' command.

%SYS-W-NOSPEEDDUPLEX cannot set speed/duplex on 1 Gig Port.

Explanation:

Speed and duplex settings are not individually configurable on gigabit ethernet ports.

Recommended Action:

If you want to turn off auto-negotiation on gigabit ethernet ports and set port to full duplex and 1000 Mbits speed, turn off auto-negotiation on the port. This is also useful when connected to a buffered repeater.

%SYS-W-NOSPEEDFIBER cannot set speed to 10Mbits on 100Mbit Fiber Port

Explanation:

This message appears when the user attempts to assign a 10 Mbits speed to a 100Mbits fiber port.

Recommended Action:

This message is merely a warning that such an action cannot be performed. No action, aside from ensuring that a speed of 100Mbits has been assigned to the given fiber port, is required.

%SYS-W-ONLYLANPORTALLOWED Only Lan port names are allowed.

Explanation:

Only LAN port names are allowed.

Recommended Action:

Specify a LAN port name.

%SYS-W-ONLYPHYPORTALLOWED Only physical port names are allowed

Explanation:

Only physical port names are allowed.

Recommended Action:

Specify a physical port.

%SYS-W-PWRFAIL power supply in slot <*slot_number*> has failed.

Explanation:

This message is displayed when the power supply fails.

Recommended Action:

Replace the power supply.

%SYS-W-RMON_RX RMON queue empty: enabling updates

Explanation:

The RMON receive queue is enabled.

Recommended Action:

None.

%SYS-W-RMON_TX RMON queue failed: disabling updates

Explanation:

The RMON transmit queue has failed.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-W-RTCIVTIME real-time clock had bad time - clock has been reset

Explanation:

This message appears when the real-time clock has become corrupted or otherwise invalid. The time will be reset back to 0.

This message is for the user's benefit. No action is required.

%SYS-W-WAN_TOD_RECEIVE_FAIL error on receiving msg from wan card, error code <code>

Explanation:

There was an error receiving an error message.

Recommended Action:

If problem persists, contact Enterasys Technical Support.

%SYS-W-WAN_TOD_RECVQ_FAIL create queue failed, cannot receive msg from wan card

Explanation:

The create queue has failed and message can not be received from the WAN card.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-W-WAN_TOD_SEND_FAIL WAN TOD msg not sent due to IPC failure

Explanation:

A WAN TOD message was not sent due to an IPC failure.

Recommended Action:

Contact Enterasys Technical Support.

$\%SYS\text{-}W\text{-}WAN_TOD_TMR_FAIL$ create timer failed, cannot periodically update time on WAN card

Explanation:

The create timer failed.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-W-WAN_TOD_WAIT_FAIL WAN TOD event with unsuccessful status

Explanation:

A WAN TOD event was unsuccessful.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-W-WANPORTOUTOFRANGE The specified port *<port>* is out of range

Explanation:

Port is out of range.

Recommended Action:

Specify a port that is within range.

Error Messages

%SYS-E-ADD_IMAGE_BACKUP_FAIL Failure to add image to Backup CM.

Explanation:

This message is displayed when the image has not been added to the backup control module.

Recommended Action:

Try to added the image to the backup control module again.

%SYS-E-ATMCELLMAPPINGNOTSUPPORTED Port set failed, cell mapping value not valid for this PHY type.

Explanation:

You can not set cell mapping on this type of port.

Recommended Action:

Specify an appropriate port.

%SYS-E-ATMFRAMINGNOTSUPPORTED Port set failed on port *<port>* framing value not valid for this PHY type.

Explanation:

You can not set framing on this type of port.

Recommended Action:

Specify an appropriate port.

%SYS-E-ATMMEDIANOTSUPPROTED Port set failed on port <*port*> media type can only be set on MMF, SMF, UTP PHYs.

Explanation:

You can not set media on this type of port.

Recommended Action:

Specify an appropriate port.

%SYS-E-ATMPORTINFAILURE Port *<port>* experienced previous failure.

Explanation:

This port has failed port diagnostics. Either its PHY has been removed, or there is a hardware failure.

Recommended Action:

If this occurs and the PHY is present, contact Enterasys Technical Support.

%SYS-E-ATMSCRAMBLENOTSUPPORTED Port set failed, scramble value not valid for this PHY type.

Explanation:

You can not set scramble value on this type of port.

Recommended Action:

Specify an appropriate port.

%SYS-E-BACKUP_NO_SUCH_IMAGE <0> <1> Backup CM-no image named %s

Explanation:

This message appears when you try to delete a non-existent image with the system image delete command.

Commands:

To delete an image from the backup control module, use:

system image delete <imagename> backup-cm

To delete an image from both the primary and backup control modules, use:

system image delete <imagename>

Recommended Action:

You should run the system image list command to see the available images and then choose a name from those displayed. It is important to note the difference between the name of the image (displayed in the left column of system image list) and the version number of the image (displayed in parentheses in the right column). The image *name* should be used with the system image delete command.

%SYS-E-BAD_IPP_MEM Bad IPP Memory at 0x<hex_value> on channel <number>

Explanation:

Module in slot number corresponding to channel number has failed.

Recommended Action:

Replace line card module.

%SYS-E-BAD_OPP_MEM Bad OPP Memory at 0x<hex_value> on channel <number>

Explanation:

Module in slot number corresponding to channel number has failed.

Recommended Action:

Replace line card module.

%SYS-E-BAD_PORT_MEM Bad Memory at 0x<hex_value> on port <port_number>

Explanation:

Specified port has failed diagnostics.

Recommended Action:

Replace line card module.

%SYS-E-BADADDR Bad IP address: <IP_address> ignored

Explanation:

This error message appears when the user attempts to specify an invalid IP address.

Recommended Action:

Ensure that the specified IP address is correct and that it is being referenced with the proper syntax.

%SYS-E-BADCHKSUM Bad CRC in CPU received packet (srcCEPs=0x<hex_value>)

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-E-BADDEVICE Bad device name: '<name>'

Explanation:

This error message appears when the user attempts to access the XP's file system with an illegal device name.

Recommended Action:

Use one of the valid device names ("bootflash", "slot0", or "slot1") to access the file system.

%SYS-E-BADURL bad URL specified: *<URL>*

Explanation:

This error message appears when the user specifies an invalid or otherwise illegal URL.

Ensure that the URL being referenced is correct and has been specified using the appropriate syntax.

%SYS-E-BAUDFAIL < name>: Failed to change baud rate

Explanation:

This message appears when the system set terminal baud command was run to change the baud rate of the serial management console port, but the system was unable to set the baud rate to the value requested.

Recommended Action:

This message probably indicates a programming error because the CLI parser checks the baud rate for validity before trying to change the serial port. In general, it indicates that the serial hardware cannot run at the requested baud rate.

%SYS-E-CHS_BACKUP_FAIL> <0> <0> failure to choose image on Backup CM

Explanation:

The system is unable to choose the image on the backup control module.

Commands

To choose an image on the backup control module, use:

system image choose <imagename> backup-cm

To choose an image for both the primary and backup control modules, use: system image choose <imagename>

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-CHS_PRIMARY_FAIL> <0> <0> failure to choose image on PRIMARY CM

Explanation:

The system is unable to choose the image on the primary control module for the next reboot.

Commands

To choose an image on the primary control module, use:

system image choose <imagename> primary-cm

To choose an image for both the primary and backup control modules, use:

system image choose <imagename>

Contact Enterasys Technical Support.

%SYS-E-CLI_FR_SERVICE_REUSED service profile (%s) is being used for frame relay circuits

Explanation:

This message appears when a PPP service profile cannot be created because the name is already used by a frame relay service.

Recommended Action:

Select another name for the PPP service.

%SYS-E-CM3_50_INVALID, Control Module (CM3) 'CPU-Esprit', is not supported on xp 8000 systems with a backplane jumpered for 50Mhz.

Explanation:

The control module is not supported.

Recommended Action:

Either remove all CM3 control modules or jumper the backplane for 62.5Mhz. The jumper is located behind the Power Supply(PS1). For 62.5Mhz, move the jumper to the top two pins.

%SYS-E-CONNREFUSED telnet: Unable to connect to remote host: : connection refused

Explanation:

This message appears when a user on an XP issues the "telnet" command to establish a telnet connection with a remote system but the remote system refuses the connection.

Recommended Action:

Check the remote system to determine why it isn't accepting telnet connections.

%SYS-E-DELETE_IMAGE_BACKUP_FAIL <0> <1> image (%s) delete from Backup CM failed

Explanation:

This message is displayed when an attempt to delete an image from the backup control module fails.

Commands

To list images on the primary control module, use: system image delete <imagename> backup-cm
To list images on both the primary and backup control modules, use: system image delete <imagename>

Recommended Action:

Retry making sure you are specifying the correct imagename.

%SYS-E-DELETING_CHOSEN_IMAGE <0> <1> you cannot delete the image %s.

Explanation:

This message appears when you attempt to delete an image from the PCMCIA Flash Module that has been chosen as the image for the XP to load on the next reboot. You are prevented from performing this operation.

Recommended Action:

First use either the **system image choose** *<imagename*> command to choose a new image or the **system image choose none** command to have no image chosen. Once you have done this, you may then delete the image.

%SYS-E-FACADD error adding facility '<name>'

Explanation:

System resources are limited and the SYS system facility failed to initialize.

Recommended Action:

Increase system memory and if problem persists, contact Enterasys Technical Support.

%SYS-E-FLASH_WRITEPROTECTED external FLASH card is writeprotected, please remove protection and reboot

Explanation:

This message is displayed when the external Flash card is detected with the write-protection on.

Recommended Action:

Remote the write-protection, reinstall the Flash card and reboot the system.

%SYS-E-FLASHMNTFAIL < number > MB Flash card could not be mounted

Explanation:

This message appears at boot time when the flash card cannot be mounted.

Recommended Action:

This message may indicate that this type of card is not supported, or that the write-protect switch is turned on, or that the file system contained in the flash card is corrupt. Reboot the XP using the same flash card. If problem persists, obtain a new flash card or contact Enterasys Technical Support.

%SYS-E-HOTSWAP_EMPTY slot <*slot_id>* is empty

Explanation:

This message is displayed when you are trying to hotswap out of an empty slot.

Recommended Action:

Hotswapping out of an empty slot is not possible.

%SYS-E-HOTSWAP_OCC slot <slot_id> is already occupied

Explanation:

This message is displayed when you are trying to hotswap into a slot that is already occupied.

Recommended Action:

Hotswapping into an occupied slot is not possible.

%SYS-E-HOTSWAPI_MASTER can not hotswap in the Active CPU

Explanation:

This message is displayed when you are trying to hotswap in the active CM module.

Recommended Action:

This action is not allowed.

%SYS-E-HOTSWAPIN module in slot *<slot_id>* is unrecognized or unsupported

Explanation:

The module in the specified slot is not recognized or is unsupported.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-HOTSWAPO_MASTER can not hotswap out the Active CPU

Explanation:

This message is displayed when you are trying to hotswap out the active CM module.

Recommended Action:

This action is not allowed.

$SYS-E-HSSI_NOCLOCK$ Invalid HSSI card revision (rev. 1.x) for clock option

Explanation:

This message appears when the HSSI card revision does not support the clock option listed.

Recommended Action:

Choose another clock option.

%SYS-E-ILLEGALCOPY Copying from *<source>* to *<destination>* is not allowed

Explanation:

This error message appears when the user attempts to perform an illegal copy operation from the specified source to the given destination.

Recommended Action:

Ensure that the copy source and destination are compatible.

%SYS-E-IMAGE_CANTSET nvram error setting <image_name>

Explanation:

This message appears when the system image choose command was unable to record the user's choice of which image should be used at next boot.

Recommended Action:

This message indicates file system corruption or a hardware failure. Contact Enterasys Technical Support.

%SYS-E-IMAGES_LIST_MULTIPLE <0> <0> image list: another user is listing the images. Please wait and try again.

Explanation:

This message appears when more than one user is trying to list the images from a PCMCIA Flash Module. Only one user at a time can perform this operation.

Recommended Action:

Wait and try again.

%SYS-E-INVLDMOD Invalid Module in slot <slot_id>.

Explanation:

This message is displayed when the firmware detected unrecognized hardware.

Recommended Action:

Make sure that the firmware version is compatible with the hardware.

%SYS-E-IO %s: %s: I/O error

Explanation:

This message is displayed when the system is unable to close a file descriptor.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-IVCPUMODULE CPU module type < name > unrecognized

Explanation:

This error message appears when the XP detects an unrecognized CPU module in the system.

Contact Enterasys Technical Support with a description of the circumstances, your system configuration, and the text of this error message.

%SYS-E-LIST_IMAGES_BACKUP_FAIL <0> <0> failure to list images on Backup CM.

Explanation:

This message is displayed when a list command of the images on the backup control module fails.

Commands

To list images on the backup control module, use:

system image list backup-cm

To list images on both the primary and backup control modules, use:

system image list all

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-LIST_IMAGES_PRIMARY_FAIL <0> <0> failure to list images on Primary CM.

Explanation:

This message is displayed when a list command of the images on the primary control module fails.

Commands

To list images on the primary control module, use:

system image list primary-cm

To list images on both the primary and backup control modules, use:

system image list all

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-MACASSIGNED Requested MAC *<MAC_address>* already assigned

Explanation:

This error message appears when the user attempts to specify a MAC address that is already in use.

Recommended Action:

Specify a different, unused MAC address.

%SYS-E-MACNOTOWNED Attempting to free unassigned MAC *<MAC_address>*

Explanation:

This error message appears when the user attempts to specify a MAC address that does not "belong" to the XP.

Recommended Action:

Ensure that the specified MAC address is correct and the XP has "ownership" of that address.

%SYS-E-MEM 95% of heap memory used

Explanation:

This condition may occur when you deploy the XP with a configuration that uses many Layer-2 MAC addresses, Layer-3 flows, routing table entries, and ports with RMON/RMON2 enabled.

Recommended Action:

Enterasys Networks recommends a Control Module memory upgrade.

%SYS-E-MEMUSESTATS Printing memory stats because no memory available

Explanation:

This message appears when the XP does not have sufficient memory. The per-task memory will print to the screen. The system then produces the %SYS-F-HEAPEMPRY error message on page 510.

Recommended Action:

Enterasys Networks recommends a Control Module memory upgrade.

%SYS-E-MIXED_MEDIA_OPTS Mixed Media option specified for port does not support the option or you have specified a mix of different media ports.

Explanation:

Mixed Media option specified for port does not support the option or you have specified a mix of different media ports.

Recommended Action:

Retry the command and specify the appropriate ports.

%SYS-E-MODULE_CRASH_DUMP Crash dump from module **%d** is as follows

Explanation:

This error message appears when a crash dump is specific to a module.

Recommended Action:

Check module and reboot router.

%SYS-E-MULTIPLEUSERS <0> <0> another user is adding, choosing or removing an image. Please wait and try again.

Explanation:

This message appears when more than one user is trying to add, choose, or delete images. Only one user at a time can perform these operation.

Recommended Action:

Wait and try again.

%SYS-E-NIAQBROKE Network receive queue error

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-E-NOBACKUPCM no backup CPU Module detected in system

Explanation:

This message is displayed when you are trying to copy data to the backup CM module when the system doe not have a backup CM module.

Recommended Action:

None.

%SYS-E-NOBUFS %s: %s: no buffer space available

Explanation:

This message appears if memory is allocated in the buffer and no space is available.

Recommended Action:

Upgrade memory.

%SYS-E-NODEVICE No device specified: '<name>'

Explanation:

This error message appears when a required device name has not been appropriately specified by the user in relation to a given command.

Recommended Action:

Ensure that you have specified a valid, required device name in association with the given command.

%SYS-E-NOENHCAP < capability > capability not available

Explanation:

The specified capability is not available on the present version of hardware.

Recommended Action:

To use the capability, upgrade the hardware.

%SYS-E-NOFLASHCARD external FLASH card not present (or write-protect switch is ON)

Explanation:

This message is displayed when the system does not detect a Flash card.

Recommended Action:

Make sure a Flash card is properly installed.

%SYS-E-NOHOTSWAP System Hotswap not supported

Explanation:

This message is displayed when you are trying to issue a hotswap command on a system where hotswap is not supported.

This action is not allowed.

%SYS-E-NOMEM %s: %s: insufficient memory

Explanation:

This message appears when required memory is unavailable.

Recommended Action:

Upgrade memory.

%SYS-E-NOMSG %s: %s: no message of desired type

Explanation:

Mibget getmsg did not return expected message while reading GateD kernel's routing table.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-NOTENABLED Device configuration only permitted from enabled mode

Explanation:

This message appears when a user attempts to enter Configure mode from Diagnostic mode.

Recommended Action:

The user must first leave Diagnostic mode and enter enabled mode with the enable command. Only then can the user enter Configure mode with the config command.

%SYS-E-PORTBUSPARITY Port bus parity error

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-E-PORTBUSWRITE Port bus write error at address 0x<hex_value>

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-E-PRIMARY_NO_SUCH_IMAGE <0> <1> Primary CM-no image named %s

Explanation:

This message appears when you try to delete a non-existent image with the system image delete command.

Commands:

To delete an image from the primary control module, use:

system image delete <imagename> primary-cm

To delete an image from both the primary and backup control modules, use:

system image delete <imagename>

Recommended Action:

The user should run the system image list command to see the available images and then choose a name from those displayed. It is important to note the difference between the name of the image (displayed in the left column of system image list) and the version number of the image (displayed in parentheses in the right column). The image *name* should be used with the system image delete command.

%SYS-E-PROTO %s: %s: protocol error

Explanation:

Mibget returned protocol error while reading GateD Kernel's routing table.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-RAT_FULL MAC address %s could not be added to the Router MAC Table of Port %s

Explanation:

Routing Address Table (RAT) for the given port was full and the mac address could not be added to the table. There may be too many interfaces created with unique mac addresses. VRRP could also be installing too many entries into the RAT.

Recommended Action:

Check how many interfaces are created with unique mac addresses. Check VRRP configuration. The RAT can be viewed with 'debug 12 rat port xxx' command.

%SYS-E-REDPARAMEQUAL maximum red threshold needs to be greater than minimum red threshold

Explanation:

Random Early Discard (RED) parameters in PPP or Frame Relay configurations have incorrect thresholds.

Recommended Action:

Check PPP or Frame Relay configurations on WAN card.

%SYS-E-SETDSTIME Unable to set daylight saving time

Explanation:

This message is displayed if an error occurs while setting daylight saving time.

Recommended Action:

Set time manually with the 'system set date' command. If problem persists, contact Enterasys Technical Support.

%SYS-E-SETTIME Daylight saving time was unable to set system time

Explanation:

System received an error trying to set the real time clock.

Recommended Action:

Set time manually with the 'system set date' command. If problem persists, contact Enterasys Technical Support.

%SYS-E-SOCKETSETTYPEMISMATCH Slot %d, The Socket Set upper channel and lower channel cards are different types.

Explanation:

This message appears when there are two cards of dissimilar type in the same socket set carrier module.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-SOCKETSETUPRCHNLSYNCFAIL The Socket_Set upper channel sync fails, hotswap out slot **%d**.

Explanation:

This message appears when the socket carrier module has only the lower channel in use, there is no card in the upper channel, and upper channel carrier channel sync logic has failed to sync up correctly. The carrier module will be hot swapped by software.

Recommended Action:

If problem persists, contact Enterasys Technical Support.

%SYS-E-SRCFILE missing source filename

Explanation:

This error message appears when the user attempts to conduct a file copy operation, but no source filename has been specified.

Recommended Action:

Ensure that the appropriate source filename is included in the command sequence.

%SYS-E-UNKNOWN_MODE Unknown mode set for deep hashing -- **%s**

Explanation:

System became confused about which hashing mode is being set.

Recommended Action:

Contact Enterasys Technical Support.

%SYS-E-UNKNOWNURL Unrecognized URL: <*URL*>

Explanation:

This error message appears when the XP encounters an unrecognizable URL.

Recommended Action:

Ensure that the specified URL is correct.

%SYS-E-UNKWNHOST unknown host '<name>'

Explanation:

This error message appears when the XP is unable to resolve the specified hostname's IP address.

Recommended Action:

Ensure that DNS is working correctly and that the specified hostname is correct.

%SYS-E-VFSBADINUSECNT %s: %s: invalid in-use count

Explanation:

This message appears when you attempt to modify the configuration on the XP. The file system where you store the Startup configuration file is corrupted and must be reformatted to fix the problem.

Recommended Action:

1. Record your current configuration information (it will be lost when you reboot your system or when you reformat the file system).

Note: If your system contains a PCMCIA module, a backup copy of your Startup configuration should have been stored on it so this step may not be necessary.

- 2. Reboot the XP. During the Boot Firmware initialization, press the Escape key to stop the System Firmware from booting. (Typically, the Boot Firmware waits two seconds for user interruption before starting to boot the System Firmware.)
- 3. At the Boot Firmware's CLI prompt, enter the following:

xp-boot> umount xp-boot> erasevfs xp-boot> mount -i xp-boot> boot

% SYS-E-VFSBADVERSION vfs_initialize_pcmcia: flash mount: bad VFS version - file system erased?

Explanation:

While trying to initialize the PCMCIA Flash Module, an illegal version number was detected. This is usually due to an erased PCMCIA Flash Module.

Recommended Action:

Use the boot image prompt command "pcmount -i" to initialize the PCMCIA Flash Module.

% SYS-E-VFSCORRUPT error while attempting to repair file system

Explanation:

While attempting to fix a problem detected by the file system verify, an error was detected. The file system is corrupt and cannot be fixed.

Recommended Action:

Use the boot image prompt (XP-boot) commands "erasepcvfs" and "pcmount -i" to initialize the PCMCIA Flash Module.

%SYS-E-VFSDISKCREATE %s: %s error initializing disk

Explanation:

This message appears when an error creating a native file in the virtual file system occurs.

Recommended Action:

Call Enterasys Technical Support.

%SYS-E-VFSDISKOPEN %s: %s error opening disk

Explanation:

This message appears when an error opening a native file in the virtual file system occurs.

Recommended Action:

Call Enterasys Technical Support.

%SYS-E-VFSDISKREAD %s: %s error reading disk

Explanation:

This message appears when an error seeking/reading native file in the virtual file system occurs.

Call Enterasys Technical Support.

%SYS-E-VFSDISKWRITE %s: %s error writing disk

Explanation:

This message appears when an error seeking/writing native file in the virtual file system occurs.

Recommended Action:

Call Enterasys Technical Support.

%SYS-E-VFSENTRYFREED file system block freed during verify

Explanation:

While verifying the VFS, a bad block was detected and fixed automatically.

Recommended Action:

Informational message only, no action necessary.

%SYS-E-VFSFILECLOSE %s: %s file close failed

Explanation:

This message appears when an error closing native file in the virtual file system occurs.

Recommended Action:

Call Enterasys Technical Support.

%SYS-E-VFSFILESYSFULL %s: %s: file system is full

Explanation:

System could not find any more space on the virtual file system.

Recommended Action:

Delete some files to make space. Upgrade to larger storage device.

%SYS-E-VFSINTFLASHBAD %s: %s: internal flash corrupted

Explanation:

Internal permanent flash memory is corrupted.

Should happen only during bootup. If rebooting does not help, boot to the boot prompt by using the ESC key while booting. Must be connected to console port to get the boot prompt. Use the commands: 'umount' to unmount the file system, 'erasevfs' to reset the internal flash, or 'mount-i' to remount the clean file system (the -i option reinitializes the file system).

%SYS-E-VFSMODECONFLICT %s: %s: conflicting mode for file open

Explanation:

Virtual file system is trying to perform an operation on a file with conflicting modes (e.g., read/write on a compressed file).

Recommended Action:

Call Enterasys Technical Support.

%SYS-E-XBARTMOUT Transmit timeouts to Xbar (destCEPs=0x<hex_value>)

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and need replacing.

%SYS-E-XFERBACKUP Data transfer to backup control module failed

Explanation:

XP is unable to transfer the configuration file to the backup CM module.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%SYS-F-2MANYCPUS too many CPUs, detected < number >, architectural limit < number >

Explanation:

More than the architectural number of redundant Control Modules were detected.

Recommended Action:

Remove all extra Control Modules.

%SYS-F-BAD_NIA_MEM Bad Memory at 0x<hex_value> on NIA

Explanation:

Control Module may have a hardware problem.

Recommended Action:

Configure the system to run diagnostics, then reboot. Note the diagnostics messages. If any NIA failures are detected, the Control Modules may be bad and needs replacing.

%SYS-F-BADADDRFLUSH cache flush with bad virtual address, '0x<hex_value>'

Explanation:

This message appears when the CPU was flushing a bad virtual address and the TLB may be corrupt.

Recommended Action:

System will reboot. Ensure all line cards, CPU, fan, and backplane are seated well. Run diagnostics on the system to ensure there are no system problems. If problem persists, contact Enterasys Technical Support.

%SYS-F-BADBLK memory free failed - block '0x<hex_value>' address is invalid (<number>)

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-BADFREEBLK memory corrupted - block '<hex_value>' on free list clobbered (0x<hex_value>,<number>,<number>)

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-BADMEMREG memory block '0x<hex_value>' is not in a valid memory region

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-BADNETBUF bad buffer '0x<hex_value>' from network interface

Explanation:

This message appears when the network interface chip on the Control Module accessed an invalid memory location.

Recommended Action:

System will reboot. Ensure all line cards, CPU, fan, and backplane are seated well. Run diagnostics on the system to ensure there are no problems with the Control Module card. If problem persists, contact Enterasys Technical Support.

%SYS-F-BADSLOT CPU is in an invalid slot < number > - must be in slot < number >

Explanation:

This message appears when the Control Module (CPU) is in an invalid slot.

Recommended Action:

Move the Control Module (CPU) to the appropriate slot. System will reboot.

%SYS-F-BLKFREE memory free failed - block '0x<hex_value>' is already free (<number>) (by: 0x<hex_value> 0x<hex_value> 0x<hex_value>)

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-BLKNOALLOC memory block '0x<hex_value>' should have been allocated

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-BUSERR bus error due to '<*error*>', at virtual address 0x<*hex_value*>

Explanation:

This message appears when a system bus error has occurred.

Recommended Action:

System will reboot. Ensure all line cards, CPU, fan, and backplane are seated well. Run diagnostics on the system to ensure there are no system problems. If problem persists, contact Enterasys Technical Support.

%SYS-F-CLI_ERROR_MEM_FAIL cli malloc has failed

Explanation:

Failed to allocate enough memory for command line interface process.

Recommended Action:

Upgrade system memory.

%SYS-F-CODEIVSEQ invalid code sequencing in file *<filename>*, line *<number>*

Explanation:

This message appears when there is a problem creating VLAN for subnets.

Recommended Action:

System will reboot. If problem persists, contact Enterasys Technical Support.

%SYS-F-FATALSYS <text>: fatal system error

Explanation:

This fatal error message appears when the XP experiences a system error from which it is unable to recover, resulting in a "crash".

Recommended Action:

Contact Enterasys Technical Support.

%SYS-F-HEAPEMPTY insufficient heap memory

Explanation:

System is running low on DRAM.

Recommended Action:

Upgrade the amount of DRAM DIMM memory to the next highest recommended amount.

%SYS-F-IVSYSTEM unrecognized or invalid system '<number>'

Explanation:

This message appears when The system ID is invalid.

Recommended Action:

The backplane ID is not valid for this version of Control Module and Software. Contact Enterasys Technical Support.

%SYS-F-L2DBLALLOC L2 entry 0x<hex_value>, allocated twice on port <number>

Explanation:

This message appears when an L2 table entry was erroneously allocated twice on the same port.

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L2 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L2IVLDVLAN invalid VLAN ID '<number>'

Explanation:

This message appears when an invalid VLAN ID was passed to the L2 software drivers.

Recommended Action:

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L2 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L3DBLALLOC L3 entry 0x<hex_value>, allocated twice on channel <number>

Explanation:

This message appears when an L3 table entry was erroneously allocated twice on the same channel.

Recommended Action:

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L3 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L3DBLFREE L3 entry 0x<hex_value>, freed twice on channel <number>

Explanation:

This message appears when an L3 table entry was erroneously deleted twice on the same channel.

Recommended Action:

The system will reboot. Run diagnostics on the system to ensure there are no memory problems with the L3 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L3HASHADRBAD bad entry address of 0x<hex_value> in segment 0x<hex_value>

Explanation:

This message appears when an L3 table pointer got corrupted.

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L3 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L3HASHBAD bad hash value of 0x<hex_value> in segment 0x<hex_value>

Explanation:

This message appears when a bad hash value was computed for an L3 table entry.

Recommended Action:

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L3 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-L3TBLBAD entry to be deleted 0x<hex_value>, not found on channel <number>, bucket <number>

Explanation:

This message appears when an L3 table entry was requested to be deleted on a channel and not found.

Recommended Action:

System will reboot. Run diagnostics on the system to ensure there are no memory problems with the L3 table. If problem persists, contact Enterasys Technical Support.

%SYS-F-MEMCORRUPT memory block '0x<hex_value>' has been corrupted

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-MEMHDRBAD malloc header size '<number>' is invalid

Explanation:

Software problems in the memory management software.

Report problem to Enterasys Technical Support.

%SYS-F-MEMHDRIDX malloc block '0x<hex_value>' header index '<number>' is invalid

Explanation:

Software problems in the memory management software.

Recommended Action:

Report problem to Enterasys Technical Support.

%SYS-F-READFAILURE Problem reading slot *<slot_number>* likely due to removing a line card without pushing the hotswap button, not letting a hot swap complete before removing the line card, a low power condition, or a power supply problem.

Explanation:

An external error has been detected.

Recommended Action:

Press the Hot Swap button or use the "system hotswap out" command to hot swap out line cards before removing them, allow hot swap operations on line cards to complete before removing them, verify the power cable is fully plugged into the power supply, and replace faulty power supplies. If the slot number printed out is the lowest numbered slot with a line card in it then the problem was most likely a power problem.

%SYS-F-TEMPFANSFAIL fan failure has caused overheating - system shutting down

Explanation:

This message is displayed when the fan has failed. The system is shutting down to prevent damage to the hardware.

Recommended Action:

Repair or replace the fan.

Chapter 64

Syslog Error Messages

This chapter describes the error messages for the Syslog facility.

Informational Messages

%SYSLOG-I-EMPTY Syslog buffer is empty.

Explanation:

This message appears when there is no local syslog output from the buffer for the user to view.

Recommended Action:

Informational message. No action required.

Warning Messages

%SYSLOG-W-NOBUFFER Syslog buffer is empty because syslog server is not defined.

Explanation:

This error message appears when the local syslog buffer is empty as a result of no syslog server having been defined for the XP.

Configure a syslog server using the system set syslog server command.

%SYSLOG-W-UNKWNHOST Cannot resolve syslog server '<*name*>'.

Explanation:

This error message appears when the XP is unable to resolve the hostname of the given syslog server into its IP address.

Recommended Action:

Specify the syslog server using its existing IP address and/or ensure that the XP is able to resolve the syslog server's hostname.

Error Messages

%SYSLOG-E-SENDMSG failed to contact syslog server '<*name*>': <*name*>

Explanation:

This message appears when the syslog server is unreachable.

Recommended Action:

Ensure the syslog server is reachable if not on the system.

%SYSLOG-E-SOCKET_OPEN_FAILED socket open failed in error log task

Explanation:

This message appears when a socket fails to open when sending error messages to the syslog server.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%SYSLOG-F-ERRORLOG_Q_CREATE_FAILED errlog Q create failed, '%s': %dSENDMSG failed to contact syslog server '<name>': <name>

Explanation:

This message appears when a queue to receive error messages fails to be created.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 65

T1T3CLI Error Messages

This chapter describes the error messages for the T1T3CLI facility.

Informational Messages

%T1T3CLI-I-SERVICENONFR service%s is not frame relay service

Explanation:

This message is displayed when the user tries to assign a non-Frame Relay service to a Frame Relay port.

Recommended Action:

Make sure that the service is a Frame Relay service.

%T1T3CLI-I-SERVICENONPPP service%s is not PPP service

Explanation:

This message is displayed when the user tires to assign a non-PPP service to a PPP port.

Recommended Action:

Make sure that the service is a PPP service.

Warning Messages

%T1T3CLI-W-MLPVLANADDFAIL vlan add port command failed on %s, starting clean-up

Explanation:

This message is displayed when adding a multilink PPP port to a specified VLAN fails.

Recommended Action:

None.

%T1T3CLI-W-VLANADDFAIL vlan add port command failed on wan slot %d port %d, starting clean-up

Explanation:

This message is displayed when adding a WAN port to a specified VLAN fails.

Recommended Action:

None.

Error Messages

%T1T3CLI-E-HASLINKS mlp(%s) still has ppp ports joined

Explanation:

This error message is displayed when removing an MLP bundle fails because it has PPP ports attached to it.

Recommended Action:

Remove the PPP links from the MLP bundle and try again.

%T1T3CLI-E-MLPPHYPORT %s is part of mlp group, please use mlp port name instead.

Explanation:

This error message is displayed when a physical port is part of an MLP bundle, MLP port names should be used in commands such as vlan add port and interface create.

None.

%T1T3CLI-E-MLPPHYMLP %s already belongs to %s

Explanation:

This error messages is displayed when trying to add a physical port to more than one MLP bundle.

Recommended Action:

Use MLP port name instead of physical port name.

%T1T3CLI-E-MLPPORTEXIST %s already exists

Explanation:

This error message is displayed when trying to create an MLP bundle that already exists.

Recommended Action:

None.

%T1T3CLI-E-MLPPORTNOTEXIST %s does not exist, please use ppp create-mlp command first

Explanation:

This message is displayed when trying to delete PPP port that does not exist.

Recommended Action:

None.

%T1T3CLI-E-MLPPORTUSED physical port(s) used by configuration command.

Explanation:

This error message is displayed when the specified physical ports that are being added into an MLP bundle is used by a configuration command.

Recommended Action:

When adding a physical port to an MLP bundle, this physical port's name is specified in commands such as vlan add port and interface create. Please negate those commands and try again.

%T1T3CLI-E-MLPSLOT mlp(%s) and port(%s) are not configured for the same slot

Explanation:

This error message is displayed when trying to add a port to an MLP bundle that is connected to another slot.

Recommended Action:

Make sure that the port being added to the bundle is on the same slot.

%T1T3CLI-E-MLPVLAN mlp(%s) is already on vlan(%s)

Explanation:

This error message is displayed when trying to add an access MLP port fails because the specified port is already on a VLAN. You can not add an MLP port to more than one VLAN.

Recommended Action:

Make sure that an access MLP port is added to only one VLAN per protocol.

%T1T3CLI-E-VCALREADYEXIST frame-relay create vc command failed for %s since they are already created

Explanation:

This error message is displayed when creating a Frame Relay PVC fails because the PVC already exists.

Recommended Action:

None.

Chapter 66

Telnet Error Messages

This chapter describes the error messages for the Telnet facility.

Warning Messages

%TELNETD-W-BADPASSWD bad password from <name>

Explanation:

This message is displayed when a user enters a bad password over a telnet connection. It includes the IP address of the host making the connection.

Recommended Action:

This may indicate that a user at the specified host is trying to break into the router by guessing at the password. You should check to see who is logged in to that host. Ask them not to attempt to break into your router. You can disallow telnet access from a specified host with the **ACL?** command.

%TELNETD-W-IDLE_TIMEOUT Telnet console idle time-out

Explanation:

This message is displayed when the idle time has expired and session %d was shutdown.

Recommended Action:

Use the "system set idle-time-out telnet 30" command to set the idle time-out value to 30 minutes. The default idle time-out value is 5 minutes.

%TELNETD-W-LOGINFAIL repeated login failures from < name >

Explanation:

This message is displayed when a user enters a bad password (multiple times) over a telnet session multiple times. It includes the IP address of the host making the connection.

Recommended Action:

This message may indicate that a user at the specified host is trying to break in to the router by guessing at the password. You should check to see who is logged in to that host. Ask them not to attempt to break into the router. You can disallow telnet access from a specific host using the **ACL**? command.

Error Messages

%TELNETD-E-IOCTL ioctl(<number>) failed, errno = <number>

Explanation:

System resources are limited and the Telnet request for system IOCTL failed.

Recommended Action:

Increase system memory and if problem persists, contact Enterasys Technical Support.

Chapter 67

TFTP Error Messages

This chapter describes the error messages for the Trivial File Transfer Protocol facility.

Informational Messages

%TFTP-I-XFERRATE < name > < number > bytes in < number > . < number > seconds

Explanation:

This message is displayed to denote the transfer rate of the TFTP.

Recommended Action:

Informational message. No action required.

Error Messages

%TFTP-E-BADTFTPURL Bad TFTP URL '<url_type>:/ /<url_name>'

Explanation:

This message is displayed when the TFTP URL is bad.

Recommended Action:

Ensure you have the correct format to get to the file on the TFTP server. For example, tftp://10.50.88.100/qa/img8.

%TFTP-E-CREATETASK TFTP server could not create a child task: %i

Explanation:

This message indicates that there is a system failure.

Recommended Action:

Contact Enterasys Technical Support.

%TFTP-E-GETFILENAME Could not parse the incoming TFTP request

Explanation:

The file name is longer than the packet size specified in an incoming TFTP request packet. This may be caused by a corrupted TFTP request packet.

Recommended Action:

If problem persists, contact Enterasys Technical Support.

%TFTP-E-INVALIDFILE TFTP server could not open file '%s'

Explanation:

TFTP server could not open the file specified in an incoming TFTP request packet. This may be caused by an incorrect format of the filename sent by the TFTP client or by a corrupted TFTP request packet. The message should disappear once a filename with correct format is sent by the TFTP client.

Recommended Action:

If problem persists, contact Enterasys Technical Support.

%TFTP-E-NORESPONSE No response from server: <name>

Explanation:

This message is displayed when there was no response from the TFTP server.

Recommended Action:

Check the IP address. Ensure you have a route. Attempt to ping the TFTP server to ensure you have a route to it.

%TFTP-E-REMOTE Remote error < number>: < name>

Explanation:

This message is displayed when the TFTP server had an error.

Recommended Action:

Verify the TFTP server is up and functioning. Also, ensure the file exists and has correct protections.

%TFTP-E-SESSIONDENIED New TFTP server session denied -- Too many sessions

Explanation:

There are too many TFTP server sessions on the XP.

Recommended Action:

Terminate an existing TFTP session or wait until an existing TFTP session is finished.

%TFTP-E-SESSIONENDED TFTP server session ended prematurely: %i

Explanation:

TFTP server terminates the session with TFTP client if not able to open the local file specified by the client, or not able to receive or send file to the client. This can happen if the server cannot find the local file specified by the client. The message should disappear once the correct file name is sent by the client.

Recommended Action:

If problem persists, contact Enterasys Technical Support.

%TFTP-E-TASKENDED TFTP server task died prematurely

Explanation:

This message indicates that there is a system failure.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 68

Traceroute Error Messages

This chapter describes the error messages for the Traceroute facility.

Error Messages

%TR-E-BADVALUE invalid value (must be between < number > and < number >).

Explanation:

This message appears when there was a bad entry.

Recommended Action:

Enter valid entry between suggested values.

%TR-E-NOMEM processing error - insufficient memory

Explanation:

This message appears when system resources are limited.

Recommended Action:

Increase system resources with more memory. If problem persists, contact Enterasys Technical Support.

%TR-E-UNKWNHOST unknown host '<host_name>'

Explanation:

This message appears when the hostname could not be resolved.

Recommended Action:

Ensure you have a valid hostname and the DNS is working.

Chapter 69

Unicast Error Messages

This chapter describes the error messages for the Unicast facility.

Informational Messages

%UNICAST-I-NETSPECFIXED Network specification changed to (*<IP_address/mask>*).

Explanation:

An IP routing command expected a network IP address as a parameter. The mask was misconfigured by the user and therefore modified so that the command could successfully execute.

Recommended Action:

Other messages are also displayed providing more detailed information about the misconfiguration.

Warning Messages

%UNICAST-W-INVNETSPEC Non-masked bits not zero (<*IP_address*>).

Explanation:

An IP routing command expected a network IP address as a parameter. The non-masked portion of the IP address was misconfigured (should be all zeros).

Recommended Action:

Modify the network IP address parameter.

Error Messages

%UNICAST-E-IFEXISTS Interface <interface_name > already exists.

Explanation:

This message appears when you attempt to create a RIP interface which already exists.

Recommended Action:

Verify interface name and re-enter command.

%UNICAST-E-IFNOTFOUND <interface_name> is not a known interface.

Explanation:

A routing option was applied to a non-existent interface.

Recommended Action:

Select a valid interface.

%UNICAST-E-IFOVFL No more free interfaces max *<number>* current *<number>*.

Explanation:

The number of interfaces that can participate in IP routing has been reached.

Recommended Action:

Contact Enterasys Technical Support.

%UNICAST-E-INVBETENDS Lower limit of mask (<number>) is greater than upper limit (<number>).

Explanation:

While defining a route filtering policy, the between option was misconfigured.

Recommended Action:

Reconfigure the lower and upper limits for the between option.

%UNICAST-E-INVBETLOWEND Lower limit of mask (*<number>*) is mask than specified mask len (*<number>*).

Explanation:

While defining a route filtering policy, the *between* option was misconfigured. There is a conflict between the network's mask length and the lower limit defined by *between*.

Recommended Action:

Reconfigure the lower limit for the between option.

%UNICAST-E-INVBETWEENOPT Invalid between option.

Explanation:

While defining a route filtering policy, the between option was misconfigured.

Recommended Action:

Reconfigure the lower and upper limits for the between option.

%UNICAST-E-INVCONFIG Gated is waiting for valid configuration.

Explanation:

The current configuration contains invalid commands or is missing required commands that prevented the GateD task from starting.

Recommended Action:

Other error messages describe the misconfiguration in more detail.

%UNICAST-E-INVMASKLEN Masklen (<*number>*) specified is greater than 32.

Explanation:

While defining a route filtering policy, the *between* option was misconfigured. There is a conflict between the network's mask length and the range defined by the *between* option.

Recommended Action:

Make sure that both the lower and upper limits are numerical values equal or lower than 32.

%UNICAST-E-MARTIANEXISTS Martian *<martian_name>* already exists.

Explanation:

Duplicate martian addresses have been configured.

Recommended Action:

Remove one of the duplicate martians.

%UNICAST-E-MARTIANNOTFOUND < name > is not a known martian.

Explanation:

The software component that manages martian addresses has detected an internal error.

Recommended Action:

If message displays repeatedly, contact Enterasys Technical Support.

%UNICAST-E-MARTIANOVFL No more free martians max *<number>* current *<number>*.

Explanation:

The maximum number of martian addresses that can be configured has been reached.

Recommended Action:

If possible, remove unused martians.

Fatal Errors

%UNICAST-F-NOSPAWN Failed to spawn Gated (status < number >).

Explanation:

The Gated task could not be spawned.

Recommended Action:

Restart the system. If problem persists, contact Enterasys Technical Support.

Chapter 70

VLAN Error Messages

This chapter describes the error messages for the VLAN facility.

Informational Messages

%VLAN-I-ACCESSCHNG Port <port_list> successfully changed to <port_type>.

Explanation:

This message is displayed when the specified ports were successfully changed to be trunk ports (or access ports).

Recommended Action:

Informational message. No action necessary.

%VLAN-I-ADDPORTS Adding ports cylan_name[<vlan_id</pre>]

Explanation:

This message is displayed when the system is in the process of adding the specified ports to the specified VLAN.

Recommended Action:

%VLAN-I-ADDSUCCESS < number_of_ports > < port_list > successfully added to VLAN < vlan_name >

Explanation:

This message is displayed when at the completion of the vlan add ports command.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-CREATED VLAN <*vlan_name*> created with VLAN ID <*vlan_id*>

Explanation:

This message is displayed when a VLAN was created successfully.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-IFMTUCHANGED The MTU of the interface <interface_name > changed to <MTU >

Explanation:

This message appears when the maximum transmission unit of an interface has changed as a result of adding or removing port(s) from a VLAN.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-L4BDGSTATE L4-Bridging %s on Vlan %d (\$s).

Explanation:

This message is an informational message which displays the state of the L4 Bridging function with respect to a VLAN.

Recommended Action:

%VLAN-I-MULTIADDPORTS Adding ports // vlan_name through <vlan_name</pre>

Explanation:

This message is displayed when ports are added to multiple VLANs.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-MULTICREATED VLANS < vlan_name > through < vlan_name > successfully created. To add ports to multiple VLANS, use "vlan multi-add ports" command.

Explanation:

This message is displayed when multiple VLANs are created.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-MULTIREMOVED VLANS <*vlan_name*> through <*vlan_name*> successfully removed.

Explanation:

This message is displayed when multiple VLANs are removed.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-MULTIRMPORTS Removing ports vlan_name> through <vlan_name>

Explanation:

This message is displayed when ports are removed from multiple VLANs.

Recommended Action:

%VLAN-I-REMOVED VLAN <*vlan_name*> successfully removed.

Explanation:

This message is displayed when a VLAN was negated (removed) successfully.

Recommended Action:

Informational message. No action necessary.

%VLAN-I-RMPORTS Removing ports cylan_name[<vlan_id</pre>]

Explanation:

This message is displayed when the system is in the process of removing the specified ports from the specified VLAN.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%VLAN-W-ADDFAILURE < number_of_ports > < port_list > could not be added to VLAN < vlan_name >

Explanation:

This message is displayed when the specified ports could not be added to the VLAN. This could happen if they already belong to another VLAN and are access ports.

Recommended Action:

Check to see if the ports belong to another VLAN.

%VLAN-W-APS_PROTECTINGPORT <1> Some ports (%s) could not be added because they are configured as APS Protecting Ports

Explanation:

This message is displayed when an attempt is made to add ports which are functioning as protecting ports to a VLAN that does not contain the working port.

Recommended Action:

Do not add an APS protecting port to any VLAN. It will implicitly be added to all the VLANs to which the corresponding APS working port belongs.

%VLAN-W-IFSETMTU The interface <interface_name> MTU could not be changed successfully as a result of adding port(s) to the VLAN <vlan_name> (<function>)

Explanation:

This message appears when the maximum transmission unit of an interface could not be changed when adding ports to the VLAN.

Recommended Action:

%VLAN-W-MULTIADDFAILURE Failure to add <vlan_name>

Explanation:

This message is displayed when ports are unable to be added to the VLAN.

Recommended Action:

Contact Enterasys Technical Support.

%VLAN-W-NATCONFIGURED <1> Some ports (%s) could not be added because NAT is configured on the interface connected to this vlan and the line cards do not support the NAT feature. Please upgrade the line cards

Explanation:

Network Address Translation (NAT) is not supported on all line cards. This message is displayed when ports on a line card which does not support NAT are being added to a vlan which requires them to support NAT.

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

%VLAN-W-NOHWSUPPORT <2> Some ports (%s) could not be added because the modules do not support %s

Explanation:

This message is displayed when an attempt is made to add ports belonging to a line card to a VLAN which requires a specific functionality which is not supported by the line card. (For example, L4 Bridging).

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

%VLAN-W-WAN_NEGATE_FAILED vlan add negation failed on wan card

Explanation:

Ports on a WAN module could not be removed from a VLAN.

Recommended Action:

Contact Enterasys Technical Support.

Error Messages

%VLAN-E-ADDFAILURE < number > port(s) < port_list > could not be added to VLAN < VLAN_name >

Explanation:

This message is displayed when none of the specified ports could be added to the given VLAN. This usually occurs when the user tries to assign access ports to a VLAN which are already part of another VLAN.

Recommended Action:

Remove the desired ports from the VLAN to which they are currently assigned, then reassign them to the new VLAN.

%VLAN-E-APS_PROTECTINGPORT Some ports (%s) could not be added because they are configured as APS Protecting Ports

Explanation:

This message is displayed when an attempt is made to add ports which are functioning as protecting ports to a VLAN that does not contain the working port.

Recommended Action:

Do not add an APS protecting port to any VLAN. It will implicitly be added to all the VLANs to which the corresponding APS working port belongs.

%VLAN-E-ATMBADMUX VLAN contains an ATM VC port with encap type of vc-mux. Only one protocol can be associated with this type of port.

Explanation:

An ATM VC with encap type vc-mux sends no protocol information over the wire. Because the protocol is determined from the VC, only IP or IPX can be configured over a vlan or port that contains an ATM VC in vc-mux encap mode. This error appears when you attempt to add a port with encap type of vc-mux to a vlan that has both IP and IPX interfaces configured.

Recommended Action:

See that only one protocol is associated with this type of port.

%VLAN-E-BADNAME_L3VLAN Only VLANs created implicitly by the system may begin with "sys_". Please select another name.

Explanation:

This message is displayed when a user chose a name that began with "SYS_". Names beginning with "SYS_" are reserved.

Recommended Action:

Select another name.

%VLAN-E-BADNAME_RSVD The VLAN name <*vlan_name*> conflicts with a reserved name. Please select another name.

Explanation:

VLAN names beginning with "SYS_" are reserved, as are other names such as "Default".

Recommended Action:

Use a different name for the VLAN.

%VLAN-E-BADNAME_TOOBIG The VLAN name cannot exceed 32 characters. Please select another name.

Explanation:

This message is displayed when the VLAN name exceeds 32 characters.

Recommended Action:

Select another name which does not exceed 32 characters.

%VLAN-E-BADNAME_VLAN_ALNUM VLAN names must begin with an alphanumeric character. Please select another name.

Explanation:

This message is displayed when the user is trying to create a VLAN with a name that begins with a non-alphanumeric character, such as an underscore. This is not allowed.

Recommended Action:

Use a VLAN name which begins with an alphanumeric character (A-Z, a-z, 0-9).

%VLAN-E-BADNAME_WS The VLAN name must have at least 1 nonwhitespace character. Please select another name.

Explanation:

This message is displayed when the user is trying to name a VLAN with a name that consists only of tabs and spaces. This is not allowed.

Recommended Action:

Use a name which has alphanumeric characters.

%VLAN-E-BOUND <*vlan_name*> is bound to a layer 3 (IP/IPX) interface. Please delete the interface first.

Explanation:

This message is displayed when the user is trying to delete a VLAN which is bound to an IP or IPX interface. The interface must be deleted first, before the VLAN can be deleted.

Recommended Action:

Delete all layer 3 interfaces to which this VLAN is bound. Then the VLAN can be deleted.

%VLAN-E-CMDNOTAPPLY Make port trunk/access port command does not apply to T1/T3 card

Explanation:

This message is displayed when the user specifies a WAN (HSSI or Serial) port is to be a trunk or access port.

Recommended Action:

WAN (HSSI/Serial) ports cannot be made trunk or access ports.

%VLAN-E-DFLTSTPCFLCT One or more ports being added have default stp enabled on them and this conflicts with the pvst instance on the vlan

Explanation:

This message appears when ports with default STP enabled are being added to a VLAN with a PVST instance.

Recommended Action:

Do not add ports with STP enabled to a VLAN with a PVST instance.

%VLAN-E-DUPNAME <*vlan_name*> already exists. Please use another name.

Explanation:

This message is displayed when the user is trying to create a VLAN with the same name as a VLAN which has already been created.

Recommended Action:

Use a different name for the VLAN being created.

%VLAN-E-DUPVID VLAN ID <id_number> already exists. Please use a different VLAN ID.

Explanation:

This message is displayed when the user is trying to create a VLAN with a VLAN ID that is already being used by another VLAN.

Recommended Action:

Use another VLAN ID for the VLAN being created.

%VLAN-E-FORBIDDEN Port(s) ''can not be added to vlan '<vlan_name>' as they are forbidden from being added to the vlan

Explanation:

This message appears when an attempt is made to add ports to the VLAN that are forbidden from being added to the VLAN.

Recommended Action:

Remove the port(s) from the VLAN forbid command and then add the ports to the VLAN.

%VLAN-E-FORBIDDEN_LIST Vlan '<*vlan_name*>' contains list of forbidden ports. Please remove them before removing the vlan

Explanation:

This message appears when an attempt is made to delete a VLAN that contains forbidden ports.

Recommended Action:

Negate the VLAN forbid command and try removing the VLAN again.

%VLAN-E-GVRP_VLAN Vlan <*vlan_name*> is dynamically created via GVRP and ports can not be added to it statically

Explanation:

This message appears when you add ports to a VLAN created by GVRP.

Recommended Action:

VLANs created dynamically by GVRP cannot have ports statically added to them.

%VLAN-E-L4BDGCONFIGERR Non-IP/IPX traffic not supported for L4-Bridging - Vlan <*vlan-id*>

Explanation:

Non-IP/IPX traffic is currently permitted for the specified VLAN. Only IP/IPX traffic is allowed on a VLAN for which Layer 4 bridging is enabled.

Recommended Action:

Reconfigure the VLAN for IP-only, IPX-only or IP/IPX-only.

%VLAN-E-L4BDGNOTALLOW L4 Bridging not supported by Module <string> in slot <number>

Explanation:

The specified module does not provide Layer 4 bridging capability. This message is displayed when ports on a line card which does not support L4 Bridging are being added to a vlan which has been configured as an L4 Bridging VLAN.

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

%VLAN-E-L4BDGONVLAN Disable L4-Bridging on Vlan %d (%s) before removing VLAN.

Explanation:

This message is displayed when an attempt is made to delete a VLAN which has L4 Bridging configured on it.

Recommended Action:

L4 Bridging must first be disabled on the VLAN which is to be deleted. Once this is done, the VLAN can be safely deleted.

%VLAN-E-MEMBERS Port(s) ''<port_list>' are already members of vlan '<vlan_name>' and can not be forbidden from being added to the vlan

Explanation:

This message appears when an attempt is made to forbid ports from a VLAN that are already members of the VLAN.

Recommended Action:

Remove the ports from the VLAN and then execute the VLAN forbid command again.

%VLAN-E-MULTI_NOT_REMOVED Failure to remove < num > VLANS

Explanation:

This message is displayed when multiple VLANs cannot be removed.

Recommended Action:

VLANS with ports cannot be removed. Make sure all ports are removed from all of the VLANS and try again.

%VLAN-E-MULTIADDFAILURE Failure to add volan_name>

Explanation:

This message is displayed when ports cannot be added to multiple VLANs.

Recommended Action:

Contact Enterasys Technical Support.

%VLAN-E-NATCONFIGURED Some ports (%s) could not be added because NAT is configured on the interface connected to this vlan and the line cards do not support the NAT feature. Please upgrade the line cards

Explanation:

Network Address Translation (NAT) is not supported on all line cards. This message is displayed when ports on a line card which does not support NAT are being added to a vlan which requires them to support NAT.

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

Explanation:

An access port can belong to at most one VLAN per protocol type (IP/IPX/bridged-protocol). A trunk port may belong to any number of VLANs. When changing a port from a trunk port to an access port, if the trunk port belongs to too many VLANs, this message is displayed.

Recommended Action:

It is recommended that the port be removed from all VLANs before being converted to an access port. Then it can be added to the desired VLAN(s).

%VLAN-E-NOCREATE Failed to create VLAN <vlan name>.

Explanation:

An internal error occurred while creating a VLAN.

Recommended Action:

Contact Enterasys Technical Support.

%VLAN-E-NOHWSUPPORT Some ports (%s) could not be added because the line cards do not support the protocols defined over this vlan. Please upgrade the line cards.

Explanation:

Network Address Translation (NAT) is not supported on all line cards. This message is displayed when ports on a line card which does not support NAT are being added to a vlan which requires them to support NAT.

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

%VLAN-E-NOMEM Command failed because system has run out of memory.

Explanation:

This message is displayed when the XP has run out of free memory.

Recommended Action:

Add more memory to the XP Control Module.

%VLAN-E-NOMLTPL One or more ports being added do not support IPX multiple encap, defined on the attached interface.

Explanation:

Multiple IPX encapsulations are not supported on all line cards. This message is displayed when ports on a line card that does not support multiple IPX encapsulations are being added to a vlan which requires them to support multiple IPX encapsulations.

Recommended Action:

Contact Enterasys Technical Support to upgrade the line card.

%VLAN-E-NOMULTICREATE Failure to create VLAN <vlan_name>

Explanation:

This message is displayed when multiple VLANs cannot be created.

Recommended Action:

Contact Enterasys Technical Support.

%VLAN-E-NOREMOVE VLAN <*vlan_name*> cannot be removed because it contains ports. Please remove all ports in this VLAN before removing the VLAN.

Explanation:

A VLAN must have all ports removed from it before the VLAN can be removed.

Recommended Action:

Negate all commands which add ports to the VLAN before negating the VLAN.

%VLAN-E-NOREMOVEFROMDEFAULTVLAN Ports cannot be removed from the default VLAN.

Explanation:

This error message is displayed when the user attempts to remove a port from the default VLAN when the port does not belong to any other VLAN.

Recommended Action:

Do not attempt to remove a port from the default VLAN if it does not belong to any other VLAN.

%VLAN-E-NOSUCHVLAN VLAN '<vlan_name>' does not exist

Explanation:

This message is displayed when the user is trying to remove a VLAN which does not exist.

Recommended Action:

Check the VLAN name and try again.

%VLAN-E-NOT_REMOVED < vlan_name > could not be removed.

Explanation:

This message is displayed when the user is trying to delete a reserved VLAN, or a VLAN which does not exist.

Recommended Action:

Check the name of the VLAN; do not try to remove reserved VLANs.

Explanation:

This message is displayed when you try to add an access port to multiple VLANs.

Recommended Action:

Make the port a trunk port and execute the command again.

%VLAN-E-PVSTEXSTS PVST instance exists on this vlan. Please negate the PVST instance before deleting the vlan.

Explanation:

This message is displayed when an attempt is made to delete a VLAN which has Per-VLAN Spanning Tree (PVST) configured on it.

Recommended Action:

PVST must first be disabled on the VLAN which is to be deleted. Once this is done, the VLAN can be safely deleted.

%VLAN-E-PVSTENBLD PVST is enabled on some ports in %s, please disable pvst first

Explanation:

Ports cannot be removed from a VLAN without first disabling PVST on them.

Recommended Action:

Disable PVST on the ports to be removed from the VLAN, and then remove the ports from the VLAN.

%VLAN-E-STARTID_TOOBIG The start ID must be smaller than the end ID

Explanation:

This message is displayed when multiple VLANs are being created and the start ID is greater than or equal to the end ID.

Recommended Action:

Make sure the start ID is less than the end ID and execute the command again.

%VLAN-E-STNOTFOUND SmartTRUNK st.<*number>* not found.

Explanation:

This message is displayed when the SmartTRUNK specified does not exist.

Recommended Action:

Verify SmartTRUNK.

Chapter 71

IP Redundancy (VRRP) Error Messages

This chapter describes the error messages for the IP Redundancy (VRRP) facility.

Informational Messages

%IPRED-I-ADJUST_WARMUP reset warm-up period for virtual router <id_number> on interface <interface_name> (<warmup_period> secs remaining)

Explanation:

This message appears when the warm-up period for a Virtual Router defined on an interface is changed.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-CONFIGUPDATE updated config for virtual router <id_number> on interface <interface_name>

Explanation:

This message appears when the Virtual Router configuration on an interface has changed.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-START_WARMUP virtual router <id_number> on interface <interface_name> will start once the warm-up period expires (<warmup_period> secs remaining)

Explanation:

This message appears when a Virtual Router defined on an interface comes up. It indicates the warm-up period has started.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-STATE <event>, <old_state>-><new_state>, I/F <Interface name>, vid <router ID>

Explanation:

This message appears for the following events: Startup (Startup), Shutdwn (Shutdown), Adv Tmr (Advertise Timer), Mas Dwn (Master down timer), Rcv ZPP (Received zero priority packet), Rcv EPP (Received equal priority packet), Rcv HPP (Received higher priority packet), Rcv LPP (Received lower priority packet), and Int Dwn (Interface Down). Old_state/new_state can be M (Master), B (Backup), or I (Initialize).

Recommended Action:

Informational message. No action necessary.

%IPRED-I-VR_CREATED successful creation of virtual-router <id_number> on interface <interface_name>

Explanation:

This message appears when a Virtual Router has been successfully added on an interface.

Recommended Action:

%IPRED-I-VR_IPADDED added IP address <IP_address > to virtual-router <id_number > on interface <interface_name >

Explanation:

This message appears when an IP address has been added to a Virtual Router defined on an interface.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-VR_IPREMOVED removed IP address <IP_address > from virtual-router <id_number> on interface <interface_name>

Explanation:

This message appears when an IP address has been removed from a Virtual Router defined on an interface.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-VR_REMOVE_DONE successful shutdown and deletion of virtual-router <id number> on interface <interface_name>

Explanation:

This message appears when deletion of a Virtual Router from an interface has succeeded.

Recommended Action:

Informational message. No action necessary.

%IPRED-I-VR_STARTED started virtual-router <id_number> on interface <interface_name>

Explanation:

This message appears when a Virtual Router has been initialized on an interface.

Recommended Action:

%IPRED-I-VR_STOPPED stopped virtual-router <id_number> on interface <interface_name>

Explanation:

This message appears when a Virtual Router has been halted on an interface.

Recommended Action:

Informational message. No action necessary.

Explanation:

This message appears when the warm-up period has expired for a Virtual Router defined on an interface.

Recommended Action:

Informational message. No action necessary.

Warning Messages

%IPRED-W-INVALID_EVENT received invalid event (VRRP state=<state name> event=<event name> interface=<name> vrId=<ID number> code=<ID>)

Explanation:

This message appears when a Virtual Router receives one of the following unrecognized events: Startup (Startup), Shutdwn (Shutdown), Adv Tmr (Advertise Timer), Mas Dwn (Master down timer), Rcv ZPP (Received zero priority packet), Rcv EPP (Received equal priority packet), Rcv HPP (Received higher priority packet), Rcv LPP (Received lower priority packet), and Int Dwn (Interface Down). State can be M (Master), B (Backup), or I (Initialize).

Recommended Action:

No action necessary.

%IPRED-W-MSG_RX IPRED queue received unrecognized message <ID>

Explanation

This message appears when receiving an unrecognized message from the IP RED task queue.

Recommended Action:

No action necessary.

%IPRED-W-MSG_TX send message to IPRED queue failed (<function name> - <ID>)

Explanation:

This message appears when the sending of a message to the IP RED task queue fails.

Recommended Action:

No action necessary.

%IPRED-W-TMR_MISSING timer expired - info not found (<name> - <ID>)

Explanation:

This message is usually displayed when a VRRP state transitions and can be ignored. However, if it's displayed repeatedly, follow the recommended action below.

Recommended Action:

Stop the currently configured VRRP Virtual Routers (negate the **vrrp start** CLI commands), and then re-start them.

Error Messages

%IPRED-E-ADDRMASK invalid subnet (interface <interface_name>, virtual-router <id_number>)

Explanation:

This error message appears when the mask given to an IP address associated with a Virtual Router is invalid.

Recommended Action:

Correct the network mask and re-execute the CLI command.

%IPRED-E-AUTHKEY a key is required for the type of authorization selected (interface *<interface_name>*; virtual-router *<id_number>*)

Explanation:

This error message appears when a Virtual Router has been configured to one of several authorization types that require a key. However, the "key" parameter/option is missing.

Recommended Action:

Ensure that you have properly configured a "key" for the Virtual Router referred to in the error message.

%IPRED-E-BAD_AF interface < interface_name > is not an IP interface

Explanation:

The message appears when the interface added to a Virtual Router is not an IP interface.

Recommended Action:

Verify interface is an IP interface.

%IPRED-E-CONFIGCMD remove config parameters currently applied to virtual-router <id_number> on interface <interface_name>

Explanation:

This message appears when the user attempts to remove a Virtual Router from the system. However, CLI commands referring to (or dependent upon) the existence of the Virtual Router in question still exist.

Recommended Action:

Remove all CLI commands that refer to this Virtual Router.

%IPRED-E-DUPL_CFG / sparameter name parameter already configured - ignoring (interface <interface_name</pre>; virtual-router <id_number</pre>)

Explanation:

This message appears when the same parameter is configured more than once with conflicting values.

Recommended Action:

Be sure to remove any extra configuration CLI commands.

%IPRED-E-DUPLICATE virtual-router <id_number> already exists on interface <interface_name>

Explanation:

This message appears when a Virtual Router has been applied to an interface and a Virtual Router already exists on the specified interface.

Recommended Action:

Verify the Virtual Router configuration.

%IPRED-E-EN0 en0 is not a valid interface

Explanation:

This message appears when en0 is added to a Virtual Router. en0 is not a valid interface.

Recommended Action:

Do not specify en0 as a Virtual Router interface.

%IPRED-E-GET_SEMA4 failed acquiring sema4 (retCode < number >)

Explanation:

This message appears when there is an internal error acquiring a semaphore.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-IF_MISMATCH IP address < IP_address > is currently in use by interface < interface_name >

Explanation:

This message appears when an address is associated with a Virtual Router. However, the IP address is currently in use on the XP on a different interface from the one where the Virtual Router has been configured.

Recommended Action:

Verify that the Virtual Router configuration is correct.

%IPRED-E-IOCTL ioctl operation failed (*<function>*)

Explanation:

This message appears when an internal I/O control procedure failed in the specified function.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-KEYLEN invalid key length (<number>). Maximum length = 8 characters (interface_name>; virtual-router <id_number>)

Explanation:

This message appears when the user attempts to configure an authorization key with an illegal length.

Recommended Action:

Redefine the length of the authorization key, ensuring that the value is within the guideline specified in the error message text.

%IPRED-E-MALLOC malloc failed (<*function>*)

Explanation:

Error encountered while allocating memory in the specified function.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-MANY_IPADDRS remove associated IP addresses before removing virtual-router <id_number> on interface <interface_name>

Explanation:

This error message appears when the user attempts to remove a Virtual Router from the system that still has IP addresses associated with it.

Recommended Action:

Be sure to remove all of the associated IP addresses before removing the Virtual Router.

%IPRED-E-MISCONFIG at least 1 option to configure is required

Explanation:

This error message appears when the user attempts to select a Virtual Router to which a number of options are to be applied. However, at this time, no options are defined for the Virtual Router.

Recommended Action:

Verify the Virtual Router configuration.

%IPRED-E-NETMASK invalid netmask (interface < interface_name >, virtual-router < id_number >)

Explanation:

This error message appears when the mask given to an IP address associated with a Virtual Router is invalid.

Recommended Action:

Correct the network mask and re-execute the CLI command.

%IPRED-E-NO_MCAST interface < name > does not support IP multicasts

Explanation:

This error message appears when the user attempts to create a Virtual Router on an interface that does not support multicast IP addresses.

Recommended Action:

Select a valid interface for the Virtual Router.

%IPRED-E-NOADDRS at least 1 associated IP address is required (interface <interface_name>; virtual-router <id_number>)

Explanation:

This error message appears when the user attempts to start a Virtual Router without having first associated an IP address with the Virtual Router.

Recommended Action:

Be sure to associate an IP address with the Virtual Router before attempting to restart it.

%IPRED-E-NOSOCKET socket operation failed

Explanation:

This message appears when there is an internal error creating a socket.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-NOSUCHIF invalid interface <interface_name>

Explanation:

This message appears when an invalid interface has been added to a Virtual Router.

Recommended Action:

Verify that the interface is valid.

%IPRED-E-NOSUCHIP IP address not found (interface <interface_name>; virtual-router <id_number>)

Explanation:

This message appears when an invalid IP address has been added to a Virtual Router.

Recommended Action:

Verify the IP address is valid.

%IPRED-E-NOSUCHVR virtual router <id_number> not found on interface <interface_name>

Explanation:

This message appears when the user attempts to configure an option for a Virtual Router that has not yet been created.

Recommended Action:

Configure a Virtual Router before attempting to assign any options to it.

%IPRED-E-OWNER virtual-router <id_number> on interface <interface_name> has to be the address owner of ALL or NONE of the

associated IP addresses. The following IP addresses cause a conflict: *<IP* address>

Explanation:

This message appears when multiple IP addresses have been associated with a Virtual Router.

Recommended Action:

Remove the IP address that causes a conflict.

Note:

The IP addresses assigned to a Virtual Router must either all match the IP addresses of the interface where the Virtual Router has been configured, or must all be different from the interface IP address.

%IPRED-E-PRIORITY invalid priority assigned to virtual-router <id_number> on interface <interface_name> <explanation>

Explanation:

This message appears when a Virtual Router priority has been configured incorrectly.

Recommended Action:

Reconfigure the priority as stated in the "explanation" portion of the message text.

%IPRED-E-RAT_FULL failed adding virtual-MAC to port /s table - too many virtual-routers with unique IDs defined. Virtual-router <id_number> on interface <interface_name> will be shut down. When error condition is fixed, restart the virtual-router (negate vrrp start command; exit CLI config; start again)

Explanation:

This message appears when there are too many Virtual Routers defined on a port.

Recommended Action:

Remove some of the Virtual Routers on the port and restart the Virtual Router (negate vrrp start command; exit CLI config; start again).

%IPRED-E-RECVFROM recvfrom() failed with errno < number>

Explanation:

Internal error receiving VRRP packet.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-REL_SEMA4 failed releasing sema4 (retCode < number >)

Explanation:

This message appears when there is an internal error releasing a semaphore.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-RXD_VRRP_PKT *<explanation>*

Explanation:

This message appears when a VRRP packet with conflicting information is received.

Recommended Action:

The "explanation" portion of the message text describes what portion of the received packet is incorrect. It may also display the IP address of the router responsible for generating the invalid/conflicting VRRP packets. Ensure that the local and remote routers both have an identical configuration for the Virtual Router.

%IPRED-E-SEND_ARP sending ARP packet failed (interface <interface_name>; virtual-router <id_number>)

Explanation:

This message appears when the virtual-router interface fails to send an ARP to it's associated IP addresses.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-SEND_VRRP detected interface down

Explanation:

This message appears when the XP attempts to transmit a VRRP packet on an interface which is not currently "up."

Recommended Action:

Verify that the interface is "up" before attempting to resend the VRRP packet.

%IPRED-E-SETSOCK setsockopt() operation failed (<option>)

Explanation:

This message appears when there is an internal error setting a socket option.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-E-START_RAT_FULL could not start virtual-router <id_number> on interface <interface_name>. Too many virtual-routers with unique IDs defined. Port port_name>'s Router MAC Table could overflow

Explanation:

This message appears when trying to start a Virtual Router and there are too many Virtual Routers defined on a port.

Recommended Action:

Remove some of the Virtual Routers on the port and start the Virtual Router again.

%IPRED-E-STARTCMD remove 'start' command currently applied to virtual-router <id number> on interface <interface_name>

Explanation:

This message appears when the user attempts to remove a Virtual Router. However, a CLI **start** command referring to the Virtual Router about to be removed still exists.

Recommended Action:

Be sure to remove the CLI start command in question before removing the Virtual Router.

%IPRED-E-TIMER timer creation failed (<function> - retCode <number>)

Explanation:

This message appears when there is an internal error creating a timer in the specified function.

Recommended Action:

Contact Enterasys Technical Support.

Fatal Messages

%IPRED-F-CREATE_QUE failed creating queue (retCode < number>)

Explanation:

This message appears when there is an internal error creating the queue on which to receive messages.

Recommended Action:

Contact Enterasys Technical Support.

%IPRED-F-CREATE_SEMA4 failed creating sema4 (retCode < number>)

Explanation:

Internal error creating semaphore to protect internal data structures.

Recommended Action:

Contact Enterasys Technical Support.

Chapter 72

Web Cache Error Messages

This chapter describes the error messages for the web cache facility.

Informational Messages

%WC-I-BYPASS_LIST Bypass list < list> for web caching < name>

Explanation:

Hosts for which HTTP requests are not redirected for the caching policy.

Recommended Action:

Informational message. No action necessary.

%WC-I-CREATED Web caching < name > has been successfully created for server group < group >

Explanation:

The cache group has been created.

Recommended Action:

Informational message. No action necessary.

%WC-I-DELETED Web caching *<name>* has been successfully deleted for server group *<group>*

Explanation:

The cache group has been deleted.

Recommended Action:

Informational message. No action necessary.

%WC-I-INTERFACE Policy < name > has been successfully attached to/attached from < interface > interface

Explanation:

The caching policy has been applied to the specified interface.

Recommended Action:

Informational message. No action necessary.

%WC-I-USER_LIST User list < list> for web caching < name>

Explanation:

List of clients for the web caching policy.

Recommended Action:

Informational message. No action necessary.

Error Messages

%WC-E-ACLNOTFOUND Rule <acl> not present

Explanation:

The specified ACL is not found.

Recommended Action:

Check the ACL name and make sure it exists.

%WC-E-APPLIED Policy has other commands attached -- negate these commands first

Explanation:

The policy that is being negated has other commands applied to it. This policy cannot be deleted before the other applied commands.

Recommended Action:

Negate the other commands that are applied to this policy before deleting this policy.

%WC-E-EXCEEDED Total number of servers specified *<number>* exceeded maximum capacity *<maximum>*

Explanation:

The number of servers specified exceeds the maximum allowed (128).

Recommended Action:

A maximum of 128 servers can be part of a cache group. Make sure that there are no more than 128 servers specified for the cache group.

%WC-E-IFAPPLIED Interface *<name>* has a cache applied -- cannot apply multiple cache blocks to an interface

Explanation:

A caching policy is already applied to the specified interface.

Recommended Action:

Compare the applied caching policy with the new policy. To apply the new policy to the interface, first delete the already-applied policy from the interface.

%WC-E-INCORRECT_LIST IP list specified is invalid

Explanation:

The list of IP addresses is specified in an incorrect format.

Recommended Action:

Specify the IP address list in the format "ip-addr1... ip-addr4".

%WC-E-INCORRECT_RANGE IP range specified should have only 2 elements "start IP address end IP address"

Explanation:

The range of IP addresses is specified in an incorrect format.

Recommended Action:

Specify the IP address range in the format "start-IP end-IP".

%WC-E-INVALID Range or list specified not in correct format e.g. range "lower-IP-address higher-IP address"

Explanation:

The IP address range or list is specified in an incorrect format.

Recommended Action:

Check the command syntax and specify the range or list in the correct format.

%WC-E-IPONLY Policy can be applied to IP ACLs only -- ignoring <acl>

Explanation:

Only IP ACLs can be specified for the policy.

Recommended Action:

Specify an IP ACL.

%WC-E-NOCACHE Could not find cache < name >

Explanation:

The specified cache is not found.

Recommended Action:

Check the cache name and make sure it exists.

%WC-E-NOMEM Processing error -- out of memory <string>

Explanation:

The system is out of memory.

Recommended Action:

Expand existing memory and try again. If problem persists, contact Enterasys Technical Support.

%WC-E-NONIPIF Cannot apply policy to non IP interface < name >

Explanation:

The interface to which the policy is being applied is a non-IP interface.

Recommended Action:

Apply the policy to an IP interface.

%WC-E-NOSUCHIF Interface < name > does not exist

Explanation:

The specified interface does not exist.

Recommended Action:

Check the interface name and make sure it exists.

%WC-E-NOSVRLIST Could not find server list < list > for cache < name >

Explanation:

The specified server group name does not exist in the specified cache group.

Recommended Action:

Check the server group name and make sure it exists.

%WC-E-SVRLIST_EXISTS Server list < list> already exists

Explanation:

The specified server group name already exists in the specified cache group. Duplicate server names are not allowed.

Recommended Action:

Verify the server group name. No further action necessary.

Appendix A

Undocumented Error Messages

Table 1 contains a list undocumented messages. It is unlikely that you will see one of these messages displayed within the syslogs. Most of the undocumented messages are for Enterasys internal use or are artifacts. If you have concerns about any of the undocumented messages, contact Enterasys Technical Support..

Table 1: Undocumented Error Messages

%AARP-E-AARP_18 During the input processing of an ARP packet, the router did not have memory available to make an ARP cache entry for the given protocol.

%AARP-E-AARP_30 No ARP network table exists for this network.

%AARP-I-AARP_50 An ARP packet of the type indicated has just arrived for processing. Operation type %d. Hardware address space %d. Protocol type %d. Network index number %d. Network type %s. Network Port number %d.

%ACL-E-HWNOTSFR Slot %d of interface '%s' is not SFR compliant.

% ACL-E-NOCEPINFO Could not get cep info for interface '%s'.

%ARE-E-ADDPORT Unable to add port(s) to interface %s.

%ARE-E-AREERROR Error from ARE module %d -- %s.

%ARE-E-ATTACHVLAN Unable to attach vlan %s to interface %s.

%ARE-E-BADCMD IPC command %x for protocol %x does not exist.

% ARE-E-BADMODULE Invalid module number % d entered.

% ARE-E-BADMSGID Bad incoming IPC message ID. (is %x should be %x).

 $\%\,ARE\text{-}E\text{-}BADOUTPUT$ An packet was illegally sent to interface $\%\,s.$

% ARE-E-BADPROTO Protocol value %x not found/supported.

% ARE-E-BADREQUEST Received a bad image load request from ARE module %d.

% ARE-E-BADSIZE Bad incoming IPC message size. (is %x should be %x).

 $\%\,ARE\text{-}E\text{-}BADSOURCE$ Incoming IPC message not from an ARE module.

 $\%\,ARE\text{-E-CMDERR}$ IPC command $\%\,x$ for protocol $\%\,x$ returned a error of $\%\,x$.

% ARE-E-CONFIGLOCK Unable to lock the configuration database for ARE module %d.

% ARE-E-CONFIGSEM Error creating a configuration semaphore for the ARE module configuration mode.

%ARE-E-CPU_MOD_CACHE_MEM Elite cpu cache memory test failed.

%ARE-E-CPU_MOD_UCACHE_MEM Elite cpu un-cache memory test failed.

% ARE-E-ERRORRSP Error sending an IPC response packet (%x).

% ARE-E-ERRORSND Error sending an IPC message (%x).

%ARE-E-GEN %s

% ARE-E-HASCONFIG Before changing the protocol enabled on module %d, first negate all CLI commands in its database.

% ARE-E-HASPROTO ARE module %d already has a protocol enabled on it.

% ARE-E-HELLOMAX The ARE in slot %d is dead. (did not respond to %d HELLO packets).

% ARE-E-INITMAX The ARE in slot %d is dead.

%ARE-E-L2ADD Error bringing up port %s for interface %s.

 $\%\,ARE\text{-E-LOSTHB}$ Lost the heartbeat from the ARE in slot $\%\,d.$

% ARE-E-MEMORY_ALIASING Memory error 0x%08lx ; Possible aliasing with: 0x%08lx

%ARE-E-MEMORY_BYTE_MISMATCH Memory mismatch 0x%08lx; Read 0x%x; Expected 0x%x

%ARE-E-MEMORY_INACCESSIBLE Memory inaccessible beginning @ 0x%08lx -- will generate fatal exception

%ARE-E-MEMORY_MISMATCH Memory mismatch 0x%08lx; Read 0x%08lx; Expected 0x%08lx

% ARE-E-MULTIPROTO The protocol is already enabled on ARE module %d.

%ARE-E-NOIMAGE Error finding an image for the ARE module in slot %d. It will be shut down.

 $\%\,ARE\text{-E-NONBUF}$ Unable to allocate memory for an HELLO packet.

%ARE-E-NOPROTO Protocol %s has not been enabled on any ARE module.

% ARE-E-NORESPONSE Response time-out. No response back from ARE module.

% ARE-E-NOSERVICE IPC command %x for protocol %x has no service function.

%ARE-E-NOTACTIVE ARE module %d is not active.

% ARE-E-NOTAHB Unknown ARE heartbeat packet.

 $\% ARE-E-NOTVER\ A\ HELLO\ RESPONSE\ packet\ of\ version\ \% d\ was\ received\ (expected\ version\ \% d).$

% ARE-E-SYSNOTVALID An ARE module was detected in an invalid system.

%ARE-F-BADQPTR elite_queue_send() received a bad queue pointer %x

% ARE-F-CAUSEFATAL Main system requested a fatal error. Going down now!

% ARE-I-ARESTARTED Initializing Advanced Routing Engine module %d. Please wait.....

% ARE-I-BOARDALIVE ARE module %d is ready for operation.

% ARE-I-CONFIGEMPTY The configuration for ARE module %d is empty.

%ARE-I-MEM_INFO %s: %s

%ARE-W-ALREADYUP A unexpected HELL0/RESPONSE packet was received from a live board.

%ARE-W-L2REMOVE Unable to remove the L2 entry on port %s.

% ARE-W-NOTCHANGED No changes were made to the configuration for ARE module %d.

%ARE-W-PROMDONE A message from the ARE module %d bootprom programmer: %s.

% ARE-W-STARTHS Hotswap for ARE module %d. Shutting down the module...

% ARE-W-UNEXPECTPKT A unexpected HELLO/RESPONSE packet was received.

% ARP-E-CLRTEGFAIL NUE_Set_TEG_Flag failed (0x%x).

% ARP-E-CNTRLTMRFAIL NU_Control_Timer failed (0x%x).

% ARP-E-RESETTMRFAIL NU_Reset_Timer failed (0x%x).

% ARP-E-SETTEGFAIL NUE_Set_TEG_Flag failed (0x%x).

% ARP-E-WAITTEGFAIL Wait_For_TEG failed (0x%x).

%ARP-W-HOSTUNREACH %s: no route to host. ARP entry will be added when the route becomes available.

%ATALK-E-BADADDR Bad Appletalk address %s.

% ATALK-E-BADADDRNET Network %d is not with the cable range %d-%d.

% ATALK-E-BADNETRANGE AppleTalk cable range %d-%d is invalid.

% ATALK-E-BADNODE AppleTalk node %i is invalid.

%ATALK-E-BADRTMPNET Incoming RTMP packet conflicts with the configured cable range for interface %s.

 $\%\,ATALK\text{-E-DELZONE}$ Error deleting zone $\%\,s$ from interface $\%\,s.$

% ATALK-E-NETFILTERED A network filter is conflicting with the preexisting cable range for interface %s.

 $\%\,ATALK-E-NETOVERLAP\,\,Cable\,\,range\,\,\%d-\%d\,\,overlaps\,\,the\,\,preexisting\,\,range\,\,\%d-\%d.$

%ATALK-E-NETRANGECOUNT Only one continuous AppleTalk cable range is allowed. Range %d-%d will be used.

% ATALK-E-NOINTF AppleTalk interface %s does not exist.

% ATALK-E-NOVALIDADDR Unable to find a unique node address on this cable range.

 $\%ATALK\text{-}E\text{-}RESETTMRFAIL\ \%s:}$ Error resetting timer failed (0x%x).

%ATALK-E-SETCR Error setting cable range %d-%d on interface %s.

% ATALK-E-SETNODE Error setting AppleTalk node %d on interface %s.

% ATALK-E-SETTEGFAIL Error setting task event. Return status(0x%x). Flag ID %d.

% ATALK-E-SETZONE Error setting zone %s on interface %s.

% ATALK-E-ZIPNAMESIZE AppleTalk zone name %s is too large.

% ATALK-E-ZONEEXISTS Zone %s already exists on interface %s.

% ATALK-F-CREATEQ Unable to create a packet queue for task (%s).

%ATALK-F-CREATETASK %s: Could not create task. (0x%x).

% ATALK-F-CREATETMRFAIL %s: NUE_Create_Timer failed (0x%x).

% ATALK-F-DELBADNET Attempted to delete a non-existent net.

 $\%\,ATALK\text{-}F\text{-}DELTIMERFAIL\ \%\,s:$ Unable to stop a timer (%x).

% ATALK-F-STARTTIMER %s: NUE_Start_Timer failed (0x%x).

% ATALK-F-TASKEND %s: Task ended prematurely.

% ATALK-I-CHANGEADDR Address %u-%u for interface %s was changed to %u-%u.

%ATALK-I-CHANGECABLE Operating cable range %d-%d for interface %s was changed to %u-%u.

%ATALK-I-NEWADDR New address %u-%u was selected for interface %s.

%ATALK-I-NEWZONE The default zone for interface %s was set to %s.

%ATALK-W-CHANGEDEFAULT Zone %s is no longer the default zone for interface %s.

%ATALK-W-NEWDEFAULT Zone %s has been registered as the default zone for interface %s.

%ATM_DIAG-E-ACLATTACHED An ACL is attached to this interface.\n\tPlease detach ACL '%s' from interface '%s' first.

% ATM_DIAG-E-ADDRESS_ERROR Invalid address was entered.

% ATM_DIAG-E-ADDRESS_ERROR Invalid address was entered.

 $\%ATM_DIAG-E-BADMTU \ The \ specified \ MTU-\%d-is \ too \ large. \ Please \ select \ a \ smaller \ value \ and \ try \ again.$

%ATM_DIAG-E-BADPORT The specified port - port number %d - is illegal. Please check the port name and try again.

%ATM_DIAG-E-BADVLAN The specified VLAN - %s - does not exist. Please check the name of the VLAN and try again.

 $\%ATM_DIAG-E-BCAST0HOST\ Invalid\ IP\ address,\ \%s,\ is\ a\ broadcast\ address.$

%ATM_DIAG-E-BCAST1HOST Invalid IP address, %s, is a broadcast address.

%ATM_DIAG-E-CANNOTBRINGUP Interface %s has not been configured with any IP or IPX addresses. Please configure it before bringing it up.

% ATM_DIAG-E-CANNOTNEGATE Interface %s cannot be negated because addresses have been configured for it using \"interface add\" commands. Please negate the appropriate \"interface add\" commands before negating the \"interface create\" command.

%ATM_DIAG-E-CANTCREATEIF Unknown error creating interface %s!

%ATM_DIAG-E-CMD %s expected an argument, didn't get one

 $\%ATM_DIAG-E-DIAG_RCV_PKT_MALLOC_FAILED\ Malloc\ reports\ there\ is\ no\ more\ available\ memory.$

%ATM_DIAG-E-DIFFSUBNET local address(%s) and peer address(%s) are not on the same subnet.

%ATM_DIAG-E-EXISTS Interface %s has already been created. Please use another name for the interface.

%ATM_DIAG-E-IFNONE No %s interfaces found.

%ATM_DIAG-E-IFNOTIP An IP address cannot be configured on interface %s, because the interface does not support IP.

%ATM_DIAG-E-IFVLANEXISTS There is already an %s interface called %s on VLAN %s. A VLAN can be bound to only one L3 interface for each protocol.

% ATM_DIAG-E-IPADDREXISTS The IP address %s is already configured on interface %s.

%ATM_DIAG-E-MACCONFLICT The MAC address %s conflicts with another MAC address %s already being used by another interface on this port. Only one MAC address can be configured per port, per protocol.

%ATM_DIAG-E-MISSINGPORTVLANOPTIONS You must supply either the port or the vlan to be used with this interface.

%ATM_DIAG-E-MOD_PHY_GET_FAILURE Mod-Phy Get failed to return SUNI chip type.

%ATM_DIAG-E-MOD_PHY_GET_FAILURE Mod-Phy Get failed to return SUNI chip type.

%ATM_DIAG-E-MOD_PHY_PATH_FAILURE Slot %d Port %d, Mod-Phy SUNI CSR 0x%08x, Exp 0x%08x, Rcv 0x%08x.

%ATM_DIAG-E-MOD_PHY_PATH_FAILURE Sys Port %d, Mod-Phy SUNI CSR 0x%08x, Exp 0x%08x, Rcv 0x%08x.

% ATM_DIAG-E-NOMAC The MAC address, %s, is being used by the en0 10base-T interface on the CPU module and is reserved. Please use another MAC address.

%ATM_DIAG-E-NAME %s is not a valid host or network address

% ATM_DIAG-E-NAMETOOLONG The interface name %s is too long. The name cannot be longer than %d characters.

% ATM_DIAG-E-NO_PORTLIST_AVAIL No Port was specified by the user.

% ATM_DIAG-E-NO_PORTLIST_AVAIL No Port was specified by the user.

%ATM_DIAG-E-NOEXIST Interface %s does not exist. Please check the name and try again.

%ATM_DIAG-E-NOSUCHIF Interface %s was not found or is not configured with any '%s' addresses.

 $\%\,ATM_DIAG\text{-}E\text{-}NOSUCHPORT$ Port doesn't exist on this system.

%ATM_DIAG-E-NOVCLFOUND VCL at.%d.%d.%d.%d is not created.

% ATM_DIAG-E-PKT_DATA_BUFF_TOO_SMALL Packets must contain at least 32 bytes of data.

%ATM_DIAG-E-PKT_DATA_BUFF_TOO_SMALL Packets must contain at least 32 bytes of data.

 $\% ATM_DIAG-E-PKT_TEST_CHECK_PKT_COUNT \ Sys \ Port \ \% d, \ Sent \ \% d, \ Received \ \% d.$

 $\%ATM_DIAG-E-PKT_TEST_DATA_MISCOMPARE\ Addr\ 0x\%08x, Exp\ 0x\%08x, Rcv\ 0x\%08x.$

 $\%\,ATM_DIAG\text{-}E\text{-}PKT_TEST_FAILURE$ More on this later.

%ATM_DIAG-E-PKT_TEST_INCORRECT_LEN Exp %d, Rcv %d.

% ATM_DIAG-E-PKT_TEST_PKT_DIDNT_ARRIVE Sys Port %d, Packet number %d.

%ATM_DIAG-E-PKT_TEST_PORT_NOT_UP Sys Port %d.

 $\%ATM_DIAG-E-PKT_TEST_RCVD_EXTRA_PKT\ Sys\ Port\ \%d.$

%ATM_DIAG-E-PKT_TEST_SEND_PKT_FAILED SendPkt status = FAILED. Sys Port %d, PVC %d, %d bytes.

%ATM_DIAG-E-PKT_TEST_SEND_PKT_FAILED SendPkt status = FAILED. Sys Port %d, PVC %d, %d bytes.

%ATM_DIAG-E-PKT_TEST_SET_STATE_FAILED Sys Port %d, User Handle Index %d, 0x%08x.

%ATM_DIAG-E-PKT_TEST_SET_STATE_FAILED Sys Port %d, User Handle Index %d.

%ATM_DIAG-E-PKT_TEST_VC_OPEN_FAILED Sys Port %d.

%ATM_DIAG-E-PKT_TEST_VC_OPEN_FAILED Sys Port %d.

%ATM_DIAG-E-PKT_TEST_WRONG_LENGTH Incorrect length from packet. Sys Port %d, Exp'd %d, Rcv'd %d.

% ATM_DIAG-E-PORTHASVLAN Port %s already belongs to VLAN %s. Please use the -vlan- option of the -interface create- command instead of the -port- option.

%ATM_DIAG-E-PROTNOTSUPP VLAN %s does not support the %s protocol. Please check the VLAN name and try again.

% ATM_DIAG-E-QOSATTACHED A QOS flow definition is attached to interface %s. Please negate the QOS commands applied to this interface.

%ATM_DIAG-E-RANGE_ERROR End address must be greater than Start address.

% ATM_DIAG-E-RANGE_ERROR End address must be greater than Start address.

%ATM_DIAG-E-RESERVEDIF Interface %s is a reserved interface and cannot be created. However, you can add addresses to the interface using the _interface add_ command.

%ATM_DIAG-E-SUBNETEXISTS The address %s belongs to a subnet which is already configured on this system.

%ATM_DIAG-E-TSHOP_CSR_ADDR_FAILURE Slot %d Port %d, CSR 0x%08x, Exp 0x%08x, Rcv 0x%08x.

%ATM_DIAG-E-TSHOP_CSR_ADDR_FAILURE Sys Port %d, CSR 0x%08x, Exp 0x%08x, Rcv 0x%08x.

 $\%ATM_DIAG-E-TSHOP_CSR_DATA_FAILURE\ Slot\ \%d\ Port\ \%d,\ CSR\ 0x\%08x,\ Exp\ 0x\%08x,\ Rcv\ 0x\%08x.$

%ATM_DIAG-E-TSHOP_CSR_DATA_FAILURE Sys Port %d, CSR 0x%08x, Exp 0x%08x, Rcv 0x%08x.

 $\%ATM_DIAG-E-TSHOP_MEM_ADDR_FAILURE\ \%s\ Slot\ \%d\ Port\ \%d,\ Addr\ 0x\%08x,\ Exp\ 0x\%08x,\ Rev\ 0x\%08x.$

 $\%ATM_DIAG-E-TSHOP_MEM_ADDR_FAILURE~\%s~Sys~Port~\%d,~Addr~0x\%08x,~Exp~0x\%08x,~Rcv~0x\%08x.$

 $\%ATM_DIAG-E-TSHOP_MEM_FAILURE\ Slot\ \%d\ Port\ \%d,\ Addr\ 0x\%08x,\ Exp\ 0x\%08x,\ Rev\ 0x\%08x.$

 $\%ATM_DIAG-E-TSHOP_MEM_FAILURE\ Sys\ Port\ \%d,\ Addr\ 0x\%08x,\ Exp\ 0x\%08x,\ Rcv\ 0x\%08x.$

%ATM_DIAG-E-TSHOP_RD_RANGE_ERROR Number of ToolShop CSRs to be read is too high.

%ATM_DIAG-E-TSHOP_RD_RANGE_ERROR Number of ToolShop CSRs to be read is too high.

%ATM_DIAG-E-UNKNOWN_SUNI_TYPE Slot %d Port %d, Unrecognized SUNI chip type.

%ATM_DIAG-E-UNKNOWN_SUNI_TYPE Unrecognized SUNI chip type on Local Port %d.

%ATM_DIAG-I-CSR_REQUIRED %s.

%ATM_DIAG-I-INCORRECT_PKT_ID Exp %d, Rcv %d.

%ATM_DIAG-I-MAC_ADDRSS_DUMP Slot %d, Port %d.

%ATM_DIAG-I-MEM_ADDRSS_TEST oc3 ToolShop SDRAM Address test on Slot %d, Port %d, from 0x%08x to 0x%08x, on %s.

%ATM_DIAG-I-MEM_ADDRSS_TEST oc3 ToolShop SDRAM Address test on Slot %d, Port %d,\n from 0x%08x to 0x%08x, on %s.

%ATM_DIAG-I-MEM_MACHO__TEST oc3 ToolShop SDRAM Marching Ones test on Slot %d, Port %d, from 0x%08x to 0x%08x, on %s.

 $\%ATM_DIAG-I-MEM_MACHO__TEST\ oc3\ ToolShop\ SDRAM\ Marching\ Ones\ test\ on\ Slot\ \%d, Port\ \%d, \\ n\ from\ 0x\%08x\ to\ 0x\%08x, on\ \%s.$

%ATM_DIAG-I-MEM_STRESS_TEST oc3 ToolShop SDRAM Stress test on Slot %d, Port %d, from 0x%08x to 0x%08x, on %s.

%ATM_DIAG-I-MEM_STRESS_TEST oc3 ToolShop SDRAM Stress test on Slot %d, Port %d,\n from 0x%08x to 0x%08x, on %s.

%ATM_DIAG-I-MEM_ZEROES_TEST

%ATM_DIAG-I-MEM_ZEROES_TEST

%ATM_DIAG-I-MODPHY_SUN_TEST oc3 Mod-Phy SUNI Path test on Slot %d, Port %d.

%ATM_DIAG-I-MODPHY_SUN_TEST oc3 Mod-Phy SUNI Path test on Slot %d, Port %d.

%ATM_DIAG-I-PHY_NOT_PRESENT %s.

%ATM_DIAG-I-PKT_LENGTH_TEST oc3 Various Length Packet test on Slot %d, Port %d.

%ATM_DIAG-I-PKT_QUICK_TEST oc3 VPI VCI Range Packet test on System Port Number %d.

%ATM_DIAG-I-PKT_QUICK_TEST oc3 VPI VCI Range Packet test on System Port Number %d.

%ATM_DIAG-I-PKT_RANGES_TEST oc3 VPI VCI Range Packet test on Slot %d, Port %d.

%ATM_DIAG-I-PKT_RANGES_TEST oc3 VPI VCI Range Packet test on Slot %d, Port %d.

 $\% ATM_DIAG-I-PKT_SIMULT_TEST\ oc 3\ Simultaneous\ Packet\ and\ Memory\ test\ on\ Slot\ \%d,\ Port\ \%d.$

%ATM_DIAG-I-PKT_SIMULT_TEST oc3 Simultaneous Packet and Memory test on Slot %d, Port %d.

%ATM_DIAG-I-TEST_LOOP_COUNT %s PASSED, Loop number %d.

%ATM_DIAG-I-TEST_LOOP_COUNT %s, Loop number %d

%ATM_DIAG-I-TLSHOP_CSR_TEST oc3 ToolShop CSRs test on Slot %d, Port %d.

 $\%ATM_DIAG-I-TLSHOP_CSR_TEST\ oc3\ ToolShop\ CSRs\ test\ on\ Slot\ \%d,\ Port\ \%d.$

 $\%ATM_DIAG\text{-}I\text{-}TOO_MANY_PAKETS \ You \ selected \ too \ many \ VPIs \ and/or \ VCIs.$

 $\%\,ATM_DIAG\text{-I-TOO_MANY_PAKETS}\,\,You\,\,selected\,\,too\,\,many\,\,VPIs\,\,and/or\,\,VCIs.$

%ATM_DIAG-I-VALUE_REQUIRED %s.

%ATM_DIAG-W-WAN_CREATE_FAILED interface creation failed on slot %d port %d

%ATM_DIAG-W-WAN_NEGATE_FAILED interface negation failed on slot %d port %d

 $\%ATM_PVC\text{-}E\text{-}INVALID_DEFINE_OBJECT\ Unexpected\ atm\ define\ object:\ \%s$

%ATM_PVC-E-INVALID_QOS_OPTION Unsupported QoS option.

%ATM_PVC-E-INVALID_SRV_CAT_OPTION The Service Category %s is not supported

%ATM_PVC-E-MODIFY_FAILED PVC modify failed with status %d

%ATM_PVC-E-NO_AVAIL_BW Bandwidth not available on link, free: %d

%ATM_PVC-E-NO_AVAIL_QOS_DEFINE Maximum QoS Definitions exceeded

% ATM_PVC-E-NO_CHANGE_ENCAP Cannot change the PVC encapsulation

%ATM_PVC-E-NO_CHANGE_SRV_CLS Cannot change the Service Class

% ATM_PVC-E-NO_PORTLIST_AVAIL A portlist was not found in the command options

%ATM_PVC-E-NO_PVC_FOUND Cannot modify PVC on slot %d vpi %d vci %d

%ATM_PVC-E-NO_RESOURCES_AVAIL XP reporting no memory resources

%ATM_PVC-E-PVC_MAX_EXCEEDED Port has maximum PVCs defined. Max = %d

%ATM_PVC-E-QOS_NAME_NOT_FOUND The QoS Definition name %s was not found

% ATM_PVC-E-UNKNOWN_DEFINE_CMD ATM define command not recognized

%ATM_PVC-E-VCI_OUT_OF_RANGE VCI %d is beyond supported VCI max %d

%ATM_PVC-E-VPI_OUT_OF_RANGE VPI %d is beyond supported VPI max %d

% ATM_PVC-W-FIXING_MBS_OPTION MBS set, QoS not VBR. Clearing MBS value.

%ATM_PVC-W-FIXING_SCR_OPTION SCR set, QoS not VBR. Clearing SCR value.

%ATM-E-ATMFRAMINGNOTSUPPORTED <0> <2> Port set failed on port at.%d.%d, framing value not valid for this PHY type.

%ATM-E-ATMMEDIANOTSUPPORTED <0> <2> Port set failed on port at.%d.%d, media type can only be set on MMF, SMF, UTP PHYs.

%ATM-E-ATMPORTINFAILURE <0> <2> Port at.%d.%d experienced previous failure. Please repair.

%ATM-E-ATMSCRAMBLENOTSUPPORTED <0> <2> Port set failed on port at.%d.%d, scramble value not valid for this PHY type.

%ATM-E-BIGDTIMEOUTINIT Channel %d, time-out while waiting for Bit 0 in BigD Xlnx Init register to be 1.

% ATM-E-REG_MULTI_ADDR Could not register the ATM Multicast Address.

%ATM-E-RSVDSRVNAME Service name is reserved, please choose another name. // ATM PVC message area.

 $\%ATM-E-SRVDEFINUSE < 0 > < 3 > Service \ definition \ on \ at. \%d. \%d \ still \ in \ use \ by \ \%d \ VPL(s) \ or \ VCL(s).$

 $\%ATM-E-SRVDEFPORTREMOVE < 0> < 3> Service \ \% s \ not found on \ at. \% d. \% d. \ Negate \ failure.$

%ATM-E-VPLSRVDEFMODIFY <0> <5> Replaced SrvDef %s on at.%d.%d.%d with SrvDef %s.

%ATM-I-VCLSRVDEFMODIFY <0> <6> Replaced SrvDef %s on at.%d.%d.%d.%d with SrvDef %s.

% ATM-I-VPLALREADYOPEN <0> <2> VPI %d on local ATM port %d already open.

%BGP-E-BADEXTLCPRFGR Localpref can only be used with Internal, IGP or Routing groups not with external group %s.

%BGP-E-BADHSTLOCALPREF LocalPref option for internal peer host %s should be the same as used in the group %s.

%BGP-E-BADINTVAL Interfaces may only be specified for (internal) routing groups. %s is not of group type routing

%BGP-E-BADLOCALPREF if localpref is set on one internal peer group, it must be set on all internal peer groups. LocalPref is not configured for %s group.

%BGP-E-GENWRKINPROGR Sorry; Work in progress and not completed; // // Errors related to Peer Groups //

%BGP-E-GROUPEXISTS Group with Id %s also has type %s and as %d.

 $\mbox{\rm \%BGP-E-HOSTNOTFOUND}$ Peer host $\mbox{\rm \%s}$ not found in peer group $\mbox{\rm \%s}.$

%BGP-E-HSTNOTESTABLISH Peer host %s connection is not established yet. // // Errors related to Peer-Group Allowed Networks. //

%BGP-E-TMPFILEFAIL Failed to create temp, parse file

%BGP-E-PARSEERROR %s

%CDP-E-AUTH_ERROR Received CDP packet has invalid authentication code

%CDP-E-CREATEQ error creating $'\%\,s'$ queue - error= $\%\,d$

%CDP-E-EVENTWAIT error in wait for events

%CDP-E-INVALID_VERSION CDP packet received with unsupported version

%CDP-E-MCASTREG error registering multicast address - port=%d

%CDP-E-NOMEM processing error - insufficient memory

%CDP-E-NONETBUFS unable to send frame no net buffer port %d

%CDP-E-NOWAN CDP is not supported on WAN modules.

%CDP-E-PARSE_ERROR Received CDP packet could not be parsed

%CDP-E-STPTIMER error stopping '%s' timer - error=%d

%CDP-E-STRTTIMER error starting '%s' timer - error=%d

%CDP-E-TIMER error creating '%s' timer - error=%d

%CDP-E-XMTQFULL unable to send frame xmit queue full port %d

%CDP-I-CDP_RECEIVE Received CDP packet on port %s with eth type %d

%CDP-I-CDP_RECEIVE1 Received CDP packet on port %d with eth type %d

%CDP-I-CDP_SEND Sent CDP packet on port '%s'

% CDP-I-NEIGHBOR_ADD Added new %s neighbor with neighbor port '%s'

%CDP-I-NEIGHBOR_ADD1 Added new %s neighbor with neighbor port '%d'

%CDP-I-NEIGHBOR_AGE Neighbor with neighbor port '%s' aged out

%CDP-I-NEIGHBOR_AGE1 Neighbor with neighbor port '%d' aged out

%CDP-I-NEIGHBOR_DEL Neighbor with neighbor port '%s' deleted

 $\%CDP\text{-}I\text{-}NEIGHBOR_DEL1$ Neighbor with neighbor port '%d' deleted

 $\% CDP\text{-I-NEIGHBOR_UPDATE Neighbor entry with neighbor port: } '\% s' \ updated$

%CDP-I-NEIGHBOR_UPDATE1 Neighbor entry with neighbor port: '%d' updated

%CDP-W-NOWAN CDP is not supported on WAN modules.

%CLI-E-FDDI_ONLY This command requires a FDDI port

% CLI-E-IVMODULE invalid or unoccupied module number specified: $'\%\,s'$

% CLI-E-IVNUMTOOHI $'\%\,s'$ is higher than the acceptable range $(\%\,d\text{-}\%\,d)$

%CLI-E-IVNUMTOOLOW '%s' is lower than the acceptable range (%d-%d)

%CLI-E-IVVPIRANGE VPI range '%s' is illegal

%CLI-E-NO_VCI VCI specification is not allowed
%CLI-E-NO_VPI VPI specification is not allowed

%CLI-E-NOPOS POS port not allowed for this command

%CLI-E-POS_ONLY This command requires a POS port

%CLI-E-SONET_ONLY This command requires a SONET port

%CLI-E-VPIRANGEBAD VPI range '%s', syntax error

%CLI-F-NOKWYDS internal error - no keywords available

%CLI-I-MONITOR_OFF Terminal monitor disabled

%CLI-I-MONITOR_ON Terminal monitor enabled

%COMMON-E-BADMOVE Source and Destination are the same

%COMMON-E-INMLP Port '%s' is part of MLP bundle multilink%d

%COMMON-E-INTERNAL Internal error

%COMMON-E-INTRUNK Port '%s' is part of %s %s%d

%COMMON-E-INVALIDENCRYPT Invalid password encryption '%s'

%COMMON-E-NOTFOUND Command number '%d' not found

%COMMON-E-USERMODE Failed to enter '%s' mode

%COMMON-E-WRONGAL You can only add entries to access list '%d' in this editing session

%COMMON-I-ALNOCHANGE No change was made to access list, exiting...

%CONS-E-CONTROL_TIMER NU_Control_Timer failed with status %d

%CONS-E-CREATE_TIMER NU_Create_Timer failed with status %d

%CONS-E-DELETE_TIMER NU_Delete_Timer failed with status %d

%CONS-E-INPUT2LONG input is longer than %d characters

 $\%CONS\text{-}E\text{-}RESET_TIMER\ NU_Reset_Timer\ failed\ with\ status\ \%d$

 $\%CONS\mbox{-I-DISABLE}$ All ports have been disabled

%CONS-I-NOJOY Unable to load %s

%CONS-I-PORT_INVALID cfgport %s not valid

%CONS-I-PORT_MISSING cfgport not set

%CONS-I-PORT_NOLINK %s No link

 $\% CONS\mbox{-}I\mbox{-}SMARTBOOT$ No configuration found, Attempting tftp

%CONS-I-TFTP_DONE tftp of %s complete

%CONS-W-BOOTADDR bootaddr not set

%CONS-W-CFGSOURCE cfgsource not set

%CONS-W-GATEWAY gateway not set

%CONS-W-IDLE_TIMEOUT Serial console idle time-out

%CONS-W-NETADDR netaddr not set

%CONS-W-NETMASK netmask not set

%DDT-E-AT_MODULE AT Module (Slot %i): FAILED

%DDT-E-BOARD_DETECT Bad Board Detect (Slot %i)

%DDT-E-BP_GE_MODULE Backplane GE Module (Slot %i) : FAILED

%DDT-E-BP_GMAC_6KBP_LOOPBACK (Slot %i, Port %i): Backplane GMAC 6000BP Loopback: FAILED

%DDT-E-CMTS_BCM3033_REG (Slot %i): BCM-3033 Register Test: FAILED

%DDT-E-CMTS_BCM3137_REG (Slot %i): BCM-3137 Register Test: FAILED

%DDT-E-CMTS_BCM3210_INT_LB (Slot %i): BCM-3210 Internal Loopback Test: FAILED #endif /* CMTS_SUPPORT */

%DDT-E-CMTS_BCM3210_LED (Slot %i): BCM-3210 LED Test: FAILED

 $\mbox{\ensuremath{\%}DDT-E-CMTS_BCM3210_REG}$ (Slot $\mbox{\ensuremath{\%}i)}$: BCM-3210 Register Test: FAILED

%DDT-E-CMTS_BCM3210_TS_CNTR (Slot %i): BCM-3210 Time Stamp Counter Test: FAILED

%DDT-E-CMTS_CPU_TESTS CMTS PROM-Based Tests (Slot %i): FAILED

 $\% DDT\text{-}E\text{-}CMTS_ETHER_REG \ (Slot \ \%i): CMTS \ Ethernet \ Controller \ Registers \ Test: FAILED$

%DDT-E-CMTS_EXT_LB (Slot %i) : CMTS Ethernet XBAR Loopback : FAILED

%DDT-E-CMTS_EXTN_BUFFER_RAM (Slot %i): External Buffer RAM Test: FAILED

%DDT-E-CMTS_EXTN_KEY_RAM (Slot %i): External Key RAM Test: FAILED

%DDT-E-CMTS_EXTN_MAP_RAM (Slot %i): External Map RAM Test: FAILED

%DDT-E-CMTS_GALILEO_REG_TEST (Slot %i) : CMTS Galileo Registers Test : FAILED

%DDT-E-CMTS_GALILEO_TIMER_TEST (Slot %i) : CMTS Galileo Timer Interrupt Test : FAILED

%DDT-E-CMTS_L2_CACHE (Slot %i) : CMTS L2 Cache Test : FAILED

%DDT-E-CMTS_MAC_LB (Slot %i) : CMTS Ethernet MAC Loopback : FAILED

%DDT-E-CMTS_MOD_PROM_TESTS %s #endif /* CMTS_SUPPORT */

%DDT-E-CMTS_MODULE CMTS Module (Slot %i): FAILED

%DDT-E-CMTS_PCI9080_REG (Slot %i): PCI-9080 Register Test: FAILED

%DDT-E-CMTS_PORT_STATUS (Slot %i, HDLC Port %i): FAILED #endif /* CMTS_SUPPORT */

 $\%DDT\text{-}E\text{-}CMTS_SDRAM_A_D_BUS\ (Slot\ \%i): CMTS\ SDRAM\ Address\ and\ Data\ Buses\ Test: FAILED$

 $\%DDT\text{-}E\text{-}CMTS_SDRAM_MARCH_C (Slot \ \%i): CMTS \ SDRAM \ MarchC \ Memory \ Test: FAILED$

%DDT-E-CMTS_SEMAPHORE (Slot %i): CMTS Semaphore Test: FAILED

%DDT-E-CMTS_SHMEM (Slot %i): Shared Memory Test: FAILED

 $\% DDT\text{-}E\text{-}CPU_MOD_CACHE_MEM\ CPU\ Module\ Cached\ Memory: FAILED$

 $\%DDT\text{-}E\text{-}CPU_MOD_EN0_LOOPBACK\ EN0\ Packet\ Loopback: FAILED: Size = \%d;\ Seq = \%s$

%DDT-E-CPU_MOD_EN0_PAYLOAD_DATA EN0 Packet Payload Mismatch : Size = %d; Seq = %s

%DDT-E-CPU_MOD_EN0_PAYLOAD_LEN EN0 Packet Length Mismatch : Expected %d; Got %d

%DDT-E-CPU_MOD_EN0_Q EN0 Diag Queue not initialized

%DDT-E-CPU_MOD_ETH CPU Module Ethernet : FAILED

%DDT-E-CPU_MOD_EXTFLASH CPU Module External Flash : FAILED

%DDT-E-CPU_MOD_FLASH CPU Module Flash : FAILED

%DDT-E-CPU_MOD_INTFLASH CPU Module Internal Flash: FAILED

%DDT-E-CPU_MOD_MEM CPU Module Memory : FAILED

%DDT-E-CPU_MOD_RTC CPU Module: Real Time Clock did not advance

%DDT-E-CPU_MOD_SYSREG CPU Module FPGA Test: FAILED

%DDT-E-CPU_MOD_SYSREG_GEN CPU Module FPGA: %s

%DDT-E-CPU_MOD_SYSREG_HOTSWAP_FAIL CPU Module Sysreg Hotswap; Module %i:FAILED

%DDT-E-CPU_MOD_SYSREG_HOTSWAP_MISMATCH CPU Module Sysreg Hotswap; Hotswap detect mismatch 0x%08lx

%DDT-E-CPU_MOD_SYSREG_INT_MISMATCH CPU Module Sysreg Interrupt; Unexpected interrupt was encountered

%DDT-E-CPU_MOD_SYSREG_INT_NOMATCH CPU Module Sysreg Interrupt; Expected interrupt did not occur

%DDT-E-CPU_MOD_SYSREG_INT_Q CPU Module Sysreg Interrupt Queue Initialized; Check runscope option

 $\% DDT\text{-}E\text{-}CPU_MOD_SYSREG_INT_TIMEOUT\ CPU\ Module\ Sysreg\ Interrupt\ Time-out$

 $\% DDT\text{-}E\text{-}CPU_MOD_TIMER_INT\ CPU\ Module: Timer\ interrupt\ not\ detected$

 $\%DDT\text{-}E\text{-}CPU_MOD_TIMERS\ CPU\ Module\ Timers:FAILED$

 $\% DDT\text{-}E\text{-}CPU_MOD_TIMERS_MISMATCH \ CPU \ Module: Timers \ out \ of \ sync$

 $\%\,DDT\text{-}E\text{-}CPU_MOD_UCACHE_MEM\ CPU\ Module\ Uncached\ Memory: FAILED$

 $\%\,DDT\text{-E-CPU_MOD_Z8536}$ CPU Module : z8536 timer did not advance

%DDT-E-CPU_MODULE CPU Module: FAILED

 $\%\,\mathrm{DDT\text{-}E\text{-}DEBUG_TEST}$ Debug Test: FAILED

%DDT-E-DIAG_LOOP Failure detected at iteration %i:%s

%DDT-E-DMAC_EXT_LOOPBACK (Slot %i, Port %i) : DMAC EXT Loopback : FAILED

 $\% DDT\text{-}E\text{-}DMAC_EXT_LOOPBACK (Slot~\%i, Port~\%i): DMAC~External~Loopback: FAILED$

 $\% DDT\text{-}E\text{-}DMAC_MAC_LOOPBACK (Slot \ \%i, Port \ \%i): DMAC \ MAC \ Loopback: FAILED$

%DDT-E-DMAC_MAC_LOOPBACK (Slot %i, Port %i): DMAC MAC Loopback: FAILED

%DDT-E-DMAC_MEM_TEST (Slot %i, Port %i): DMAC Memory Test: FAILED

%DDT-E-DMAC_MEM_TEST (Slot %i, Port %i): DMAC Memory Test: FAILED %DDT-E-DMAC_PHY_LOOPBACK (Slot %i, Port %i): DMAC PHY Loopback: FAILED %DDT-E-DMAC_PHY_LOOPBACK (Slot %i, Port %i): DMAC PHY Loopback: FAILED %DDT-E-DMAC_STRIP_LOOPBACK (Slot %i, Port %i): DMAC Stripping Loopback: FAILED %DDT-E-DMAC_STRIP_LUBACK (Slot %i, Port %i): DMAC STRIP Luback: FAILED %DDT-E-DMAC_TEST (Slot %i, Port %i): DMAC Test: FAILED %DDT-E-DMAC_TEST (Slot %i, Port %i): DMAC Test: FAILED %DDT-E-ELITE_IPC (Index %i) : ELITE IPC : FAILED %DDT-E-ELITE_MODULE ELITE Module (Slot %i): FAILED %DDT-E-FDDI_CAMEL_BIST (Slot %i, Port %i): FDDI CAMEL BiST: ipc FAILED %DDT-E-FDDI_CAMEL_CAM (Slot %i, Port %i): FDDI CAMEL CAM Test: ipc FAILED %DDT-E-FDDI_CAMEL_CSR (Slot %i, Port %i): FDDI CAMEL CSR: ipc FAILED %DDT-E-FDDI_CAMEL_UNIQUE_ADDR (Slot %i, Port %i): FDDI CAMEL unique Addressability: ipc FAILED %DDT-E-FDDI_CPU_TESTS FDDI PROM-Based Tests (Slot %i): FAILED %DDT-E-FDDI_DAS_A_CDC_LOOPBACK (Slot %i, Port %i): FDDI ELM A CDC Lpbk: ipc FAILED %DDT-E-FDDI_DAS_A_EB_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM A EBUFF Lpbk: ipc FAILED %DDT-E-FDDI_DAS_A_EXTERNAL_LOOPBACK (Slot %i, Port %i): FDDI ELM A Ext Lpbk: ipc FAILED %DDT-E-FDDI_DAS_A_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM A LM Local Lpbk: ipc FAILED %DDT-E-FDDI_DAS_A_SC_BYPASS_LOOPBACK (Slot %i, Port %i): FDDI ELM A SC Bypass Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_CAM_LOOPBACK (Slot %i, Port %i): FDDI ELM B CAM Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_CDC_LOOPBACK (Slot %i, Port %i): FDDI ELM B CDC Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_EB_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM B EBUFF Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_EXTERNAL_LOOPBACK (Slot %i, Port %i): FDDI ELM B Ext Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM B LM Local Lpbk: ipc FAILED %DDT-E-FDDI_DAS_B_SC_BYPASS_LOOPBACK (Slot %i, Port %i): FDDI ELM B SC Bypass Lpbk: ipc FAILED %DDT-E-FDDI_ELM_BIST (Slot %i, Port %i): FDDI ELM BiST: ipc FAILED %DDT-E-FDDI_ELM_CSR (Slot %i, Port %i): FDDI ELM CSR Test: ipc FAILED %DDT-E-FDDI_ELM_UNIQUE_ADDR (Slot %i, Port %i): FDDI ELM Unique Addressability: ipc FAILED %DDT-E-FDDI_MODULE FDDI Module (Slot %i) : FAILED %DDT-E-FDDI_PHY_ELM_LINE_STATES (Slot %i, Port %i): FDDI ELM A Line States: ipc FAILED %DDT-E-FDDI_PORT_STATUS (Slot %i, HDLC Port %i): FAILED %DDT-E-FDDI_SHARED_BUS (Slot %i): Expected greater than 5000; Got %i: FAILED

%DDT-E-FDDI_SHARED_BUS_IPC (Slot %i): Arbitrary Bus Test: ipc FAILE

%DDT-E-FE_MODULE FE Module (Slot %i) : FAILED

%DDT-E-GE_MODULE GE Module (Slot %i): FAILED

%DDT-E-GEN %s

%DDT-E-GMAC_CASCADE_LOOPBACK (Slot %i, Port %i): GMAC Cascade Loopback: FAILED

%DDT-E-GMAC_EXT_LOOPBACK (Slot %i, Port %i): GMAC EXT Loopback: FAILED

%DDT-E-GMAC_INT_LOOPBACK (Slot %i, Port %i): GMAC Internal Loopback: FAILED

%DDT-E-GMAC_MAC_LOOPBACK (Slot %i, Port %i): GMAC MAC Loopback: FAILED

%DDT-E-GMAC_MEM_TEST (Slot %i, Port %i): GMAC Memory Test: FAILED

%DDT-E-GMAC_PHY_LOOPBACK (Slot %i, Port %i): GMAC PHY Loopback: FAILED

%DDT-E-GMAC_TEST (Slot %i, Port %i): GMAC Test: FAILED

%DDT-E-IPP_MEM_TEST (Slot %i): IPP Memory Test: FAILED

%DDT-E-IPP_TEST (Slot %i) : IPP Test : FAILED

%DDT-E-MEMORY_ALIASING Memory error @ 0x%08lx; Possible aliasing with: 0x%08lx

%DDT-E-MEMORY_BYTE_MISMATCH Memory mismatch @ 0x%08lx; Read 0x%x; Expected 0x%x

%DDT-E-MEMORY_INACCESSIBLE Memory inaccessible beginning @ 0x%08lx -- will generate fatal exception

%DDT-E-MEMORY_MISMATCH Memory mismatch @ 0x%08lx; Read 0x%08lx; Expected 0x%08lx

 $\% DDT\text{-}E\text{-}NIA_LOOPBACK\ NIA\ Loopback\ Test:\ FAILED$

%DDT-E-NIA_MEM_BUFFER NIA Buffer Memory Test: FAILED

%DDT-E-NIA_MEM_CTL_PRI_QUEUE_TEST NIA Control Priority Queue Test: FAILED

%DDT-E-NIA_MEM_FREE_PRI_QUEUE_TEST NIA Free Priority Queue Test: FAILED

 $\%\,DDT\text{-}E\text{-}NIA_MEM_HI_PRI_QUEUE_TEST\,\,NIA\,\,High\,\,Priority\,\,Queue\,\,Test:\,\,FAILED$

 $\%\,DDT\text{-}E\text{-}NIA_MEM_LOW_PRI_QUEUE_TEST\,\,NIA\,\,Low\,\,Priority\,\,Queue\,\,Test:\,\,FAILED$

 $\% DDT\text{-}E\text{-}NIA_MEM_MED_PRI_QUEUE_TEST\ NIA\ Medium\ Priority\ Queue\ Test:\ FAILED$

%DDT-E-NIA_MEM_TEST NIA Memory Test: FAILED

%DDT-E-NIA_TEST NIA Test: FAILED

%DDT-E-NIA_XBAR_LOOPBACK NIA-XBAR Loopback Test: FAILED

%DDT-E-OCMAC_EXT_LOOPBACK (Slot %i, Port %s) : OCMAC EXT Loopback : FAILED

 $\% DDT\text{-}E\text{-}OCMAC_INT_LOOPBACK \ (Slot \ \%i, Port \ \%s): OCMAC \ Internal \ Loopback: FAILED$

%DDT-E-OCMAC_MAC_LOOPBACK (Slot %i, Port %s) : OCMAC MAC Loopback : FAILED

%DDT-E-OCMAC_MEM_TEST (Slot %i, Port %i): OCMAC Memory Test: FAILED

%DDT-E-OCMAC_PHY_LOOPBACK (Slot %i, Port %s): OCMAC PHY Loopback: FAILED

%DDT-E-OCMAC_STRIP_LOOPBACK (Slot %i, Port %i): OCMAC Stripping Loopback: FAILED

%DDT-E-OCMAC_TEST (Slot %i, Port %i) : OCMAC Test : FAILED

%DDT-E-OPP_MEM_TEST (Slot %i) : OPP Memory Test : FAILED

%DDT-E-OPP_TEST (Slot %i): OPP Test: FAILED

%DDT-E-PKT_FLUSH NIA %s queue flush incomplete: %i bufs remain

%DDT-E-PKT_STAT %s

%DDT-E-PORT_FAIL_COUNT (Slot %i, Port %i) failed %i times during test

%DDT-E-PORT_LINK_DOWN Test Failed: (Slot %d, Port %d) Link State DOWN

%DDT-E-PORT_STATUS (Slot %i, Port %i): FAILED

%DDT-E-POS_MICRO_TEST (Slot %i): POS Microcontroller Test: FAILED

%DDT-E-QMAC_EXT_LOOPBACK (Slot %i, Port %2i) : QMAC EXT Loopback : FAILED

%DDT-E-QMAC_MAC_LOOPBACK (Slot %i, Port %2i): QMAC MAC Loopback: FAILED

%DDT-E-QMAC_MEM_TEST (Slot %i, Port %2i) : QMAC Memory Test : FAILED

 $\%DDT\text{-}E\text{-}QMAC_PHY_LOOPBACK (Slot \%i, Port \%2i): QMAC \ PHY \ Loopback: FAILED$

 $\% DDT\text{-}E\text{-}QMAC_STRIP_LOOPBACK (Slot \ \%i, Port \ \%2i): QMAC \ Stripping \ Loopback: FAILED$

%DDT-E-QMAC_STRIP_LUBACK (Slot %i, Port %2i) : QMAC STRIP Luback : FAILED

 $\%DDT\text{-}E\text{-}QMAC_TEST\ (Slot\ \%i,\ Port\ \%2i):QMAC\ Test:FAILED$

%DDT-E-SGE_MODULE S-GE Module (Slot %i) : FAILED

%DDT-E-SIPP_MEM_TEST (Slot %i): SIPP Memory Test: FAILED

%DDT-E-SIPP_TEST (Slot %i): SIPP Test: FAILED

%DDT-E-SNAKE_LOOPBACK %s Cascade Loopback: (Slot %i, Port %i): FAILED

 $\%\,DDT\text{-}E\text{-}SNAKE_MODULE\;Cascade\;Loopback}:FAILED$

%DDT-E-SO_MODULE SO Module (Slot %i) : FAILED

 $\%DDT\text{-}E\text{-}SOPP_MEM_TEST\ (Slot\ \%i): SOPP\ Memory\ Test: FAILED$

%DDT-E-SOPP_TEST (Slot %i): SOPP Test: FAILED

%DDT-E-SXOB_CNTR_TEST (Slot %i): SXOB Counters Test: FAILED

 $\%DDT\text{-}E\text{-}SXOB_MEM_TEST\ (Slot\ \%i): SXOB\ Memory\ Test: FAILED$

%DDT-E-SXOB_PKTMEM_TEST (Slot %i) : SXOB Packet Memory Test : FAILED

 $\%DDT\text{-}E\text{-}SXOB_TBLMEM_TEST\ (Slot\ \%i): SXOB\ Table\ Memory\ Test: FAILED$

%DDT-E-SXOB_TEST (Slot %i): SXOB Test: FAILED

%DDT-E-UNKNOWN_MODULE_TYPE Unknown Module Type: %i

%DDT-E-UNKNOWN_PORT_TYPE Unknown Port Type

%DDT-E-WAN_CPU_TESTS WAN PROM-Based Tests (Slot %i): FAILED

%DDT-E-WAN_DSU_LB (Slot %i): DSU Loopback Test: FAILED #ifdef CMTS_SUPPORT

%DDT-E-WAN_ETHER_REG (Slot %i): WAN Ethernet Controller Registers Test: FAILED

%DDT-E-WAN_EXT_LB (Slot %i): WAN Ethernet XBAR Loopback: FAILED

%DDT-E-WAN_GALILEO_REG_TEST (Slot %i): WAN Galileo Registers Test: FAILED

%DDT-E-WAN_GALILEO_TIMER_TEST (Slot %i): WAN Galileo Timer Interrupt Test: FAILED

%DDT-E-WAN_HDLC_EXT_LB (Slot %i): HDLC External Loopback: FAILED

%DDT-E-WAN_HDLC_INT_LB (Slot %i): HDLC Internal Loopback: FAILED

%DDT-E-WAN_HDLC_LINK_LED (Slot %i): HDLC Link LEDs Test: FAILED

%DDT-E-WAN_HDLC_REG (Slot %i): WAN HDLC Registers Test: FAILED

%DDT-E-WAN_HIFN_7711 (Slot %i): HIFN 7711 Test: FAILED

%DDT-E-WAN_HIFN_9711 (Slot %i): HIFN 9711 Test: FAILED

%DDT-E-WAN_HIFN_MEM (Slot %i): HIFN Context Memory Test: FAILED

%DDT-E-WAN_L2_CACHE (Slot %i) : WAN L2 Cache Test : FAILED

%DDT-E-WAN_MAC_LB (Slot %i): WAN Ethernet MAC Loopback: FAILED

%DDT-E-WAN_MODULE WAN Module (Slot %i) : FAILED

 $\% \, DDT\text{-}E\text{-}WAN_PORT_STATUS \, (Slot \, \%i, \, HDLC \, Port \, \%i): FAILED \, \#ifdef \, CMTS_SUPPORT \,$

 $\%DDT\text{-}E\text{-}WAN_SDRAM_A_D_BUS \ (Slot \ \%i): WAN \ SDRAM \ Address \ and \ Data \ Buses \ Test: FAILED$

 $\%DDT\text{-}E\text{-}WAN_SDRAM_MARCH_C\ (Slot\ \%i): WAN\ SDRAM\ MarchC\ Memory\ Test: FAILED$

 $\% DDT\text{-}E\text{-}WAN_SEMAPHORE \ (Slot \ \%i): WAN \ Semaphore \ Test: FAILED$

%DDT-E-WAN_SHMEM (Slot %i): Shared Memory Test: FAILED

 $\% DDT\text{-}E\text{-}XBAR_CHAN\ Cross\text{-}Bar\text{:}\ Channel\text{-}to\text{-}Channel\ Test\text{ :}\ FAILED$

 $\%DDT\text{-}E\text{-}XBAR_FABRIC\ Cross\text{-}Bar\ Fabric\ \%i:FAILED$

 $\%\,DDT\text{-}E\text{-}XB\,AR_GEN\,\,\%\,s$

%DDT-E-XBAR_LINK Cross-Bar: (Slot %i, Port %i) -> (Slot %i, Port %i): FAILED

%DDT-E-XBAR_MODULE Cross-Bar on Back-Plane: FAILED

%DDT-I-AT_MODULE AT Module (Slot %i): PASSED

 $\%\,DDT\text{-}I\text{-}BP_GE_MODULE\,\,Backplane\,\,GE\,\,Module\,\,(Slot\,\,\%i):PASSED$

 $\% DDT\text{-I-BP_GMAC_6KBP_LOOPBACK} \ (Slot\ \%i,\ Port\ \%i): Backplane\ GMAC\ 6000BP\ Loopback: PASSED$

%DDT-I-CMTS_BCM3033_REG (Slot %i): BCM-3033 Register Test: PASSED

%DDT-I-CMTS_BCM3137_REG (Slot %i): BCM-3137 Register Test: PASSED

%DDT-I-CMTS_BCM3210_INT_LB (Slot %i): BCM-3210 Internal Loopback Test: PASSED

%DDT-I-CMTS_BCM3210_LED (Slot %i): BCM-3210 LED Test: PASSED

%DDT-I-CMTS_BCM3210_REG (Slot %i): BCM-3210 Register Test: PASSED

%DDT-I-CMTS_BCM3210_TS_CNTR (Slot %i): BCM-3210 Time Stamp Counter Test: PASSED

%DDT-I-CMTS_CPU_TESTS CMTS PROM-Based Tests (Slot %i): PASSED #endif /* CMTS_SUPPORT */

%DDT-I-CMTS_ETHER_REG (Slot %i): CMTS Ethernet Controller Registers Test: PASSED

%DDT-I-CMTS_EXT_LB (Slot %i): CMTS Ethernet XBAR Loopback: PASSED

%DDT-I-CMTS_EXTN_BUFFER_RAM (Slot %i): External Buffer RAM Test: PASSED

%DDT-I-CMTS_EXTN_KEY_RAM (Slot %i): External Key RAM Test: PASSED

%DDT-I-CMTS_EXTN_MAP_RAM (Slot %i): External Map RAM Test: PASSED

%DDT-I-CMTS_GALILEO_REG_TEST (Slot %i): CMTS Galileo Registers Test: PASSED

%DDT-I-CMTS_GALILEO_TIMER_TEST (Slot %i): CMTS Galileo Timer Interrupt Test: PASSED

%DDT-I-CMTS_L2_CACHE (Slot %i): CMTS L2 Cache Test: PASSED

%DDT-I-CMTS_MAC_LB (Slot %i) : CMTS Ethernet MAC Loopback : PASSED

 $\% \, DDT\text{-I-CMTS_MODULE CMTS Module (Slot \,\%i)} : PASSED \,\#endif \,/^* \, CMTS_SUPPORT \,*/$

 $\%\,DDT\text{-I-CMTS_PCI9080_REG}\,(Slot\,\%i)\text{: PCI-9080 Register Test: PASSED}$

 $\% \, DDT\text{-}I\text{-}CMTS_PORT_STATUS \, (Slot \, \%i, HDLC \, Port \, \%i) : PASSED \, \#end if \, /* \, CMTS_SUPPORT \, */ \, PASSED \, */ \,$

%DDT-I-CMTS_SDRAM_A_D_BUS (Slot %i) : CMTS SDRAM Address and Data Buses Test : PASSED

%DDT-I-CMTS_SDRAM_MARCH_C (Slot %i): CMTS SDRAM MarchC Memory Test: PASSED

%DDT-I-CMTS_SEMAPHORE (Slot %i): CMTS Semaphore Test: PASSED

%DDT-I-CMTS_SHMEM (Slot %i): Shared Memory Test: PASSED

%DDT-I-CPU_MOD_NOEXTFLASH CPU Module: No External Flash to test

%DDT-I-CPU_MOD_NOEXTFLASH CPU Module: No External Flash to test

 $\%\,DDT\text{-I-CPU_MOD_SYSREG}\,\,CPU\,\,Module\,\,FPGA\,\,Test;\,\,PASSED$

 $\% DDT\text{-}I\text{-}CPU_MOD_SYSREG_INT_TIMEOUT \ CPU \ Module \ Sysreg \ Interrupt \ Time-out$

%DDT-I-CPU_MODULE CPU Module: PASSED

%DDT-I-DEAD_PORT Dead Port: (Slot %i, Port %i) (No Further Testing of this port)

%DDT-I-DEBUG_TEST Debug Test: PASSED

%DDT-I-DIAG_BEGIN Running system diagnostics...this may take a few moments

 $\%DDT\text{-}I\text{-}DIAG_BEGIN_TIME$ Begin Time : %s

%DDT-I-DIAG_END Done with system diagnostics

%DDT-I-DIAG_END_TIME End Time: %s

%DDT-I-DIAG_ID My boot prom MAC address (ethaddr): %s {CPU in Slot %i}

 $\%DDT\text{-I-DIAG_ID2} \ CPU \ Module \ Type: \%s \ (Rev \ \%s) \ ; CPU \ freq = \%s; CPU \ Board \ freq = \%s$

%DDT-I-DIAG_ID3 System Type : %s (Rev %s)

%DDT-I-DIAG_LOOP_INFO %s: %i

%DDT-I-DMAC_EXT_LOOPBACK (Slot %i, Port %i): DMAC EXT Loopback: PASSED

%DDT-I-DMAC_MAC_LOOPBACK (Slot %i, Port %i): DMAC MAC Loopback: PASSED

%DDT-I-DMAC_MEM_TEST (Slot %i, Port %i): DMAC Memory Test: PASSED

%DDT-I-DMAC_PHY_LOOPBACK (Slot %i, Port %i): DMAC PHY Loopback: PASSED

%DDT-I-DMAC_STRIP_LOOPBACK (Slot %i, Port %i): DMAC Stripping Loopback: PASSED

%DDT-I-DMAC_STRIP_LUBACK (Slot %i, Port %i): DMAC STRIP Luback: PASSED

%DDT-I-DMAC_TEST (Slot %i, Port %i): DMAC Test: PASSED

%DDT-I-ELITE_MODULE ELITE Module (Slot %i): PASSED

%DDT-I-FDDI_CAMEL_BIST (Slot %i, Port %i) : FDDI CAMEL BiST: DONE

%DDT-I-FDDI_CAMEL_CAM (Slot %i, Port %i): FDDI CAMEL CAM Test: DONE

%DDT-I-FDDI_CAMEL_CSR (Slot %i, Port %i) : FDDI CAMEL CSR Test : DONE

%DDT-I-FDDI_CAMEL_UNIQUE_ADDR (Slot %i, Port %i): FDDI CAMEL unique Addressability Test: DONE

 $\%DDT\text{-}I\text{-}FDDI_CPU_TESTS\ FDDI\ PROM\text{-}Based\ Tests\ (Slot\ \%i): PASSED$

 $\%DDT\text{-}I\text{-}FDDI_DAS_A_CDC_LOOPBACK (Slot \ \%i, Port \ \%i): FDDI \ ELM \ A \ CDC \ Lpbk: DONE$

%DDT-I-FDDI_DAS_A_EB_LOC_LOOPBACK (Slot %i, Port %i) : FDDI ELM A EBUFF Lpbk: DONE

%DDT-I-FDDI_DAS_A_EXTERNAL_LOOPBACK (Slot %i, Port %i) : FDDI ELM A Ext Lpbk: DONE

%DDT-I-FDDI_DAS_A_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM A LM Local Lpbk: DONE

%DDT-I-FDDI_DAS_A_SC_BYPASS_LOOPBACK (Slot %i, Port %i): FDDI ELM A SC Bypass Lpbk: DONE

 $\% \, DDT\text{-}I\text{-}FDDI_DAS_B_CAM_LOOPBACK \, (Slot \, \%i, \, Port \, \%i): FDDI \, CAM \, Lpbk: \, DONE$

 $\% DDT\text{-}I\text{-}FDDI_DAS_B_CDC_LOOPBACK (Slot \ \%i, Port \ \%i): FDDI \ ELM \ B \ CDC \ Lpbk: DONE \ A \ CDC \$

 $\% DDT\text{-}I\text{-}FDDI_DAS_B_EB_LOC_LOOPBACK (Slot \ \%i, Port \ \%i): FDDI \ ELM \ B \ EBUFF \ Lpbk: DONE$

%DDT-I-FDDI_DAS_B_EXTERNAL_LOOPBACK (Slot %i, Port %i) : FDDI ELM B Ext Lpbk: DONE

%DDT-I-FDDI_DAS_B_LOC_LOOPBACK (Slot %i, Port %i): FDDI ELM B LM Local Lpbk: DONE

%DDT-I-FDDI_DAS_B_SC_BYPASS_LOOPBACK (Slot %i, Port %i): FDDI ELM B SC Bypass Lpbk: DONE

%DDT-I-FDDI_ELM_BIST (Slot %i, Port %i) : FDDI ELM BiST: DONE

 $\%\,DDT\text{-I-FDDI_ELM_CSR}$ (Slot $\%\,i,$ Port $\%\,i)$: FDDI ELM CSR Test: DONE

%DDT-I-FDDI_ELM_UNIQUE_ADDR (Slot %i, Port %i): FDDI ELM Unique Addressability Test: DONE

%DDT-I-FDDI_MODULE FDDI Module (Slot %i): PASSED

%DDT-I-FDDI_PHY_ELM_LINE_STATES (Slot %i, Port %i): FDDI ELM A Line States: DONE

%DDT-I-FDDI_PORT_STATUS (Slot %i, HDLC Port %i): PASSED

%DDT-I-FDDI_SHARED_BUS (Slot %i): Expected greater than 5000; Got %i: PASSED

%DDT-I-FE_MODULE FE Module (Slot %i): PASSED

%DDT-I-GE_MODULE GE Module (Slot %i): PASSED

%DDT-I-GEN %s

 $\% DDT\text{-}I\text{-}GMAC_CASCADE_LOOPBACK (Slot~\%i,~Port~\%i): GMAC~Cascade~Loopback: PASSED~CASCADE_LOOPBACK (Slot~\%i,~Port~\%i): GMAC~CASCADE_LOOPBACK (Slot~\%i,~Port~\%i):$

%DDT-I-GMAC_EXT_LOOPBACK (Slot %i, Port %i): GMAC EXT Loopback: PASSED

%DDT-I-GMAC_INT_LOOPBACK (Slot %i, Port %i): GMAC Internal Loopback: PASSED

%DDT-I-GMAC_MAC_LOOPBACK (Slot %i, Port %i): GMAC MAC Loopback: PASSED

%DDT-I-GMAC_MEM_TEST (Slot %i, Port %i): GMAC Memory Test: PASSED

%DDT-I-GMAC_PHY_LOOPBACK (Slot %i, Port %i): GMAC PHY Loopback: PASSED

%DDT-I-GMAC_STRIP_LOOPBACK (Slot %i, Port %i): GMAC Stripping Loopback: PASSED

%DDT-I-GMAC_TEST (Slot %i, Port %i) : GMAC Test : PASSED

%DDT-I-IPP_MEM_TEST (Slot %i): IPP Memory Test: PASSED

%DDT-I-IPP_TEST (Slot %i): IPP Test: PASSED

%DDT-I-MAX_ERRORS Max Errors Reached; Suppressing further errors for this test

%DDT-I-MEM_INFO %s: %s

%DDT-I-MEM_MAX_ERRORS Max Errors Reached; Suppressing further errors for this test

%DDT-I-MEM_TEST %s: %s: %s

%DDT-I-NIA_LOOPBACK NIA Loopback Test: PASSED

%DDT-I-NIA_MEM_BUFFER NIA Buffer Memory Test: PASSED

%DDT-I-NIA_MEM_CTL_PRI_QUEUE_TEST NIA Control Priority Queue Test: PASSED

 $\% \, DDT\text{-}I\text{-}NIA_MEM_FREE_PRI_QUEUE_TEST \, NIA \, Free \, Priority \, Queue \, Test: \, PASSED$

%DDT-I-NIA_MEM_HI_PRI_QUEUE_TEST NIA High Priority Queue Test: PASSED

 $\% DDT\text{-}I\text{-}NIA_MEM_LOW_PRI_QUEUE_TEST\ NIA\ Low\ Priority\ Queue\ Test:\ PASSED$

%DDT-I-NIA_MEM_MED_PRI_QUEUE_TEST NIA Medium Priority Queue Test: PASSED

%DDT-I-NIA_MEM_TEST NIA Memory Test: PASSED

%DDT-I-NIA_TEST NIA Test: PASSED

 $\% DDT\text{-}I\text{-}NIA_XBAR_LOOPBACK\ NIA\text{-}XBAR\ Loopback\ Test:\ PASSED$

%DDT-I-OCMAC_EXT_LOOPBACK (Slot %i, Port %s): OCMAC EXT Loopback: PASSED

 $\% DDT\text{-I-OCMAC_INT_LOOPBACK} \ (Slot\ \%i, Port\ \%s): OCMAC\ Internal\ Loopback: PASSED$

%DDT-I-OCMAC_MAC_LOOPBACK (Slot %i, Port %s): OCMAC MAC Loopback: PASSED

%DDT-I-OCMAC_MEM_TEST (Slot %i, Port %i): OCMAC Memory Test: PASSED

%DDT-I-OCMAC_PHY_LOOPBACK (Slot %i, Port %s): OCMAC PHY Loopback: PASSED

%DDT-I-OCMAC_STRIP_LOOPBACK (Slot %i, Port %i): OCMAC Stripping Loopback: PASSED

%DDT-I-OCMAC_TEST (Slot %i, Port %i): OCMAC Test: PASSED

%DDT-I-OPP_MEM_TEST (Slot %i) : OPP Memory Test : PASSED

%DDT-I-OPP_TEST (Slot %i): OPP Test: PASSED

%DDT-I-PACKET_INFO Type: %s (Slot %i, Port %i) {Pri: %s, Size: %i, Seq: %s}

%DDT-I-PORT_STATUS (Slot %i, Port %i): PASSED

%DDT-I-POS_MICRO_TEST (Slot %i): POS Microcontroller Test: PASSED

%DDT-I-QMAC_EXT_LOOPBACK (Slot %i, Port %2i) : QMAC EXT Loopback : PASSED

%DDT-I-QMAC_MAC_LOOPBACK (Slot %i, Port %2i): QMAC MAC Loopback: PASSED

%DDT-I-QMAC_MEM_TEST (Slot %i, Port %2i): QMAC Memory Test: PASSED

 $\% DDT\text{-}I\text{-}QMAC_PHY_LOOPBACK (Slot \%i, Port \%2i): QMAC PHY Loopback: PASSED$

 $\% DDT\text{-}I\text{-}QMAC_STRIP_LOOPBACK (Slot~\%i, Port~\%2i): QMAC~Stripping~Loopback: PASSED$

%DDT-I-QMAC_STRIP_LUBACK (Slot %i, Port %2i) : QMAC STRIP Luback : PASSED

%DDT-I-QMAC_TEST (Slot %i, Port %2i) : QMAC Test : PASSED

 $\%DDT\text{-}I\text{-}SGE_MODULE \ S\text{-}GE \ Module \ (Slot \ \%i): PASSED$

%DDT-I-SIPP_MEM_TEST (Slot %i): SIPP Memory Test: PASSED

%DDT-I-SIPP_TEST (Slot %i) : SIPP Test : PASSED

%DDT-I-SNAKE_LOOPBACK %s Cascade Loopback: PASSED

%DDT-I-SNAKE_MODULE Cascade Loopback: PASSED

 $\%DDT\text{-}I\text{-}SO_MODULE\ SO\ Module\ (Slot\ \%i): PASSED$

 $\%DDT\text{-}I\text{-}SOPP_MEM_TEST\ (Slot\ \%i): SOPP\ Memory\ Test: PASSED$

 $\%DDT\text{-}I\text{-}SOPP_TEST\ (Slot\ \%i):SOPP\ Test:PASSED$

%DDT-I-SUNI_CSR_TEST (Slot %i, Port %i): Mod-Phy SUNI CSR Test: PASSED

%DDT-I-SXOB_CNTR_TEST (Slot %i): SXOB Counters Test: PASSED

%DDT-I-SXOB_MEM_TEST (Slot %i) : SXOB Memory Test : PASSED

%DDT-I-SXOB_PKTMEM_TEST (Slot %i) : SXOB Packet Memory Test : PASSED

 $\% DDT\text{-}I\text{-}SXOB_TBLMEM_TEST \ (Slot \ \%i): SXOB \ Table \ Memory \ Test: PASSED$

 $\%DDT\text{-}I\text{-}SXOB_TEST\ (Slot\ \%i):SXOB\ Test:PASSED$

%DDT-I-TSHP_CSR_TEST (Slot %i, Port %i): ToolShop CSR Test: PASSED

%DDT-I-TSHP_END_TEST (Slot %i, Port %i): ToolShop En-Decap Memory Test: PASSED

%DDT-I-TSHP_SAR_TEST (Slot %i, Port %i): ToolShop SAR Buff Memory Test: PASSED

%DDT-I-TSHP_TEST (Slot %i, Port %i) : ToolShop Test : PASSED

%DDT-I-WAN_CPU_TESTS WAN PROM-Based Tests (Slot %i): PASSED

%DDT-I-WAN_DSU_LB (Slot %i): DSU Loopback Test: PASSED

%DDT-I-WAN_ETHER_REG (Slot %i): WAN Ethernet Controller Registers Test: PASSED

%DDT-I-WAN_EXT_LB (Slot %i): WAN Ethernet XBAR Loopback: PASSED

%DDT-I-WAN_GALILEO_REG_TEST (Slot %i): WAN Galileo Registers Test: PASSED

%DDT-I-WAN_GALILEO_TIMER_TEST (Slot %i): WAN Galileo Timer Interrupt Test: PASSED

%DDT-I-WAN_HDLC_EXT_LB (Slot %i): HDLC External Loopback: PASSED

%DDT-I-WAN_HDLC_INT_LB (Slot %i): HDLC Internal Loopback: PASSED

%DDT-I-WAN_HDLC_LINK_LED (Slot %i): HDLC Link LEDs Test: PASSED

%DDT-I-WAN_HDLC_REG (Slot %i): WAN HDLC Registers Test: PASSED

 $\%\,DDT\text{-I-WAN_HIFN_7711}$ (Slot $\%\,i):HIFN\,7711$ Test: PASSED

%DDT-I-WAN_HIFN_9711 (Slot %i): HIFN 9711 Test: PASSED

%DDT-I-WAN_HIFN_MEM (Slot %i): HIFN Context Memory Test: PASSED

%DDT-I-WAN_L2_CACHE (Slot %i): WAN L2 Cache Test: PASSED

%DDT-I-WAN_MAC_LB (Slot %i) : WAN Ethernet MAC Loopback : PASSED

%DDT-I-WAN_MODULE WAN Module (Slot %i) : PASSED #ifdef CMTS_SUPPORT

%DDT-I-WAN_PORT_STATUS (Slot %i, HDLC Port %i) : PASSED #ifdef CMTS_SUPPORT

 $\%DDT\text{-}I\text{-}WAN_SDRAM_A_D_BUS \ (Slot \ \%i): WAN \ SDRAM \ Address \ and \ Data \ Buses \ Test: PASSED$

%DDT-I-WAN_SDRAM_MARCH_C (Slot %i) : WAN SDRAM MarchC Memory Test : PASSED

%DDT-I-WAN_SHMEM (Slot %i) : Shared Memory Test: PASSED

%DDT-I-XBAR_ACTIVE_FABRIC Setting Active Fabric To %i

%DDT-I-XBAR_CHAN Cross-Bar : Channel-to-Channel Test : PASSED

%DDT-I-WAN_SEMAPHORE (Slot %i): WAN Semaphore Test: PASSED

%DDT-I-XBAR_FABRIC Cross-Bar Fabric %i : PASSED

%DDT-I-XBAR_LINK Cross-Bar: (Slot %i, Port %i) -> (Slot %i, Port %i) : PASSED

 $\%DDT\text{-}I\text{-}XBAR_MODULE\ Cross\text{-}Bar\ on\ Back\text{-}Plane: PASSED$

%FDDI-E-MODULE_ERR Module %d - %s

%FDDI-I-FW_VER Module %d Firmware version %s

%GATED-E-AGGRALLOCLIST Mem allocation failed for an aggregate route.

%GATED-E-INVMASK Mask (%s) specified is invalid.

%HBT-F-TMRSTOPFAIL failed to stop timer '0x%x', error = %d

%HBT-W-HBTDISABLED Hbt is already disabled

%HBT-W-HBTENABLED Hbt is already enabled

%INTERFACE-E-BADELITESLOT The ARE blade in slot %i is either not currently active or not assigned to the correct ARE protocol. Please ensure that the blade is active or use the command 'are-blade set protocol ...' and try again.

%INTERFACE-E-CANNOTBRINGDOWN Interface 'lo0' can not be brought down

%INTERFACE-E-ELITEINFNOSUPPWAN %s interfaces do not support WAN ports

%INTERFACE-E-INVALIDIP The IP address %s is invalid.

%INTERFACE-E-IPXADDREXISTS The IPX address %s is already configured on interface %s.

%INTERFACE-E-NOELITEAVAIL %s interfaces require an ARE blade. If you have an ARE blade, please ensure that it is active.

%INTERFACE-E-NOELITESLOT Multiple ARE blades have been detected. You need to specify which ARE blade you want with the SLOT option.

%INTERFACE-I-DEFELITESLOT This interface will use the ARE blade in slot %i as a default

%INTERFACE-W-WAN_ADD_FAILED interface add failed on slot %d port %d

%IPC-E-BADGETOBJ Bad GET Object ID '%d'

%IPC-E-BADINFORMOBJ Bad INFORM Object ID '%d'

%IPC-E-BADOPC Bad IPC message opcode '%d'

%IPC-E-BADREPLYOBJ Bad REPLY Object ID '%d'

%IPC-E-BADSETOBJ Bad SET Object ID '%d'

%IPC-E-BADTRAPOBJ Bad TRAP Object ID '%d'

%IPC-E-CLOSEFAIL Failed to close IPC client on port '%d'

%IPC-E-FWDMSGFAIL Failed to forward msg with error '%d'

%IPC-E-FWDSAVEDMSGFAIL Failed to forward saved msg with error '%d'

%IPC-E-GETSAVEDMSGFAIL Failed to get saved msg with error '%d'

%IPC-E-LOGCHAN Logging message error: Bad channel '%d'

%IPC-E-LOGMALLOC Logging message error: Malloc failed

 $\%\,IPC\text{-E-LOGMOD}$ Logging message error: Bad module id '%d'

%IPC-E-MBOXFAIL Failed to access mailbox for channel '%d'

%IPC-E-MODFAILURE Too many remote module %d failures (%d times)... please reboot system

%IPC-E-OPENFAIL Failed to open IPC client on port '%d'

%IPC-E-RCVFAIL IPC receive error '%d'

%IPCERR-E-BADGETNXTOBJ Bad GET_NEXT Object ID '%d'

%IPCERR-E-BADGETOBJ Bad GET Object ID '%d'

%IPCERR-E-BADINFOBJ Bad INFORM Object ID '%d'

%IPCERR-E-BADOPC Bad IPC message opcode '%d'

%IPCERR-E-BADPORT Bad IPC port '%d'

%IPCERR-E-BADREPLYOBJ Bad REPLY Object ID '%d'

%IPCERR-E-BADSETOBJ Bad SET Object ID '%d'

%IPCERR-E-EEPTFAIL failed to modify extended exit port

%IPCERR-E-FWDRCVFAIL IPC received failed in the forwarding task - %s

%IPCERR-F-MALLOCFAIL failed to allocate memory for message

%IPC-E-SAVEMSGFAIL Failed to save msg in ipc queue with error '%d'

%IPC-E-TMRERR IPC timer error '%d'

%IPC-E-WANFAIL Failed to send WAN activation to module '%d' - error=%d

%IPC-F-EVWAIT event wait failed with error '%d'

%IPC-F-QCREATFAIL saved msg queue creation failed with error '%d'

%IP-E-FORWMODESET Port %s is already set to %s. Please negate this before proceeding.

%IP-E-NOMODULENUM Invalid module number -- %d

%IP-E-UNKNOWN_MODE Unknown mode set for deep hashing -- %s

 $\% IP\text{-I-DISDSTUNREACH ICMP}\ destination\ unreachable\ messages\ disabled.$

%IP-I-DISECHORPLY ICMP echo reply messages disabled.

%IP-I-DISTIMSTMPRPLY ICMP time stamp reply messages disabled.

%IP-I-DISTIMXCEEDED ICMP timexceeded messages disabled.

% IP-I-ENDSTUNREACH ICMP destination unreachable messages enabled.

%IP-I-ENECHORPLY ICMP echo reply messages enabled.

%IP-I-ENTIMSTMPRPLY ICMP time stamp reply messages enabled.

% IP-I-ENTIMXCEEDED ICMP timexceeded messages enabled.

%IPRED-I-CONFIG_UPDATE Updated config for virtual router %d on interface %s (%s)

%IPRED-W-IF_POLL interface polling timer expired - no interfaces down

 $L2TM-E-APS_CONFLICT$ failed configuring APS on s and s and s

%L2TM-E-FLOW_STP Cannot enable flow-bridging-mode and force-STP-state simultaneously (%s).

 $\%L2TM\text{-}E\text{-}INVLDMACENTRY\ Invalid\ MAC\ Table\ Entry}(\%x)\ \text{-}\ source\ and\ dest\ ptr\ NULL}$

%L2TM-E-INVLDNAME %s

%L2TM-E-NOADD %s

%L2TM-I-MAP_APPLIED %s

%L2TM-I-MAP_CREATED %s

%L2TM-I-MAP_NOAPPLY %s

%L2TM-I-MAP_PRIO_OFF %s

%L2TM-I-MAP_PRIO_ON %s

%L2TM-I-MAP_REMOVED %s

%LOADBAL-E-AGINGALRSET %s

%LOADBAL-E-CMDDEPRECATED %s

%LOADBAL-E-MASKALRSET %s

%LOADBAL-E-REMAGINGTIMER %s

%LOADBAL-E-REMCLISUBNET %s

%LOADBAL-I-SUBNETREM %s

%LOADBAL-I-SUBNETSET %s

%LOADBAL-W-SUBNETFORWMODLIM~%s

%MPS-E-BUF_OVERFLOW route delete buffer overflowed

%MPS-E-BUF_OVERFLOWED MPS thread closing connected sockets, see previous BUF_OVERFLOW error for details

%MPS-E-INET_ADDR_LEN received inet address length %d, should have been %d

 $\mbox{\ensuremath{\mbox{MPS-E-NH_IPV4_LEN}}}$ received NH IPV4 length $\mbox{\ensuremath{\mbox{\mbox{\mbox{M}}\mbox{$\mbox{$\mbox{$\mbox{$}\mbox{$}\mbox{$\mbox{$}$

%MPS-E-NH_IPX_LEN received NH IPX length %d, should have been %d

%MPS-E-NO_IPX_ADDR no IPX interface configured

%MPS-E-PROTO_VERSION request contains unsupported version %d

%MPS-E-RECV_CMD request contains unsupported command %d

%MPS-E-RECV_ERR connected receive socket errored with errno=%d

%MPS-E-SEND_LEN %s() length to send=%d, sent length=%d, errno=%d

%MPS-E-UNSUP_PROTO request contains unsupported protocol %d

%MPS-F-NO_TIMER NUE_Create_Simple_Timer failed, sts=%d

%MPS-F-START_TIMER NUE_Start_Timer() return error %d

 $\% MPS\text{-}F\text{-}STOP_TIMER\ NUE_Stop_Timer()\ return\ error\ \% \, d$

%MPS-F-UNKNOWN_EVENT got unknown event 0x%X

%MPS-F-WAIT_FAIL NUE_Wait_For_TEG_Events() return error %d

%MPS-I-ACCEPTED_RX accepted rx cnx from MPS RC

%MPS-I-ACCEPTED_TX accepted tx cnx from MPS RC

%MPS-I-C_SOCKS_ERR connected sockets error, closing them

 $\% MPS\text{-I-CONN_SUCCESS} \ connected \ sockets \ configured$

%MPS-I-IPX_ADDR replying with IPX net address %s

%MPS-I-NEW_RC_CONN received new MPS RC connection

%MPS-I-NO_ROUTE no route to %s exists, route lookup failing

%MPS-I-OTHER_EVENT got unexpected event 0x%X

%MPS-I-READY MPS RS ready to process requests from MPS RC

%MPS-I-RECV_ZERO connected rx socket got recv() of 0 bytes

%MPS-I-RS_STOPPED no longer processing requests

%MPS-I-RS_UPDATES sending %d route updates

%MPS-I-RX_ARRIVED listening rx socket event occurred

%MPS-I-RX_ON_TX receive event on connected tx socket

%MPS-I-TX_ARRIVED listening tx socket event occurred

%MPS-W-BAD_MAC_LEN next hop %s has sdl with mac len %d, route lookup failing

%MPS-W-NO_MAC next hop %s has no sdl, route lookup failing

%MPS-W-NO_NEXT_HOP no next hop to %s exists, route lookup failing

%NAT-E-IF %s

%NAT-E-IFALSET %s

%NAT-E-IFPRT Interface %s is being set as NAT %s, port %s of slot %d is set to %s which not allowed with %s

%NAT-E-MALLOC Malloc error at %s

%NAT-E-STPRTMIS %s

%NAT-I-DNSTO %s

%NAT-I-IFCL %s

%NAT-I-INACTV NAT is currently inactive

% NAT-I-SECP % s

%NETSTAT-E-FAMILY Unknown address family: %s

%NETSTAT-E-NOSTATS No statistics are available for protocol: %s

%NETSTAT-E-PROTO Unknown or uninstrumented protocol: %s

 $\% OSPF-E-NOSETPOLLINT\ Polling\ Interval\ can\ only\ be\ set\ for\ Non-Broadcast\ or\ Point\ to\ Multi\ Point\ interfaces.$

%OSPF-I-ROUTERIDFND OSPF Router Id found: %s

%OSPF-W-INTFDOWN Interface %s marked down.

%PBR-E-ENIF Policy '%s' cannot be applied to the management interface

%PBR-E-LOIF Policy '%s' cannot be applied to the loopback interface

%POLICY-E-ASPATHALLOCFAIL Malloc failed for aspath.

%POLICY-E-ASPATHILLEGAL Aspath %s syntax is illegal. // // Errors related to Export Destinations //

%POLICY-E-ASPATHNULL AS Path is null.

%POLICY-E-EXPPLCYDSTNOTFOUND Export policy with destination %s not found.

%POLICY-E-EXPPLCYFLTNOTFOUND Export policy (with destination %s source %s filter %s) not found.

%POLICY-E-EXPPLCYSRCNOTFOUND Export policy with destination %s source %s not found.

%POLICY-E-IMPPLCYFLTNOTFOUND Import policy (with source %s filter %s) not found.

%POLICY-E-IMPPLCYNOTFOUND Import policy with source %s not found.

%POLICY-E-INVEXDSTIDX Invalid Export destination.

%POLICY-E-INVEXPSRCIDX Invalid Export source.

%POLICY-E-INVIMPSRCIDX Invalid Export source.

%PPP-E-FORCEBGDENCAPFAILED Failed to set PPP bridged encapsulation on port %s

%PPP-I-FORCEBGDENCAP Bridged PPP encapsulation has been forced on port %s

%PPP-I-REVERTENCAP PPP encapsulation on port %s has been reverted from forced-bridged-encapsulation to automatic selection of PPP encapsulation

%PROFILE-E-TASK_ADDED Delete all the profiling tasks before changing mode

 $\label{eq:profile} \mbox{\ensuremath{\$PROFILE-F-TIMER}} \ \mbox{Timer} \ \mbox{\ensuremath{$Creation$}} \ \mbox{\ensuremath{$Error.$}}$

%RELAY-I-DEBUG Relay agent debugging turned $\%\,s$

 $\%RL\mbox{-E-ALREADY_APPLIED_PORT}$ This policy is already applied to the specified port

%RL-E-ALREADYINAGGRMODE Modules '%s' are already in 'Aggregate' mode. Ignoring all.

%RL-E-NOTALLINFLOWMODE All the modules are not in 'Per Flow' Rate Limiting mode. You can not apply this policy to all Interfaces

%RL-I-CHANGEDTOFLOW Rate limiting mode changed to 'Per Flow'(default mode) for modules '%s'

 $\% RL\text{-I-CHANGEDTOLINK Rate limiting mode changed to 'Aggregate' for modules '\%s' and the state of the stat$

%RL-I-DEF_CREATED Default policy '%s' has been successfully created

%RL-I-DEF_DELETED Default policy '%s' has been successfully deleted

%RL-I-PORTLEVELDISABLED Input Port Level Rate Limiting disabled on modules '%s'

%RL-I-PORTLEVELENABLED Input Port Level Rate Limiting enabled on modules '%s'

%RMON-E-ALIGN Request for unaligned memory of size %d bytes rounded up.

 $\%RMON\mbox{-E-FIXEDALLOC}$ No memory slots left for fixed allocation of %d bytes.

%RMON-E-MEMVALUE Memory for %s is limited to %dMB.

%RMON-E-VARALLOC No memory slots left for variable allocation of %d bytes.

%RMON-W-INVALID_PORT Cannot add %s index %d row - port %u is invalid.

%SERIAL-E-CLI_LMI_SET_FAILED cli: Cannot set the same LMI parameter in multiple commands

%SERIAL-E-CLI_WRONG_OBJECT_ID cli: Got cli msg with unrecognized object id

%SERIAL-E-CLI_WRONG_OPCODE cli: Got cli msg with unrecognized opcode

%SERIAL-E-DMAC_RX_PKT WAN Simulator received a packet from a DMAC

%SERIAL-E-GMAC_RX_PKT WAN Simulator received a packet from a GMAC

%SERIAL-E-GMAC_RX_PKT WAN Simulator received a packet from a GMAC

%SERIAL-E-H7711_BELOW_MIN_REV Compression/Encryption chip is below minimum revision (value = 0x%x)

%SERIAL-E-H7711_NEED_UPGRADE serial card should be upgraded if compression/encryption needed

%SERIAL-E-H9711_BELOW_MIN_REV Compression chip is below minimum revision (value = 0x%x)

%SERIAL-E-H9711_NEED_UPGRADE serial card should be upgraded if compression needed

 $\% SERIAL-E-INIT_LARGE_PB_ERROR_NOMEM\ No\ memory\ to\ initialize\ large\ packet\ buffer\ pool$

%SERIAL-E-INIT_PB_PTR_ERROR Bad pointers for packet calculation

%SERIAL-E-INIT_PB_SIZE_NOT_ABOVE_MIN Size of packet buffers fails to meet minimum requirements

 $\% SERIAL-E-INIT_SMALL_PB_ERROR_NOMEM\ No\ memory\ to\ initialize\ small\ packet\ buffer\ pool$

%SERIAL-E-PPP_MRU ppp frame length is greater than the MRU on port %d

%SERIAL-F-PB_ERROR_INVALID_PTR pbfree: Null Packet Buffer Pointer

%SERIAL-I-HIFN %s

%SERIAL-I-PORT_CABLE_DOWN Port %i : No Connection or Peer Unavailable

%SERIAL-I-PORT_CABLE_UP Port %i : Ready

 $\% SERIAL\text{-}I\text{-}WAN_PKT~\%s$

 $\% SERIAL\text{-W-CTL_ERROR_NOMEM control: } Cannot \ allocate \ memory \ for \ message$

%SERIAL-W-CTL_ERROR_QUEUE control: Cannot create nucleus queue

%SERIAL-W-CTL_ERROR_QUEUE_SEND control: Cannot send message to control task

%SERIAL-W-CTL_ERROR_TIMER control: Cannot create nucleus timer

%SERIAL-W-EGRESS_MLP_PID egress: invalid PPP proto id(%x) on port %d in mp.%x

%SERIAL-W-EGRESS_PORT_N_EXISTING egress: non-existing wan port %d

%SERIAL-W-EGRESS_PPP_FORMAT egress: wrong PDU format on port %d

%SERIAL-W-EGRESS_WAN_PROTO egress: invalid WAN proto on port %d

%SERIAL-W-EPT_ERROR_NOENTRY eptdelete: no such entry

 $\% SERIAL\text{-}W\text{-}EPT_ERROR_NOMEM \ eptadd: \ malloc \ failed$

%SERIAL-W-FRSHIM_ERROR_CHANINIT fr shim: FRCC_ChanInit() failed

%SERIAL-W-FRSHIM_ERROR_DCPADD fr shim: DCP_Add() failed - code %d

%SERIAL-W-FRSHIM_ERROR_DCPPRIM fr shim: Unhandled primitive from DCP, port %d, vc %d, primitive %d

%SERIAL-W-FRSHIM_ERROR_DCPREQ fr shim: DCP Request() failed - code 0x%x

%SERIAL-W-FRSHIM_ERROR_FRCCREQ fr shim: FRCC_Req() failed

%SERIAL-W-FRSHIM_ERROR_NO_UNASSIGNED_IDS fr shim: Cannot get an unassigned call id

%SERIAL-W-FRSHIM_ERROR_NOBUF fr shim: Cannot get buffer

%SERIAL-W-FRSHIM_ERROR_NOIDS fr shim: Cannot generate a call id

%SERIAL-W-FRSHIM_ERROR_NOLMI fr shim: LMI type unknown

%SERIAL-W-FRSHIM_ERROR_NOMEM fr shim: Cannot allocate free info

%SERIAL-W-FRSHIM_ERROR_NOTFR fr shim: port is not frame relay

%SERIAL-W-FRSHIM_ERROR_PVCINIT fr shim: FRCC_PvcInit() failed

%SERIAL-W-FRSHIM_ERROR_PVCTERM fr shim: FRCC_PvcTerm() failed

%SERIAL-W-FRSHIM_ERROR_SMEADDCEI fr shim: SmeAddCei() failed - code %d

%SERIAL-W-FRSHIM_ERROR_SMEADDCFG fr shim: SmeAddCfg() failed - code %d

 $\% SERIAL-W-FRSHIM_ERROR_SMEADDSERVICE \ fr \ shim: SmeAddService() \ failed - code \ \% d$

%SERIAL-W-FRSHIM_ERROR_SMEDLCREATELINKCEI fr shim: SME_DlCreateLinkCei() failed - code %d

%SERIAL-W-FRSHIM_ERROR_SMEGETADDR fr shim: SmeGetAddr() failed - code %d

%SERIAL-W-FRSHIM_ERROR_SMEGETCEI fr shim: SME_FrGetSigCei() failed - code %d

%SERIAL-W-FRSHIM_ERROR_SMEGETCFG fr shim: SmeGetCfg() failed - code %d

 $\% SERIAL\text{-}W\text{-}FRSHIM_ERROR_TLIBINIT \ fr \ shim: tlib_init() \ failed$

%SERIAL-W-FRSHIM_ERROR_UNSUPPORTED_LMI fr shim: LMI type is unsupported

%SERIAL-W-FRSHIM_INVALID_PORT fr shim: Invalid port - %d

%SERIAL-W-FRSHIM_INVALID_VC fr shim: Invalid VC - %d

%SERIAL-W-HIFN_ERROR_NOMEM hifn_compress: Can not allocate buffer

%SERIAL-W-INGRESS_ENCAPS ingress_forward: Could not encapsulate (port %d)

%SERIAL-W-INGRESS_ERROR_COMPRESS hifn_compress: Failed to compress packet

 $\% SERIAL\text{-}W\text{-}INGRESS_ERROR_ENCAPS ingress_forward: Could not encapsulate type \,\%\,d$

%SERIAL-W-INGRESS_ERROR_ENCAPS_LEN ingress_forward: Invalid encapsulation length %d

%SERIAL-W-INGRESS_ERROR_ENCRYPT hifn_encrypt: Failed to encrypt packet

%SERIAL-W-INGRESS_ERROR_NOMEM ingress_forward: Can not allocate buffer

%SERIAL-W-INGRESS_ERROR_VC ingress_forward: VC does not exist

 $\% SERIAL\text{-}W\text{-}IPARP_ERROR_DECSEND \ iparpreply: dec_send() \ failed$

%SERIAL-W-IPARP_ERROR_NOMEM iparpreply: Can not allocate buffer

%SERIAL-W-MAC_ERROR_NOENTRY macdelete: no such entry

%SERIAL-W-MAC_ERROR_NOMEM macadd: malloc failed

%SERIAL-W-PB_ERROR_INVALID_TYPE pballoc: Invalid Packet Buffer Type

%SERIAL-W-PPPSHIM_ERROR_NOMEM ppp shim: Cannot allocate shim info memory

%SIO-F-EVGBAD unexpected events seen, expected 0x%x, seen 0x%x

%SIO-F-EVGCREAT failed to create driver event group, sts=0x%x

%SIO-F-EVGGET failed to get events, sts=0x%x

%SIO-F-EVGSET failed to set events, sts=0x%x

%SIO-F-HISRFAIL failed to create driver HISR, sts=0x%x

%SIO-F-LISRFAIL failed to register driver LISR, sts=0x%x

%SIO-F-NOBUFMEM not enough memory to allocate typeahead buffer

%SIO-F-NOSTKMEM not enough memory to allocate stack

%SME-E-BADTYPE Attempt to log with bad type '%d'

%SME-E-SMELOG %s

%SME-F-SMELOG %s

%SME-I-SMELOG %s

%SME-W-SMELOG %s

%SNMP-E-BAD_IP_ADDR IP Interface %s only has a loopback address, interface can not be used

%SNMP-E-BAD_IP_IF Command requires valid IP Interface name or valid IP address %s

 $\%SNMP\text{-}E\text{-}BIND_FAILED$ Bind IP Address %s failed, using default. Reason: %s

%SNMP-E-INVALID_TARGET Address must be valid IPv4 unicast address. %s is not valid.

 $\%SNMP\text{-E-SEND_PDU}$ Send PDU to manager %s failed %s

%SNMP-E-STARTIMER Internal Error stop timer failed code %d

%SNMP-F-CREATE_Q failed creating queue %s (retCode %d)

%SNMP-I-RETRO_IFSPEED ifSpeed for IP Interfaces will use speed of first operational port

 $\%SNMP\text{-}I\text{-}TRAP_QUEUE_CLEARED}$ SNMP Trap queue was cleared of %d traps

%SNMP-W-NOBCASTNOTSET The No Broadcasts option could not be set on the SNMP socket

%SONET-E-INVALID_DEFINE_OBJECT SONET invalid object in CLI command

%STATIC-W-GWAYNOTREACH Gateway %s is not reachable.

%STATS-F-EVWAIT event wait failed with error '%d'

%STATS-F-TMRCREATFAIL timer creation failed with error '%d'

%STATS-F-TMRSTARTFAIL failed to start timer '0x%x', error '%d'

%STRNK-E-CANTTXMARKERRESPONSE Unable to transmit Marker response.

%STRNK-E-CMDPRESENT There is a CLI command already executed for this port, negate that first

%STRNK-E-LACPMCASTREG Cannot register LACP mcast address

%STRNK-E-NOMEMKYGRP Out of memory, cannot form key group.

%STRNK-E-NOMEMLACPDU Out of memory, unable to allocate memory for LACPdu

%STRNK-E-NOMEMLAG Out of memory, unable to allocate memory for LAG

%STRNK-E-NOMEMLAGID Out of memory, unable to allocate memory for LAG Id

%STRNK-E-NOMEMMARKERRESPONSE Out of memory, unable to allocate memory for marker response packet.

%STRNK-E-NOMEMPRT Out of memory, cannot add port to LAG.

%STRNK-E-NOTXLACPDU Cannot transmit LACPdu.

%STRNK-W-LACPANDNOACK If the protocol is 802.3 LACP, then no llap ack option is ignored.

%STRNK-W-PLAPDOWN Connection on port %s for %s broken -- %s

%SYS-E-2BIG %s: %s: arg list too long

%SYS-E-8021PCONFIGURED 802.1p mode is already configured on ports '%s'. Ignoring all

%SYS-E-8021PWAN 802.1p mode can not be configured for ports '%s'>

%SYS-E-ACCES %s: %s: permission denied

%SYS-E-ADDRINUSE %s: %s: address already in use

%SYS-E-ADDRNOTAVAIL %s: %s: can't assign requested address

%SYS-E-ADV %s: %s: advertise error

%SYS-E-AFNOSUPPORT %s: %s: address family not supported by

%SYS-E-AGAIN %s: %s: resource temporarily unavailable

%SYS-E-ALREADY %s: %s: operation already in progress

%SYS-E-ATMHARDWAREINIT The ATM linecard in slot %d failed module initialization.

%SYS-E-ATMHARDWARESIPPNOTOK The ATM linecard in slot %d has an unsupported SIPP revision %d.%d.

%SYS-E-ATMPORTDB Port at.%d.%d database error - memory heap low.

 $\% SYS\text{-}E\text{-}ATMPORTINSERTION \ Portinsert \ failed \ on \ Portlist \ at.\%d.\%d.$

%SYS-E-ATMPORTNOTMGMT Port at.%d.%d not answering management calls.

%SYS-E-ATMPORTPHYNOTPRESENT Port set failed on port at.%d.%d, PHY not present.

%SYS-E-ATMPORTPHYNOTSUPPORTED Port set failed on port at.%d.%d, PHY not supported. // Invalid Module errors

%SYS-E-AUTODSTTIMER Unable to %s auto dst timer; fail status is %d

%SYS-E-AUTOHASH_CHAN_FAIL Auto-hash not supported for this channel number -- %d <SWIZZLE_NOT_SUPPORTED> <0> <1> Swizzle not supported for this channel number -- %d // obsolete hardware errors

%SYS-E-AUTOHASH_TASK Creation of the auto-hash task failed during %s operation for channel number %d.

%SYS-E-BAD_SIPP_MEM Bad SIPP Memory at 0x%08lx on channel %d

%SYS-E-BAD_WAN_PORT_MEDIA_UPDATE WAN port media update message for unknown port: %d

%SYS-E-BADDATE Illegal date specified

%SYS-E-BADE %s: %s: invalid exchange

%SYS-E-BADF %s: %s: bad file number

%SYS-E-BADFD %s: %s: f.d. invalid for this operation

%SYS-E-BADMEMCFG Bad memory configuration detected at location 0x%08lx. Please contact Technical Support.

%SYS-E-BADMEMREAD memory read failed at location 0x%08lx

%SYS-E-BADMEMWRITE memory write failed at location 0x%08lx

%SYS-E-BADMSG %s: %s: trying to read unreadable message

%SYS-E-BADPKT bad system test packet received, etype 0x%x, cep 0x%x // wan cli errors

%SYS-E-BADR %s: %s: invalid request descriptor

%SYS-E-BADRQC %s: %s: invalid request code

%SYS-E-BADSLT %s: %s: invalid slot

%SYS-E-BADSRCIP No such interface address: %s

%SYS-E-BFONT %s: %s: bad font file fmt

%SYS-E-BITMAP_MISMATCH %s // module id errors

%SYS-E-BKPLANEFAILED '%s' module in slot '%s' has failed

%SYS-E-BUSY %s: %s: mount device busy

%SYS-E-CANCELED %s: %s: operation canceled

%SYS-E-CFGCPYFAIL copying only allowed from %s to %s

%SYS-E-CHILD %s: %s: no children

%SYS-E-CHRNG %s: %s: channel number out of range

%SYS-E-CLI_ENCRYPT_KEYS Invalid encryption key: Must be 16 digit hex string, e.g 0x0123456789abcdef

%SYS-E-CLI_ERROR_TIME_OUT cli command timed out on waiting for a response from wan card

%SYS-E-CLI_FR_VC_CREATE cli: vc %d.%d.%d doesn't exist, create a vc first by using FRAME_RELAY CREATE VC command

%SYS-E-CLI_FR_VC_REQD cli: This option requires vc number to be specified for frame relay port %d

%SYS-E-CLI_LMI_NO_VC_ALLOWED cli: Cannot specify vc - LMI parameters apply to all vc's on port

%SYS-E-CLI_NON_FR_PORT card %d port %d is not a frame relay port

%SYS-E-CLI_NON_MLP_CMD %s option cannot be applied to mlp bundles

%SYS-E-CLI_NON_PPP_PORT card %d port %d is not a PPP port

%SYS-E-CLI_NON_WAN_PORT Port %d is not a wan port

%SYS-E-CLI_PPP_SERVICE_REUSED service profile(%s) is being for PPP ports

%SYS-E-CLI_SERVICE_MLP_PORT port %s is a member of %s which has already been assigned service %s

%SYS-E-CLI_SERVICE_NOT_FOR_MP service %s cannot be applied to mlp bundles: parameter %s is not allowed

%SYS-E-CLI_SERVICE_NOT_FOR_PHYPORT service %s cannot be applied to physical ports in mlp bundles: parameter %s is not allowed

%SYS-E-CLI_SERVICE_PHY_PORT %s member port %s has already been assigned service %s

%SYS-E-CLI_SERVICE_PORT port %s has already been assigned service %s

%SYS-E-CLI_SERVICE_PROFILE_NON_EXISTING cli: Service profile: %s does not exist, please use frame-relay/ppp DEFINE SERVICE command first

%SYS-E-CLI_SERVICE_VC port %s vc %d has already been assigned service %s

%SYS-E-CMTS_CKSUM_ERROR %d: channel checksum error; kernel:%s file: %s #endif /* CMTS_SUPPORT */

%SYS-E-CMTS_SYNCH_ERROR Cannot synch with CMTS card in slot %s

%SYS-E-COMM %s: %s: communication error on send

%SYS-E-CONNABORTED %s: %s: software caused connection abort

%SYS-E-CONNRESET %s: %s: connection reset by peer

%SYS-E-DEADLK %s: %s: deadlock condition

%SYS-E-DEADLOCK %s: %s: file locking deadlock error

%SYS-E-DESTADDRREQ %s: %s: destination address required

 $\% SYS\text{-}E\text{-}DIAGFRMENABLE\ Diagnostics\ mode\ must\ be\ entered\ from\ enabled\ mode\ //\ NIA\ Errors$

%SYS-E-DOM %s: %s: math arg out of domain of func

%SYS-E-DQUOT %s: %s: disc quota exceeded

%SYS-E-DSTCONFLICT Conflict in the active config with a previous DST command

%SYS-E-DSTERROR Error - 'system set dst-%s' has been disabled; it must be negated and then re-entered into the active-config to make it work correctly again

%SYS-E-END_MODULE_CRASH System received above crash dump from module %d // Errors for the autohash task creation

 $\%SYS\text{-E-END_OF_LOG}$ %s: %s: returned end of log

%SYS-E-EXIST %s: %s: file exists

%SYS-E-EXTRADAYS Too many days assigned to at least one month

%SYS-E-FAULT %s: %s: bad address

%SYS-E-FBIG %s: %s: file too large

%SYS-E-FLASHREMOVED %s: %s: external FLASH card was removed: please reinsert

%SYS-E-GIANTIPCPKT packet on 'lo' interface too large, len = %d // ATM Dual Port 155Mbps System Errors.

%SYS-E-GROUP_DELETED %s: %s: event group deleted

%SYS-E-HOSTDOWN %s: %s: host is down

%SYS-E-HOSTUNREACH %s: %s: no route to host

%SYS-E-HOTSWAP_HSQFULL hotswap queue full, request for slot %d ignored, please try later

%SYS-E-HOTSWAP_INVALID slot %d is invalid on this system

%SYS-E-IDRM %s: %s: identifier removed

%SYS-E-ILSEQ %s: %s: illegal byte sequence

%SYS-E-IMAGE_EXISTS_BACKUP that image is already present on Backup CM.

%SYS-E-INPROGRESS %s: %s: operation now in progress

%SYS-E-INTR %s: %s: interrupted system call

%SYS-E-INVAL %s: %s: invalid argument

%SYS-E-INVALID_CHANNEL %s: %s: invalid channel

%SYS-E-INVALID_DELETE %s: %s: invalid delete

%SYS-E-INVALID_DRIVER %s: %s: invalid driver

 $\%SYS\text{-E-INVALID_ENABLE}\ \%s:\ \%s:\ invalid\ enable$

%SYS-E-INVALID_ENTRY %s: %s: invalid entry

%SYS-E-INVALID_EVFLG %s: %s: invalid event flag

%SYS-E-INVALID_FLASH %s: %s: invalid flash

%SYS-E-INVALID_FUNCTION %s: %s: invalid function

%SYS-E-INVALID_GROUP %s: %s: invalid group

%SYS-E-INVALID_HISR %s: %s: invalid ISR

%SYS-E-INVALID_MAILBOX %s: %s: invalid mailbox

%SYS-E-INVALID_MEMORY %s: %s: invalid memory

%SYS-E-INVALID_MESSAGE %s: %s: invalid operation

%SYS-E-INVALID_OPERATION %s: %s: invalid pipe

 $\% SYS\text{-}E\text{-}INVALID_PARAMETER \ \%s: \ \%s: invalid parameter$

 $\%SYS\text{-E-INVALID_PIPE}\ \%s:\ \%s:\ invalid\ pointer$

%SYS-E-INVALID_POINTER %s: %s: invalid pointer

%SYS-E-INVALID_POOL %s: %s: invalid pool

%SYS-E-INVALID_PREEMPT %s: %s: invalid preempt

%SYS-E-INVALID_PRIORITY %s: %s: invalid priority

%SYS-E-INVALID_QUEUE %s: %s: invalid queue

%SYS-E-INVALID_RESUME %s: %s: invalid resume

%SYS-E-INVALID_SEMAPHORE %s: %s: invalid semaphore

%SYS-E-INVALID_SIZE %s: %s: invalid size

%SYS-E-INVALID_START %s: %s: invalid start

%SYS-E-INVALID_SUSPEND %s: %s: invalid suspend

%SYS-E-INVALID_TASK %s: %s: invalid task

%SYS-E-INVALID_TIMER %s: %s: invalid timer

%SYS-E-INVALID_VECTOR %s: %s: invalid vector

 $\% \, SYS\text{-}E\text{-}INVALIDFABSLOT \, Invalid \, Fabric \, Slot \, \%d \, /\!/$

%SYS-E-ISCONN %s: %s: socket is already connected

%SYS-E-ISDIR %s: %s: is a directory

%SYS-E-L2HLT %s: %s: level 2 halted

%SYS-E-L2NSYNC %s: %s: level 2 not synchronized

%SYS-E-L3HLT %s: %s: level 3 halted

%SYS-E-L3RST %s: %s: level 3 reset

%SYS-E-LANWANOPTIONMIXED Mixed Lan and Wan options

%SYS-E-LIBACC %s: %s: can't access a needed shared lib

%SYS-E-LIBBAD %s: %s: accessing a corrupted shared lib

%SYS-E-LIBEXEC %s: %s: attempting to exec a shared library

%SYS-E-LIBMAX %s: %s: attempting to link in too many libs

%SYS-E-LIBSCN %s: %s: .lib section in a.out corrupted

%SYS-E-LINKGRP Forced reverse flows are not allowed on members of smart trunks.

%SYS-E-LNRNG %s: %s: link number out of range

%SYS-E-LOOP %s: %s: symbolic link loop

 $\% SYS-E-MACNOTOURS \ Requested \ MAC \ is \ not \ of \ our \ OUI, \ \%02x\%02x\%02x\%02x\%02x\%02x$

%SYS-E-MAILBOX_DELETED %s: %s: mailbox deleted

%SYS-E-MAILBOX_EMPTY %s: %s: mailbox empty

%SYS-E-MAILBOX_FULL %s: %s: mailbox full

%SYS-E-MAILBOX_RESET %s: %s: mailbox reset

%SYS-E-MAJORREV Module %d major revision is %d, expected %d

%SYS-E-MEMUSESTATS Printing memory stats because no memory available, requested %d // // The following eight are used for the daylight saving time found in dstime.c //

%SYS-E-MFILE %s: %s: too many open files

%SYS-E-MLINK %s: %s: too many links

%SYS-E-MSGSIZE %s: %s: message too long

%SYS-E-MULTIHOP %s: %s: multihop attempted

%SYS-E-NAMETOOLONG %s: %s: path name is too long

%SYS-E-NETDOWN %s: %s: network is down

%SYS-E-NETRESET %s: %s: network dropped connection because

%SYS-E-NETUNREACH %s: %s: network is unreachable

%SYS-E-NFILE %s: %s: file table overflow

%SYS-E-NO_CRASH_FILE Unable to open flash file to dump crash information

%SYS-E-NO_MEMORY %s: %s: no more memory

%SYS-E-NO_MORE_LISRS %s: %s: no more low ISRs

%SYS-E-NO_PARTITION %s: %s: no partitions

%SYS-E-NOANO %s: %s: no anode

%SYS-E-NOCSI %s: %s: no CSI structure available

%SYS-E-NODATA %s: %s: no data (for no delay io)

%SYS-E-NODEV %s: %s: no such device

%SYS-E-NOENT %s: no such file or directory '%s'

%SYS-E-NOEXEC %s: %s: exec format error

%SYS-E-NOFABHOTSWAP System Fabric Hotswap not supported

%SYS-E-NOIFGMOD Cannot configure IFG for non-Ethernet ports

%SYS-E-NOLCK %s: %s: no record locks available

%SYS-E-NOLINK %s: %s: the link has been severed

%SYS-E-NOMODULENUM Invalid module number -- %d

%SYS-E-NONET %s: %s: machine is not on the network

%SYS-E-NOPKG %s: %s: package not installed

%SYS-E-NOPROTOOPT %s: %s: protocol not available

%SYS-E-NOSPC %s: %s: no space left on device

%SYS-E-NOSR %s: %s: out of streams resources

%SYS-E-NOSTR %s: %s: device not a stream

Table 1: Undocumented Error Messages

%SYS-E-NOSYS %s: %s: unsupported file system operation %SYS-E-NOT_DISABLED %s: %s: not disabled %SYS-E-NOT_PRESENT %s: %s: not present %SYS-E-NOT_REGISTERED %s: %s: not registered %SYS-E-NOT_TERMINATED %s: %s: not terminated %SYS-E-NOTBLK %s: %s: block device required %SYS-E-NOTCONN %s: %s: socket is not connected %SYS-E-NOTDIR %s: %s: not a directory %SYS-E-NOTEMPTY %s: %s: directory not empty %SYS-E-NOTSOCK %s: %s: socket operation on non-socket %SYS-E-NOTSUP %s: %s: operation not supported %SYS-E-NOTTY %s: %s: inappropriate ioctl for device %SYS-E-NOTUNIQ %s: %s: given log. name not unique %SYS-E-NXIO %s: %s: no such device or address %SYS-E-OPNOTSUPP %s: %s: operation not supported on socket %SYS-E-OPTIONERROR Options for auto dst were not assigned properly %SYS-E-OVERFLOW %s: %s: value too large to be stored in data type %SYS-E-PERM %s: %s: not super-user %SYS-E-PFNOSUPPORT %s: %s: protocol family not supported

%SYS-E-PIPE %s: %s: broken pipe

%SYS-E-PIPE_DELETED %s: %s: pipe deleted

%SYS-E-PIPE_EMPTY %s: %s: pipe empty

%SYS-E-PIPE_FULL %s: %s: pipe full

%SYS-E-PIPE_RESET %s: %s: pipe reset

%SYS-E-POOL_DELETED %s: %s: pool deleted

%SYS-E-PORT_NEGATE port can't be negated before all the other commands related to the port are negated

%SYS-E-PROTONOSUPPORT %s: %s: protocol not supported

%SYS-E-PROTOTYPE %s: %s: protocol wrong type for socket

%SYS-E-QUEUE_DELETED %s: %s: queue deleted

%SYS-E-QUEUE_EMPTY %s: %s: queue empty

%SYS-E-QUEUE_FULL %s: %s: queue full

%SYS-E-QUEUE_RESET %s: %s: queue reset

%SYS-E-RANGE %s: %s: math result not representable

%SYS-E-REMCHG %s: %s: remote address changed

%SYS-E-REMOTE %s: %s: the object is remote

%SYS-E-RESTART %s: %s: restartable system call

%SYS-E-REVISION_CHECK_FAIL Obsolete hardware revision in slot %d -- replace board immediately

%SYS-E-ROFS %s: %s: read only file system

%SYS-E-SAMEDSTIME The begin and end times must be at least 1 hour 10 minutes apart

%SYS-E-SEMAPHORE_DELETED %s: %s: semaphore deleted

%SYS-E-SEMAPHORE_RESET %s: %s: semaphore reset

%SYS-E-SHUTDOWN %s: %s: can't send after socket shutdown

%SYS-E-SOCKTNOSUPPORT %s: %s: socket type not supported

%SYS-E-SPIPE %s: %s: illegal seek

%SYS-E-SRCH %s: %s: no such process

%SYS-E-SRMNT %s: %s: srmount error

%SYS-E-STALE %s: %s: stale NFS file handle // // Following are used by the VFS. // These errors require two arguments: The name of the function calling // ERR_errlog() and the name of the function that returned the original // error being logged. //

%SYS-E-STHALF Cannot set %s to half-duplex mode

%SYS-E-STMEMNOTFOUND %s %s.%d does not contain any member ports // The following are errors for invalid hotswap cli commands

%SYS-E-STNOTFOUND %s %s.%d not found

%SYS-E-STRPIPE %s: %s: if pipe/FIFO, don't sleep in stream head

%SYS-E-TIME %s: %s: timer expired

%SYS-E-TIMEDOUT %s: %s: connection timed out

%SYS-E-TIMEOUT %s: %s: time-out

%SYS-E-TIMER_HISR_CREATE %s: %s: error creating timer

%SYS-E-TIMER_TASK_CREATE %s: %s: error creating timer

%SYS-E-TOOMANYREFS %s: %s: too many references: can't splice

%SYS-E-TXTBSY %s: %s: text file busy

%SYS-E-UNATCH %s: %s: protocol driver not attached

%SYS-E-UNAVAILABLE %s: %s: resource unavailable

%SYS-E-UNSUPPCPUMOD %s '%s', is not supported on %s systems

%SYS-E-USERS %s: %s: too many users (for UFS)

%SYS-E-VC_NEGATE vc can't be negated before all the other commands using vc are negated %SYS-E-VFSBADARG %s: %s: Bad function argument %SYS-E-VFSBADBLKNUM %s: %s: bad block number %SYS-E-VFSBADCACHEBUFFER %s: %s: bad cache buffer %SYS-E-VFSBADCACHESIGN %s: %s: bad cache buffer signature %SYS-E-VFSBADCOMPLEN %s: %s: component length exceeded %SYS-E-VFSBADDIRENTCNT %s: %s: bad count of directory entries %SYS-E-VFSBADDIRENTSIGN %s: %s: bad directory entry signature %SYS-E-VFSBADDIRHDRSIGN %s: %s: bad directory block signature %SYS-E-VFSBADENTRYNUM %s: %s: bad entry number %SYS-E-VFSBADEXTENTSIGN %s: %s: bad extra entry signature %SYS-E-VFSBADFILE %s: %s: bad open file node %SYS-E-VFSBADFILELIST %s: %s: bad open file list %SYS-E-VFSBADFILENTSIGN %s: %s: bad file entry signature %SYS-E-VFSBADFILESIGN %s: %s: bad open file signature %SYS-E-VFSBADFILESIZE %s: %s: bad file size %SYS-E-VFSBADFILHDRSIGN %s: %s: bad file block signature %SYS-E-VFSBADFREENTSIGN %s: %s: bad free entry signature %SYS-E-VFSBADFREHDRSIGN %s: %s: bad free block signature %SYS-E-VFSBADHANDLE %s: %s: bad file handle %SYS-E-VFSBADMNTPOINT %s: %s: bad mount point %SYS-E-VFSBADMODE %s: %s: bad mode for file open %SYS-E-VFSBADOFFSET %s: %s: bad offset %SYS-E-VFSBADOPENCNT %s: %s: invalid file open count %SYS-E-VFSBADPATH %s: %s: bad path %SYS-E-VFSBADSIGNATURE %s: %s: bad signature %SYS-E-VFSBADVFSHDRSIGN %s: %s: bad VFS block signature %SYS-E-VFSBLKNOTFOUND %s: %s: bad block number %SYS-E-VFSCACHEINUSE %s: %s: file cache accessed multiple times %SYS-E-VFSDIREXISTS %s: %s: directory already exists %SYS-E-VFSDIRNOTEMPTY %s: %s: directory not empty

%SYS-E-VFSFILEEXISTS %s: %s: file already exists

%SYS-E-VFSFILESTILLOPEN %s: %s: file still open

%SYS-E-VFSFILESYSFULL %s: %s: file system is full

%SYS-E-VFSFLUSH %s: %s: file flush failed

%SYS-E-VFSFSCMPRSD %s: %s: compressed file system not mountable uncompressed

%SYS-E-VFSLCKFAIL %s: %s: lock acquisition failed

%SYS-E-VFSMINBLKCNT %s: %s: file system minimum block count not met

%SYS-E-VFSNOCACHEBUFFER %s: %s: no free cache buffers

%SYS-E-VFSNOENTRIES %s: %s: file flush failed

%SYS-E-VFSNOFILE %s: file '%s' not found

%SYS-E-VFSNOFREEBLOCK %s: %s: no free blocks available

%SYS-E-VFSNOFREEENTRY %s: %s: no free entries available

%SYS-E-VFSNOHANDLE %s: %s: file handle not found

%SYS-E-VFSNOMEMORY %s: %s: insufficient system memory

%SYS-E-VFSNOTABSPATH %s: %s: absolute path must be specified

%SYS-E-VFSNOTADIR %s: %s: entry is not a directory

%SYS-E-VFSNOTAFILE %s: %s: entry is not a file

%SYS-E-VFSNULLCOMP %s: %s: component is null

%SYS-E-VFSNULLPTR %s: %s: NULL pointer encountered

% SYS-E-VFSREADPASTEOF % s: % s: reading past end-of-file

%SYS-E-VFSRNDMACCESS %s: %s: random file access error

%SYS-E-VFSUNLCKFAIL %s: %s: lock release failed

%SYS-E-WAN Forced reverse flows are not allowed on WAN ports.

%SYS-E-WAN_CKSUM_ERROR %d: channel checksum error; kernel:%s file: %s #ifdef CMTS_SUPPORT // cmts hardware initialization errors

%SYS-E-WAN_SYNCH_ERROR Cannot synch with WAN card in slot %s

%SYS-E-WANPORTOUTOFRANGE The specified port(%d) is out of range

%SYS-E-WANVCNOTALLOWED vc option is not allowed for PORT SET command

%SYS-E-XDEV %s: %s: cross-device link

%SYS-E-XFULL %s: %s: exchange full

%SYS-F-MEMTOPNULL top of RAM is unknown // // The following are used by the L3 IPP driver //

%SYS-I-ADD_IMAGE_BACKUP_OK system image stored on Backup CM--complete

%SYS-I-ATMHARDWARESIPPOK The ATM linecard in slot %d has a SIPP revision %d.%d. // Begin WAN CLI System Warnings.

%SYS-I-CMTS_SYNCH_SUCCESS Successfully synchronized with CMTS card on channel %d #endif /* CMTS_SUPPORT */ %SYS-I-CPL_PORTDN Port %s CM packet rate exceeded. %SYS-I-CPL_PORTUP Port %s CM packet shutdown period expire %SYS-I-DSTCHANGE Auto DST has changed the time %s one hour %SYS-I-HOTSWAP_HSQINDUP duplicate request for hotswap-in slot %d ignored %SYS-I-HOTSWAP_HSQOUTDUP duplicate request for hotswap-out slot %d ignored %SYS-I-HOTSWAP_INRXD received hotswapped-in request for slot %d, detecting, please wait %SYS-I-HOTSWAP_OUTQUEUED hotswap busy, request for hotswap-out slot %d queued %SYS-I-HOTSWAP_OUTRXD received hotswapped-out request for slot %d %SYS-I-ICMPSTATSCLR ICMP statistics cleared //information for the bootimage upgrade routines %SYS-I-POST Power-On Self Test mode: %s %SYS-W-CLI_NON_CMTS_PORT Port %d is not a cmts port #endif /* CMTS_SUPPORT */ // wan cli %SYS-W-CLI_NON_FR_PORT card %d port %d is not a frame relay port %SYS-W-CLI_NON_FR_PROFILE cli: Trying to set a non-frame-relay service (%s) on a frame relay port (%d) %SYS-W-CLI_NON_PPP_PROFILE cli: Trying to set a non-ppp service (%s) on a PPP port (%d) %SYS-W-CLI_SERVICE_PROFILE_IN_USE cli: the service profile is being used %SYS-W-CMTS_TOD_IPC_RECVQ_FAIL queue registration with IPC failed, cannot receive msg from cmts card through IPC %SYS-W-CMTS_TOD_RECEIVE_FAIL error on receiving msg from cmts card, error code %d %SYS-W-CMTS_TOD_RECVQ_FAIL create queue failed, cannot receive msg from cmts card %SYS-W-CMTS_TOD_SEND_FAIL CMTS TOD msg not sent due to IPC failure %SYS-W-CMTS_TOD_TMR_FAIL create timer failed, cannot periodically update time on CMTS card %SYS-W-CMTS_TOD_WAIT_FAIL CMTS TOD event with unsuccessful status %d #endif /* CMTS_SUPPORT */ %SYS-W-CMTS_TOD_WRONG_OBJECT_ID CMTS TOD msg received with unrecognized object id = %d %SYS-W-CMTSPORTOUTOFRANGE The specified port(%d) is out of range %SYS-W-CRASH_DUMP_SAVED Module %d crashed. Crash dump stored in file: %s // obsolete hardware warnings %SYS-W-FANSFAILED system fan(s) have failed or fan tray is not installed %SYS-W-NOAUTOFIBER auto-negotiate not supported on 100 Mbit Fiber Ports. %SYS-W-NOAUTOSPEEDDUPLEX cannot set speed/duplex on 10/100M Port when Autonegotiation is ON.

%SYS-W-NOFLOWCTLFE cannot advertise flow control on 10/100 Mbit Ports.

%SYS-W-TEMPTOOHIGH system temperature has exceeded operating limits

%SYS-W-VADDRNOTMAPD virtual address '0x%08lx' is not TLB mapped

%SYS-W-REVISION_CHECK_FAIL Old prototype hardware revision found in slot %d -- update as soon as possible

%T1T3CLI-E-MLPWRONGSLOT MLP is only supported on the wan module, and slot %d is not a wan module.

%TELNETD-E-CHILDRDY_WAIT rc = %d while waiting for child to be ready

%TELNETD-E-CONTROL_TIMER NU_Control_Timer failed with status %d

%TELNETD-E-CREATE_TIMER NU_Create_Timer failed with status %d

%TELNETD-E-DELETE_TIMER NU_Delete_Timer failed with status %d

%TELNETD-E-NOPTY could not acquire a pty

%TELNETD-E-PTY_ERROR PUSHLOG failed errno %d

%TELNETD-E-RANDOM_EVENT events = %d when child should have been ready

%TELNETD-E-RESET_TIMER NU_Reset_Timer failed with status %d

%TELNETD-E-TIMER telnetd could not create sleep timer

%TELNETD-F-BADSTATE telnetd: panic state=%d

%TELNETD-I-END_CLIENT telnet client terminated at user request

 $\%\,TELNETD\text{-I-END1}$ ending telnet session $\%\,d,$ proc $\%\,x$

%TELNETD-I-END2 ending telnet console session %d, proc %x

%TELNETD-I-GOTCHAR received char '%c' $(0x\%02x)\r$ /* <GOTINT> <0> <0> received interrupt from net*//* <CONSINT> <0> <0> console got interrupt*/

%TELNETD-I-NET_DUHH net was ready for reading and then it wasn't

%TELNETD-I-PTY_DUHH pty was ready for reading and then it wasn't

%TELNETD-I-START1 starting telnet session %d, proc %x

 $\%\,TELNETD\text{-I-START2}$ starting telnet console session $\%\,d,$ proc $\%\,x$

%TELNETD-W-TTLOOP_WOULDBLOCK ttloop() read returned EWOULDBLOCK session %d

%VLAN-E-NO_TOVLAN No target VLAN specified.

%VLAN-I-MOVEPORTS Moving ports %s from VLAN %s[%d] to VLAN %s[%d]

%WAN-E-MSG Loadable module %d: %s #else

%WAN-E-MSG WAN module %d: %s #endif /* CMTS_SUPPORT */

 $\%\,WAN\text{-F-MSG}$ Loadable module $\%\,d$: $\%\,s$ #else

%WAN-F-MSG WAN module %d: %s #endif /* CMTS_SUPPORT */

%WAN-I-MSG Loadable module %d: %s #else

%WAN-I-MSG WAN module %d: %s #endif /* CMTS_SUPPORT */

%WAN-W-MSG Loadable module %d: %s #else

%WAN-W-MSG WAN module %d: %s #endif /* CMTS_SUPPORT */

%WC-E-ENIF Web-caching '%s' cannot be applied to the management interface

%WC-E-LOIF Web-caching '%s' cannot be applied to the loopback interface

%WC-I-STATUS_CHANGE Server '%s' status change -- Server %s

Appendix B

Technical Support

Getting Help

For additional support related to the Common CLI syntax or this document, contact Enterasys Networks using one of the following methods:

World Wide Web	http://www.enterasys.com/
Phone	(603) 332-9400
Internet mail	support@enterasys.com
FTP	ftp://ftp.enterasys.com
Login	anonymous
Password	your email address

To send comments or suggestions concerning this document, contact the Technical Writing Department via the following email address: **TechWriting@enterasys.com** Please include the document Part Number in the email message.

Before contacting Enterasys Networks, have the following information ready:

- Your Enterasys Networks service contract number
- A description of the failure
- A description of any action(s) already taken to resolve the problem (e.g., changing mode switches, rebooting the unit, etc.)
- The serial and revision numbers of all involved Enterasys Networks products in the network
- A description of your network environment (layout, cable type, etc.)
- Network load and frame size at the time of trouble (if known)

Hardware Warranty

Enterasys warrants its products against defects in the physical product for one year from the date of receipt by the end user (as shown by Proof of Purchase). A product that is determined to be defective should be returned to the place of purchase. For more detailed warranty information, please consult the Product Warranty Statement received with your product.

Software Warranty

Enterasys software products carry a 90-day software warranty. During this period, customers may receive updates and patches for verified, reported software issues.

Repair Services

Enterasys offers an out-of-warranty repair service for all of our products. Products returned for repair will be repaired and returned within 5 working days. A product sent directly to Enterasys Networks for repair must first be assigned a Return Material Authorization (RMA) number. A product sent to Enterasys Networks without an RMA number displayed outside the box will be returned to the sender unopened, at the sender's expense.

To obtain an RMA number, contact Enterasys Technical Support. When you call for an RMA number, your support representative will spend a few minutes with you, making sure the board is defective. Once they confirm that the board is defective, they will assign an RMA number. Payment, shipping instructions, and turnaround time will be confirmed when the RMA number is assigned.

Index

Numerics 2MANYCPUS 507	ALLUSE 373 ALREADY ACL 3
\mathbf{A}	ALREADY_APPLIED 356
ABORT 152	APPDOWN 243
ACCESSCHNG 535	APPLIED 313, 356, 567
ACCLSTEXISTS 248	APPSTCHNG 147
ACLATTACHED 190	APPUP 244
ACLEXISTS 312	APS_CFG_INVALID 434
ACLNOTFOUND 313, 355, 566	APS_CFG_PRESENT 434
ACTIVEBKPLANE 467	APS_CONFLICT 230
ADD_COMM_FAIL 429	APS_ENABLED 453
ADD_IMAGE_BACKUP_FAIL 485	APS_HIGHERPRIO 434
ADD_L2_ENTRY 230	APS_INVALID_CFG 434
ADD_L2_ENTRY_FLOW 230	APS_INVALIDOPER 435
ADD_MEM 391	APS_MISMATCH 435
ADD_TARGET_FAIL 429	APS_PROTECTION 256
ADDED 420	APS_PROTECTION 356
ADDFAILED 467	APS_PROTSW_EXISTS 435
ADDFAILURE 538, 540	APS_SINGLEPORT 436
ADDPORTS 535	APS_SONET_PORT 435
ADDR_IN_EXISTING_SUBNET 190	APS_STATUS 230
ADDREXISTS 379	APS_UNAVAILABLE 436
ADDRMASK 555	AREAEXISTS 297
ADDRNOTFOUND 379	AREANOTEOLIND 208
ADDROVFL 380	AREA OVEL 208
ADDSUCCESS 536	AREAOVFL 298 AREERASED 99
ADJUST_WARMUP 551	
ADMINALREADYDOWN 247	ARPADDED 467
ADMINALREADYUP 247	ARPEXCEEDED 207 ARPKEEPTIMECONFIGURED 190
ADVALLOCFAIL 152	ARPLKUP 208
ADVALLOCLIST 153	ARPNOTFOUND 205
ADVNULL4IMGAGGR 153	ARPOVRWRITE 205
AGGRSUPPORTED 356	ASPATHALLOCFAIL 319
AGINGERROR 421	ASPATHALLOCFAIL 319 ASPATHIGN 43
AGINGTIMER 243	ASPATHNULL 320
ALIGN 398	ASSERTFAIL 153
ALLCONFIGURED 351	ASSERTFAIL 133 ATM_ONLY 63, 84
ALLNOTALLOWED 351	ATMBADMUX 541
ALLOCFAILED 336	ATMCELLMAPPINGNOTSUPPORTED 485
ALLOWED_LIST 184	ATMCELLIMATINGNOTOUTFORTED 463

ATMFRAMINGNOTSUPPORTED 486	BADEXTSTPRFGR 46
ATMMEDIANOTSUPPROTED 486	BADEXTSTPRFHS 46
ATMPORTINFAILURE 486	BADFILE 373
ATMSCRAMBLENOTSUPPORTED 486	BADFREEBLK 508
ATTRIBUTEEXISTS 320	BADGRP 265
ATTRIBUTEOVFL 320	BADHOLDTIMEGR 46
ATTRLISTIDEXIST 320	BADHOLDTIMEHS 46
ATTRLISTNOTFOUND 44, 321	BADHSTSETPREF 47
ATTRLISTOVFL 321	BADIFNAME 63
AUTH_DENIED 109	BADIFTYPE 191
AUTH_NONE 109	BADINTF 357
AUTH PASSWD 110	BADLOCALADDR 47
AUTH_SUCCEED 110	BADLOGIN 152
AUTHKEY 556	BADMAXINTERVAL 380
AUTO_FLASH 130	BADMCASTADDR 64
AUTO_YORK_PROGRAM 131	BADMEMREG 508
B	BADMETRICOUT 47
BACKBONENOTCFG 298	BADMININTERVAL 380
BACKUP_CFG 101	BADMLPSLOT 453
BACKUP_NO_SUCH_IMAGE 487	BADMLPTYPE 452
	BADMOVE 103
BACKUPFAILURE 176	BADMTU 191
BAD_AF 556	BADNAME 64
BAD_FLASH_MAGIC 131	BADNAME_L3VLAN 541
BAD_FLASH_SUM 131	BADNAME_RSVD 541
BAD_IPP_MEM 487	BADNAME_RSVD 541 BADNAME_TOOBIG 541
BAD_NIA_MEM 507	BADNAME_VLAN_ALNUM 542
BAD_OPP_MEM 487	BADNAME_WS 542
BAD_PORT 231, 286	BADNAME2 64
BAD_PORT_MEM 488	BADNAME2 04 BADNETBUF 508
BAD_TIMERS 148	
BADACLNAME 3	BADOPTCOMBO 64
BADADDR 120, 265, 488	BADOUTDELAY 47
BADADDRFLUSH 507	BADPASSWD 110, 523
BADADDRMASK 120	BADPATH 103
BADADVLIFETIME 380	BADPKT 178
BADAF 384	BADPORT 192
BADANNOT 208	BADPRIO 286
BADARCRD 383	BADPROTOVAL 48
BADATMMUX 191	BADQTYPE 384
BADBCAST 207	BADRCPURL 373
BADBGPVERIGP 44	BADRESPTIME 184
BADBGPVERIGPH 45	BADSETPREF 48
BADBGPVERRRF 45	BADSLOT 508
BADBLK 507	BADSRCIP 294
BADCHKSUM 488	BADSYSID 180
BADCLUSTID 45	BADTARGET 373
BADDEVICE 488	BADTFTPURL 525
BADETHERSIP 350	BADTRLOFF 142
BADETHERSMAC 350	BADTRLOFF1 142
BADEXTBGPRRF 45	BADUNIADDR 65

BADURL 488	CHAINNOTSPEC 40
BADVALUE 317, 529	CHAINOVFL 40
BADVC 19, 192	CHANGES 61, 83
BADVERSION 103	CHGPOLICY 244
BADVLAN 192	CHILDEXISTS 357
BADWANPROTO 454	CHILDRATE_ERR 358
BASE64 384	CHS_BACKUP_FAIL 489
BAUDFAIL 489	CHS_BACKUP_OK 469
BBONEZEROINTFS 299	CHS NONE BACKUP OK 469
BCAST0HOST 192	CHS_NONE_PRIMARY_OK 470
BCAST1HOST 193	CHS_PRIMARY_FAIL 489
BGPEXPDSTEXIST 321	CHS_PRIMARY_OK 470
BGPIMPSRCIDEXIST 321	CLADDGRPACC 244
BIGFRAME 142	CLI ACK 229
BINARY 103	CLI_ERROR_MEM_FAIL 509
BINDFAILED 336	CLI_ERROR_SEND_FAIL 414, 477
BITSTREAMREADFAILED 19	CLI_FR_SERVICE_REUSED 490
BKPLANEINSERTED 468	CLI_MAX_COMPENCR 414
BKPLANEOFFLINED 468	CLI_NO_WAN_PROTO 477
BKPLANEREMOVED 468	CLI NON PPP PORT 477
BKTA_INUSE 357	CLI_NON_WAN_PORT 477
BKTUSED 357	CLI_RECV_FAIL 478
BLKFREE 509	CLI RECVQ FAIL 478
BLKNOALLOC 509	CLI_VCCOMP 414
BOOTADDED 468	CLI_WAN_WRONG_PPP_PORT_NAME 478
BOOTREPLY 214	CLIMALLOCFAIL 154
BOOTREQUEST 214	CLNDYN 269
BOOTSOURCEISUNKNOWN 20	CLNTCONFAIL 154
BOUND 542	CLNTOPENFAIL 154
BPDU_FILTER 451	CLOCK_TEMPOKAY 439
BUCKETS 395	CLOCK_TEMPTOOHIGH 440
BUFFERSFAIL 221	CLREMGRPACC 244
BUFFERSSUCC 219	CLRTEGFAIL 208, 221
BUSERR 509	CM3 50 INVALID 490
BYPASS LIST 565	CMD 194
C	CMDDEPRECATED 454
	CMDNONREMOVABLE 83
CALLBACK FAIL 278	CMDNOTAPPLY 542
CALLBACK_FAIL 278	CMDUNKNOWN 84
CANNOTHER ATE 102	CMDUNKNWN 65
CANTADDDELT 454	CMDUSERMODE 84
CANTADDDFLT 454	CNOTIMEZONE 293, 294
CANTCREATEIF 194	CNTRLTMRFAIL 208, 221
CFG_BLANK 101	CODEIVSEQ 510
CFGOPENFAIL 153	COMPILE 271
CFGPARSEERR 154	COMPUNKNWN 65
CFGRCVERR 179	CONFIG EMPTY 104
CFGTOBACKUP 469	CONFIGEMENT 1 104 CONFIGEMD 556
CFGUPDATED 469	CONFIGURD 550 CONFIGURDATE 551
CHAINIDEXIST 39	CONFIGURDATE 331 CONN 373
CHAINNOTEOUND 39	CUININ 3/3

CONNECTION 374	DIFFHASH 422
CONNREFUSED 490	DIFFMEDIA 422
CONSACCEPTFAIL 155	DIFFNEGOTIATION 423
CONSBINDFAIL 155	DIFFNETMEM 176
CONSFDOPENFAIL 155	DIFFSPEED 423
CONSLISTENFAIL 156	DIFFSUBNET 194
CONSOPENFAIL 155	DIS_TIMER 279
CONSREADFAIL 156	DISABLED 391, 423
CONTROL_INDEX 395	DMIATTACHEDNULL 156
COSTSETCANTDELLG 454	DMIEXTAGGRMISMATCH 156
COSTSETCANTDELMLP 455	DMND_DEL 231, 237
CPU0_TEMPOKAY 439	DOWN 289
CPU0_TEMPTOOHIGH 441	DS_BIND 398
CPU1_TEMPOKAY 439	DS_REG_FAILED 430
CPU1_TEMPTOOHIGH 441	DS_REGISTERED 427
CREATE_Q 20, 172, 240	DS_UNREGISTERED 427
CREATE_QUE 564	DSCVMOD 471
CREATE_SEMA4 107, 172, 240, 564	DSTFLOWMODE 3
CREATE TASK 278	DSTIDEXIST 11
CREATE_TIMER_FAILED 443	DSTMODE 358
CREATE_TMR 172, 237	DSTMSKINSFAIL 157
CREATED 311, 353, 419, 536, 565	DSTNETWORKNOTSPCFYD 343
CREATEDIF 187	DSTNOTFOUND 11
CREATEQ 180, 422, 455	DSTOVFL 12
CREATETASK 526	DUPHELPER 216
CTL_PKT_LOOPBACK 408	DUPIFADDR 121
CTRL 374	DUPL_CFG 556
D	DUPLICATE 104, 358, 557
DATAMALLOCFAIL 162	DUPLICATEGWAYS 445
DBEMPTY 117	DUPLIP 207
DBFLUSHED 117	DUPNAME 121, 184, 543
DEBUGENABLED 335	DUPTNL 121
DEC_DRIVER 408	DUPVID 543
DECREASE MEMORY 279	DUPX 423
DEFAULT 2	DYN_VLAN_DISABLED 165
DEL_BACKUP_OK 471	DYN_VLAN_ENABLED 165
DELETE_IMAGE_BACKUP_FAIL 490	DYNAMIC_VLAN 167
DELETED 311, 353, 566	DYNCR 269
DELETED_DIRECTORY_ONLY 471	DYNGBLLSTMAL 272
DELETING_CHOSEN_IMAGE 491	DYNGBLTOLCL 272
DENY ACL 2	DYNGBLUSED 272
DESTEXISTS 299	DYNRM 270
DESTMALLOC 299	DYNSESSTO 270
DFLTNOTALWD 455	${f E}$
DFLTSTPCFLCT 455, 543	EGRESS_DEC_SEND 408
DIAGFAIL 143	EGRESS_ERROR_INARP 408
DIAGQ 143, 285, 443	EGRESS_ERROR_INARP_ADDR 409
DIFF_USERNAME 372	EGRESS ERROR INARP DSTADDR 411
DIFFDRAM 176	EGRESS_ERROR_INARP_IPX_ADDR 412
DIFFGRP 422	EGRESS_ERROR_INARP_RESOLVE 412
DILLOIN 422	EUKESS_EKKUK_INAKI_KESUL VE 412

EGRESS_FR_DEC_FAIL 415	EXPDSTOVFL 322
EGRESS_FR_FORMAT 409	EXPPOLICYOVFL 322
EGRESS_FR_NLPID 409	EXPSRCFLTROVFL 323
EGRESS_FR_OUI 409	EXPSRCIDEXIST 323
EGRESS_FR_PID 410	EXPSRCNOTFOUND 323
EGRESS_FR_VC_DISABLED 410	EXPSRCOVFL 323
EGRESS_FR_VC_NOTCONF 410	EXTASSAME 48
EGRESS_MAC_TYPE 410	\mathbf{F}
EGRESS_PORT_DISABLED 411	FABRIC1_TEMPOKAY 440
EGRESS_PPP_DEC_FAIL 415	FABRIC1_TEMPTOOHIGH 441
EGRESS_PPP_MP_PID 411	FABRIC2_TEMPOKAY 440
EGRESS_PPP_PID 411	FABRIC2_TEMPTOOHIGH 441
EMPTY 515	FACADD 157, 491
EN_TIMER 279	FACADDFAIL 127
EN0 557	FACUNKNWN 65
ENABLE_FAILURE 399	FAILED 66, 85, 385, 424
ENABLED 392, 428	FAILREGMCASTADDR 424
ENOSOCKSIZEELEM 221	FAILREGMGMTADDR 456
ERASED 99, 100	FANFAIL 58
ERIPCLINOMEM 222	FANNORMAL 57
ERIPIFSHAD 222	FANSOKAY 471
ERIPNOIFELEM 222	FATALSYS 510
ERIPNOSHOWELEM 222	FBQ 285
ERIPNOSTATRTELEM 222	FDDI_MODE 132
ERIPSHOWSHAD 223	FDDI_ONLY 85
ERIPSTATRTFAIL 223	FILE 374
ERIPSTATRTINTF 223	FILTER_ID_EXISTS 399
ERIPSTATRTSHAD 223	FILTER_ID_NOTEXISTS 399
ERIPTEGFAIL 224	FILTERIDEXIST 323
ERRORLOG_Q_CREATE_FAILED 517	FILTERNOTFOUND 324
ESAPNOMEM 224	FILTEROVFL 324
ESAPNOSTATSAPELEM 224	FILTRDSRCOVFL 12, 324
ESAPSTATSAPFAIL 224	FIXINGMBSOPTION 17, 18
ESAPSTATSAPSHAD 225	FIXINGSCROPTION 17, 18
ESOCKSIZESHAD 225	FLASH_CORRUPTED 132
ESOCKTEGFAIL 225	FLASH_CRC 132
ETYPEREG 181	FLASH ERASE 132
EVENTWAIT 181, 456	FLASH_NOT_SREC 133
EVGBAD 339, 403	FLASH_PROGRAM 133
EVGCREAT 340, 403	FLASH_SREC_LOAD 133
EVGGET 340, 404	FLASH_VERIFY 133
EVGSET 340, 404	FLASH_WRITEPROTECTED 491
EVWAIT 59, 241, 333	FLASHCRD 472
EXCEEDED 567	FLASHMNTD 472
EXISTINGVCL 20	FLASHMNTFAIL 492
EXISTINGVPL 20	FLOW_HW 237
EXISTS 194, 424	FLOW_HW 237 FLOW_MISMATCH 231
EXIT 157, 299	
EXPDSTIDEXIST 322	FLOWEVISTS 343
EXPDSTNOTFOUND 322	FLOWEXISTS 343
Lan Dollioli OutiD 322	FLT CONFLICT 237

FLT_INVALID 238	HASAPARENT 358
FLT_MAC 238	HASHPROB 300
FLTCHKFAIL 300	HASLINKS 520
FLTRDSRCNEX 12	HBTLOOPED 179
FORBIDDEN 543	HBTTAKEOVER 177
FORBIDDEN_LIST 544	HDLC_DRIVER 412
FORMAT 374	HEAP75FULL 478
FPGACRCERROR 20	HEAP85FULL 478
FPGADNLOADFAILED 21	HEAP95FULL 479
FPGAFILENAMEUNKNOWN 21	HEAPDEPLETED 479
FPGAFILEOPENFAILED 21	HEAPEMPTY 510
FPGAFILESIZEUNKNOWN 21	HEARTBEAT_LOST 134
FRCOMP_UP 407	HELLORCVD 175
FREEQFULL 286	HIFN_DRIVER 412
FSTAT 374	HISRFAIL 144, 286, 404, 444
FTPCONTROL 245	HISTNOMEM 66
FTPPRT 270	HOSTADDED 245
FTPTO 270	HOSTBITS 66
FW_DATE 129	HOSTDELETED 246
FW_DESC 129	HOSTDOWN 246
FW_HOST 130	HOSTEXISTS 249
FW_USER 130	HOSTIDEXISTS 49
FWD 213	HOSTINLIST 249
FWD_IF 213	HOSTSTATE 247
G	HOSTUNREACH 15
GCASTRLSE 261, 433	HOSTUP 246
GENERAL_ERROR 430	HOTSWAP_EMPTY 492
GENERAL_WARNING 428	HOTSWAP_INQUEUED 472
GET_SEMA4 104, 169, 238, 557	HOTSWAP_OCC 492
GETFILENAME 526	HOTSWAPI_MASTER 492
Getting help xvi, 613	HOTSWAPIN 472, 493
GIADDR 214	HOTSWAPO_MASTER 493
GLISTALLOCFAIL 445	HOTSWAPOUT 473
GLISTEXISTS 446	HSSI_NOCLOCK 493
GNSDIRECTION 4	HSTFLMODINCOM 4
GROUPIDEXISTS 49	HSTFLOWMODE 4
GROUPNOTFOUND 49	HSTFLOWSERVICEACL 5
GROUPOVFL 49	HSTMODE 359
GRPCREATED 245	HSTNOTFNDALLGR 49
GRPDELETED 245	HWCOMP 272
GRPNAMEUSED 248	I
GTWY 209	IARPNOTXMT 18
GVRP_VLAN 544	IDLE_TIMEOUT 523
GWAYALLOCFAIL 446	IF_MISMATCH 557
GWAYEXISTS 446	IFAPPLIED 567
GWAYIFLISTEXISTS 446	IFBOUND 273
GWAYNULL 447	IFEXISTS 300, 381, 387, 532
GWAYREACHEN0 447	IFHWCOMP 273
H	IFLISTALLOCFAIL 447
HANDLE BKTFULL 232	IFLISTEXISTS 447

IFMTUCHANGED 536	INTASNOTSAME 50
IFNEXISTS 300	INTERFACE 312, 354, 566
IFNONE 195	INTF_ERROR 360
IFNOTENABLED 350	INTFALLOCFAIL 448
IFNOTFOUND 5, 121, 185, 266, 301, 343, 351, 381,	INTFEXISTS 448
387, 532	INTFNULL 448
IFNOTIP 195	INTMAXMCREATED 225
IFOVFL 381, 387, 532	INTRUNK 62
IFPRTDSTBASED 273	INV_VLAN 185
IFPRTHSTMODE 273	INVALID 568
IFSETMTU 539	INVALID_EVENT 554
IFVLANEXISTS 195	INVALID_OID 399
ILLEGALCOPY 493	INVALID_STATE 279
ILLEGALRANGE 249	INVALID_VLAN 232
ILLGWAYVAL 448	INVALIDATES_EXISTING_ADDR 196
ILLROUTERID 157	INVALIDDEFINEOBJECT 22
IMAGE_CANTSET 494	INVALIDFILE 526
IMAGES_LIST_MULTIPLE 494	INVALIDHEX 85
IMPAGGREXISTS 158	INVALIDHEXRANGE 86
IMPBBONEFAIL 301	INVALIDIEAKANGE 80 INVALIDIFNAME 86, 196
IMPFLTNOTFOUND 324	INVALIDINT 86
IMPFLTROVFL 325	INVALIDINTSET 86
IMPPOLICYOVFL 325	INVALIDIDY 87
IMPSRCFLTROVFL 325	INVALIDIPX 87
IMPSRCIDEXIST 325	INVALIDMAC 87
IMPSRCNOTFOUND 326	INVALIDMACHEX 88
IMPSRCOVFL 326	INVALIDNAMEIP 88
INAGGRMODE 359	INVALIDNETMASK 196
INCMPCMD 66	INVALIDPARAM 88
INCMPQUOTE 66	INVALIDPORT 88, 249
INCOMPATIBLE 5	INVALIDPORTLIST 89
INCONSISMAC 177	INVALIDRANGE 89
INCORRECT_LIST 567	INVALIDSLOT 89
INCORRECT_RANGE 568	INVALIDSRVCATOPTION 22
INFLOWMODE 359	INVALIDSRVDEFOPTION 22
INIT_HUGHES 134	INVALIDSTRING 90
INIT_MODULE 134	INVALIDTYPE 360
INIT_SYSTEM 134	INVALIDVC 90
INIT_TASK 135	INVALIDVPI 90
INIT_TIMER 135	INVASTAG 301
INIT_YORK 135	INVBETENDS 532
INITCSRBAD 22	INVBETLOWEND 533
INITDYN 271	INVBETWEENOPT 533
INITFAIL10Base 144	INVCFG 50, 302, 381
INITPORT 473	INVCONFIG 533
INITSLOTS 473	INVCONSSLOT 158
INITSYS 473	INVEXPPLCYIDX 326
INMLP 61	INVFLTRDSRCIDX 12, 326
INSERVICE 5	INVIMPFLTIDX 327
INSUFFAREASFORVLINK 301	INVIMPFLTRIDX 327

INVIMPPLCYIDX 327	IVCMD 68
INVLD 372, 421	IVCONDITIONAL 68
INVLD_IPADDR 313	IVCPUMODULE 494
INVLDMOD 494	IVFACINST 68
INVLDMOVE 104	IVFLOAT 69
INVLDMSG 177	IVHEX 69
INVLDSRC 177	IVIFNAME_IPADDR 69
INVLDSRVC 178	IVIFNAMES 69
INVMASKLEN 533	IVIPADDR 70
INVMD5KEY 302	IVIPADDR_MASK 70
INVNETSPEC 531	IVIPLIST 70
INVPROTOMET 327	IVIPRANGE 70
INVROUTEIDX 13	IVIPXADDR 71
INVSIMPLEKEY 302	IVIPXADDR_MAC 71
INVSRCFLTRIDX 13, 328	IVLIST 71
INVTRANSAREA 302	IVMACADDR 71
IO 494	IVMASK 72
IOCTL 110, 123, 524, 558	IVMODRANGE 72
IOCTLFAIL 158	IVNAME IPADDR 72
IP_interface/name 185	IVNUMBER 72
IP_VLAN 185	IVNUMHILIMIT 72
IPADDREXISTS 196	IVNUMLOLIMIT 73
IPADDRMSK 274	IVNUMRANGE 73
IPC_ADDR_ALIGN 140	IVOBJINST 73
IPC_ADDR_RANGE 140	IVOPT 73
IPC_ARG 140	IVOPTVAL 74
IPC_FAILURE 479	IVPORTLIST 74
IPC_QUEUE 67	IVPORTNAME 74
IPC_QUEUE_CLOSE 67	IVPORTRANGE 74
IPC_SEND_FAILED 415	IVPORTYPE 74
IPC_SEQUENCE 135	IVSAPSRVNAME 75
IPCFAIL 456	IVSYSTEM 510
IPDSTADDR_REUSE_PORT 415	IVURL 75
IPDSTADDR_REUSE_VC 416	IVVCRANGE 75
IPDSTMODEON 343	K
IPHOSTFLOWMODEON 344	KEYEXISTS 40
IPINACCLIST 250	KEYLEN 558
IPLIST 274	KEYNOTFOUND 40
IPNOTINACCLIST 250	KEYOVFL 41
IPONLY 262, 313, 355, 568	
IPREDATTACHED 197	L
IPXDSTADDR_REUSE_PORT 416	L2_ENABLED 122, 185
IPXDSTADDR REUSE VC 416	L2APIFAIL 262
IPXDSTMODEON 344	L2DBLALLOC 510
IPXSTATCLEAR 219	L2IVLDVLAN 511
IS_DISABLED 392	L3_ENABLED 186
IVADDR 67	L3ARP_TX 232
IVADDRUST 67	L3CANTADDFLOW 479
IVARGCNT 127, 128	L3DBLALLOC 511
IVCHANNEL 68	L3DBLFREE 511
I V CHAINNEL UU	L3HASHADRBAD 511

L3HASHBAD 512	MARTIANOVFL 534
L3TBLBAD 512	MASKDUP 209
L4BDG 480	MASTERCPUFAIL 175
L4BDGCONFIG 232	MATCHIF 274
L4BDGCONFIGERR 544	MATCHINGENTRY 341
L4BDGHDRERR 233	MAX_ROWS 396
L4BDGL3QUE 233	MAXACTIVECCONN 158
L4BDGNOTALLOW 544	MAXFLAP 43, 50
L4BDGONVLAN 545	MAXGATESXCEEDED 449
L4BDGSTATE 536	MAXGBL 275
L4BDGTBL 233	MAXINTFSXCEEDED 449
LARGELIST 75	MAXKEYLEN 209
LARGENUMRNG 75	MAXLEN 76
LARGEPORTRNG 76	MAXOVRGBL 275
LCLACLNF 274	MAXPEERSPGRP 51
LCLACLPROTO 274	MAXPEERSPRTR 51
LEVEL_ERR 360	MAXQLEMINQ 344
LISRFAIL 144, 287, 404, 444	MAXVIPRANGE 250
LIST_IMAGES_BACKUP_FAIL 495	MCASTFAIL 303
LIST_IMAGES_PRIMARY_FAIL 495	MCASTREG 424, 456
LITE_DEF 392	MD5KIDNOTSPEC 303
LITE_DEL_DEF 392	MD5NOTSUPP 303
LITE_NON_DEF 392	MEM 496
LITE_OFF 393, 396	MEM_RANGE 396
LL_CREATED 354	MEMBERS 545
LL_DELETED 354	MEMCORRUPT 512
LL_EXISTS 360	MEMHDRBAD 512
LOCASNOTSAME 50	MEMHDRIDX 513
LOGINFAIL 111, 524	MEMORY 122, 266
LOGINFAILED 90	MEMUSESTATS 496
M	MIB_LOCKED 430
MAC_MA_UNIT_ENAB 135	MIB_NOT_IMPLEMENT 430
MAC_MOVED 233	MIRROR_INFO 261
MAC_REG 233	MISCONFIG 421, 559
MAC_T_REQ 136	MISMATCH 102, 457
MACADDR 141	MISSING_VCI 76, 91
MACADDRNOTALLOWED 197	MISSING_VPI 76, 91
MACASSIGNED 495	MISSOPTION 76
MACCONFLICT 197	MISSREQD 77
MACNOTOWNED 496	MIXED_MEDIA_OPTS 496
MACTBL 234	MLP_PORT_SET 416
MALLOC 234, 558	MLPASSEMBLY 417
MALLOCFAIL 218	MLPCREATIONFAILED 417
MANDATORY 91	MLPPHYMLP 521
MANY_IPADDRS 558	MLPPHYPORT 520
MAPNOTFOUND 349	MLPPORTEXIST 521
MAPTYPE 22	MLPPORTNOTEXIST 521
MARKED_DEL 393	MLPPORTUSED 521
MARTIANEXISTS 534	MLPSLOT 522
MARTIANNOTEOUND 534	MLPVLAN 522

MLPVLANADDFAIL 520	NETFLOWENABLED 400
MODFAIL 217, 218	NETMASK 559
MODIFYREPORT 184	NETNOTFOUND 51, 304
MODNOTFOUND 62, 91	NETOVFL 52
MODPROBE 473	NETSPECFIXED 531
MODRANGEBAD 77	NETSTART 474
MODULE_CRASH_DUMP 497	NETWKOVFL 304, 328
MODULE_MSG 130	NETWORKEXISTS 305, 328
MODULE_ONLY 92	NEWBAUD 474
MODULEONLY 77	NI_XMT_Q_FULL 23
MON_CONSOLE 62	NIAFREETMOUT 480
MONITORING_SET 262	NIAQBROKE 497
MONITORPORT 262	NIAXMTMOUT 480
MORECHAN 361	NLIST 283
MP_DOWN 289	NO_AGGR_ON_TRUNK 361
MP_UP 290	NO_CALLBACK 280
MPNOTFOUND 457	NO_CMTS_MIRRORING 263
MSG 250	NO COMP 481
MSG_RX 234, 554	NO_ENABLED_TARGETS 431
MSG_TX 234, 555	NO_ENCR 481
MULTI_NOT_REMOVED 545	NO_IFINDEX 396
MULTIADDFAILURE 539, 545	NO_MCAST 559
MULTIADDPORTS 537	NO_POS_MIRRORING 263
MULTICPU 474	NO_REPLY 136
MULTICREATED 537	NO_SEND 278
MULTIMASTERS 181	NO_SERVER 280
MULTIPLEUSERS 497	NO_START 280
MULTIREMOVED 537	NO_TARGETS 431
MULTIRMPORTS 537	NO_TIMERS 280
MULTISECNDRY 181	NO_VC 79, 92
N	NO_VCI 92
	NO_VPI 92
NAME 197, 375	NO_WAN_MIRRORING 263
NAMETOOLONG 77, 198	NOACCESSCHNG 546
NATATTACHED 198	NOACL 1
NATCFG 209	NOACL 1 NOACTIVE 118
NATCONFIGURED 6, 539, 546	NOACTIVE 118 NOACVOPT4UDP 251
NATHSTMODECFG 209	NOACVOPT4WILD 252
NATINFO 6	NOADDRS 559
NBMANBREXISTS 303	NOAGGRAPPLY 361
NBMANBROVFL 304	NOAGGRGHEAD 159
NBRNOTFOUND 304	NOAGGRGHEAD 139 NOAGGRGHEADPLCY 159
NEED_COMMAND 105	
NEEDACVREPLY 251	NOAGGRPARENT 361
NEEDPCR 23	NOAGGRRADVDST 159
NEEDPORT 251	NOAGGRRADVLIST 159
NEEDSCR 23	NOAGGRROUT 160
NEEDWILDPORT 251	NOAGGRSUPPORT 362
NEGATEBWALLOC 344	NOALL 1, 2, 312, 354
NEGFAILED 425	NOANNOT 210
NETEXISTS 51	NOASCNTUSEGR 52

NOASCNTUSEHS 52	NOMASK 210
NOASCONFIG 52	NOMATCH 105
NOASNUMEXPDST 328	NOMEM 78, 93, 111, 149, 211, 259, 313, 336, 345
NOASNUMEXPSRC 329	352, 362, 400, 425, 457, 499, 529, 547, 568
NOATM 78, 93	NOMLTPL 199, 547
NOAUTHTYPE 305	NOMODIFY 6
NOAVAILBW 23	NOMODIFYPORT 6
NOBACKUPCM 497	NOMODULENUM 226
NOBINDING 118	NOMP 78, 94
NOBKPLANES 480	NOMSG 499
NOBLIEFER 515	NOMULTICREATE 547 NONBUF 179
NOBUFFER 515	2,02,202
NOBUFMEM 405	NONE 2
NOBUFS 498	NONEGATE 105
NOCACHE 568	NONENET 425
NOCHANGE 2	NONIPIF 314, 362, 569
NOCHANGES 100	NONLIST 283
NOCHANNUM 210, 226	NONODE 211
NOCHGFTPPORT 252	NONUNIQRT 211
NOCHGVPNPORT 252	NONXTHOPUSEGR 53
NOCHILD 266	NONXTHOPUSEHS 53
NOCOMMIT 102	NOOP 342
NOCONFIG 100, 481	NOOPTVAL 78
NOCREATE 546	NOPARENT 363
NODATATYPE 93	NOPASSWD 482
NODEFAPPLY 362	NOPEERADDR 199
NODEVICE 498	NOPHYPORT 79, 94
NOENHCAP 481, 498	NOPOLICY 314, 363
NOENTRY 341	NOPORT 253
NOEXIST 198	NOPORTCONFIG 337
NOEXPIRED 118	NOPORTFORINIT 337
NOFACINST 78	NOPORTFORPPP 337
NOFLASHCARD 498	NOPORTFORPROTO 337
NOFLOWFORCESTP 457	NOPORTINFO 363
NOFORWARD 215	NOPORTLISTAVIAL 24
NOFTPDATAGRP 252	NOPORTSVLAN 363
NOHELPER 215	NOPOS 94
NOHISTENT 62	NOPVST 458
NOHOSTSADDED 248	NOPWRSPLY 475
NOHOTSWAP 498	NOREDSUPPORT 342, 345
NOHWADDR 351	NOREMOVE 547
NOHWSUPPORT 539, 546	NOREMOVEFROMDEFAULTVLAN 548
NOIGMP 266	NORESOURCESAVAIL 24
NOINTERFACES 259	NORESP 372
NOINTF 362	NORESPONSE 295, 526
NOIPADDRCFG 210	NOROUTE 151
NOIPXADDRCFG 226	NOROUTERID 305
NOLEGALGRPS 52	NORTRIDCFGD 53
NOLEGALPEERS 53	NORULE 263
NOMAC 198	NOSETOPTFTPDATAGRP 253

NO GO GIVETT TO	NOTES A VIEW AND
NOSOCKET 560	NOTSAVED 102
NOSPAWN 534	NOTSTUBBBONE 306
NOSPEEDDUPLEX 482	NOTSUPPORTED 95
NOSPEEDFIBER 482	NOVALIDAREA 306
NOSSRMEM 400	NOVC 459
NOSTATIC 118	NOVCLFOUND 24
NOSTDEBUG 148	NOVPLFOUND 24
NOSTKMEM 144, 287, 405, 444	NOWAN 79, 95, 452, 459
NOSTP 458	NOWAN_FILTER 452, 460
NOSUBSTITUTE 105	NULLDATAPTR 163
NOSUCHFILE 106	NUMOFBIFERR 306
NOSUCHGRP 253	NUMOFCCONNERR 160
NOSUCHHOST 253	NUMOFCHAINERR 41
NOSUCHIF 199, 216, 275, 314, 364, 560, 569	NUMOFEXPFLTERR 329
NOSUCHIP 560	NUMOFEXPPLCYERR 329
NOSUCHMODULE 364	NUMOFKEYERR 41
NOSUCHPORT 199	NUMOFNBIFERR 307
NOSUCHPVST 458	0
NOSUCHRULE 7, 314, 364	OAMNORSP 19
NOSUCHTASK 54, 160, 306, 381, 388	OAMNOTXMT 19
NOSUCHVCL 200	OBJMISS 54, 307, 382, 388
NOSUCHVIPRANGE 254	OBJUNKNWN 79
NOSUCHVLAN 364, 458, 548	OID_BIND 397
NOSUCHVR 560	OMACMISMATCH 200
NOSVRLIST 569	ONEKEYONLY 307
NOT REMOVED 548	ONLYLANPORTALLOWED 482
NOTAGGRORFLOW 365	ONLYPHYPORTALLOWED 483
NOTALLOWED_LIST 186	OPT2ADDRSPECFAIL 160
NOTANIPINTF 345	OPTIONNOTALLOWEDONPORT 436
NOTANIPXINTF 345	OPTMISMATCH 7
NOTAPARENT 365	OPTREQSOPT 80
NOTATRUNKPORT 548	OPTSET4GRP 254
NOTENO 211	OPTSET4SER 254
NOTENABLED 499	OPTUNKNWN 80
NOTFDS 143	ORPHANMASK 212
NOTFOUND 106	OSPFEXPDSTEXIST 330
NOTIMEZONE 294, 295	OSPFIMPSRCIDEXIST 330
NOTIMPLEMENTED 94	OTHERCMDS 425
NOTINAGGRMODE 364	OUTOFBUFFERS 338
NOTINFLOWMODE 365	OVERFLOW 339
NOTINL4BDGVLAN 7, 345	OVERLAP 186
NOTINLINKMODE 366	OWNER 560
NOTIPVLAN 346	P
NOTIPXVLAN 346	-
NOTLINKLEVEL 366	PACKET 215
NOTMEMBOFPVST 459	PARAMMISSING 96
NOTMEMOFVLAN 459	PARENT_MORECHAN 366
NOTRSVDCOMM 329	PARSEIVKYWD 80
NOTRUNK 79, 95	PARSENOOPT 80
NOTRUNNING DVMRP 120	PARSEOPTERR 81
INOTROTNINO DAININE 170	PATH_MAX_T_REQ 136

PATH_T_MAX_LB 136	PPP_PROTOCOL_UP 291
PATH_TVX_LB 137	PPP_SHUTDOWN 407
PEERIDSAME 54	PPP_UNKNOWN_PROTOCOL_DOWN 291
PERM 375	PPP_UNKNOWN_PROTOCOL_UP 291
PERMIT ACL 3	PPPADDNOTSUPP 201
PHY_PORT_SET 417	PPPEVENT 335
PINGER_ADD 312	PPPIFPORTSEXCD 201
POLICYATTACHED 200	PPPSHIM_DUP_IPADDR 413
POLICYEXISTS 315	PPPSHIM_NO_DST 413
PORT ADDED 166	PPPSHIM_SUBNET_MISMATCH 413
PORT_AUTONEG 475	PRECEDENCEDEFAULT 342
PORT_CABLE_BAD 413	PRIMARY_NO_SUCH_IMAGE 500
PORT_CLEANUP 238	PRIORITY 561
PORT_FORBIDDEN 167	PRISETCANTDELLG 460
PORT_INVALID 170	PRISETCANTDELMLP 461
PORT_LER_ALARM 137	PRO_DEF 393
PORT LER CUTOFF 137	PRO_DEL_DEF 393
PORT_REMOVED 166	PRO_NON_DEF 394
PORT_STATUS 451	PRO_OFF 394, 397
PORTBAD 63, 96	PROTIDINV 461
PORTBADMUX 25	PROTMISMATCH 8
PORTBKTUSED 367	PROTNOTSUPP 202
PORTBUSPARITY 499	PROTO 375, 500
PORTBUSWRITE 500	PROTOCOL 400
PORTDISABLEDBYMGMT 460	PROTOMETIGN 319
PORTDOESNOTEXIST 25	PROTONOTCFG 54
PORTFLOWMODE 7	PROTONOTCFGED 54
PORTHASINUSEVCLS 25	PVST_RSTPENBLD 461
PORTHASSRVDEF 25	PVSTENBLD 461, 549
PORTHASVCLS 26	PVSTEXSTS 549
PORTHASVLAN 200	PWD2LONG 111
PORTHSTFLOWMODE 8	PWRFAIL 58, 483
PORTINVLAN 201	PWRINSTALLED 57
PORTLEVEL_ALREADYDISABLED 367	PWRNORMAL 58
PORTLEVELPOLICIES 367	PWRNOTREDUNDENT 59
PORTNO 460	PWROKAY 475
PORTNOTFOUND 8, 63	PWRREDUNDENT 58
PORTNOTINVLAN 367	PWRREMOVED 59
PORTRANGEBAD 81	PWRSPLY 475
PORTS_OVERLAP 106	Q
PORTSADDED 419	QFULL 338
PORTSATTACHED 426	QOSATTACHED 202
PORTSREMOVED 420	QSENDFAIL 144, 287, 444
PORTSTATE 453	QSENDFAILED 338
POS_ONLY 96	QSENDFULL 143, 442
POST FAIL 137	_
POSTFAILED 26	QUERY1 383 QUERY3 384
PPP_MP_PROTOCOL_DOWN 290	QUERY3 384 R
PPP_MP_PROTOCOL_UP 290	
PPP_PROTOCOL_DOWN 290	RAT_FULL 501, 561
III_IROTOCOL_DOWN 270	RATE_UNAVAIL 368

RCMD 375	ROUTEOV 13
RCVDLOOPBACK 338	ROUTEOVFL 13, 450
READFAILURE 513	RSTPNOWAN 453, 462
REBOOT_NOW 397	RSTPWANEXISTS 462
RECFG 297	RSVDCOMMWKN 331
RECONFIGDONE 151	RTCIVTIME 483
RECVFROM 122, 561	RTDUMP 284
REDPARAMEQUAL 501	RTDUMPALLOC 284
REFERENCE 8	RTDUMPSIZ 284
REG_GVRP 172	RTEFLTNOTFOUN 13
REG_LRN 240	RTQKILL1 207
REG_MCAST 170	RTQREALLYOLD 206
REG_MODE 167, 170	RTRIDCHANGED 307
REGL2ADDR 26	RTRIFOVFL 308
REGSTCHNG 147	RXD_VRRP_PKT 562
REINIT_MODULE 131	\mathbf{S}
REL_SEMA4 107, 170, 239, 562	SAME 48
REM_COMM_FAIL 431	SAME PRECE 346
REM_TARGET_FAIL 431	SAMEADDR 203, 417
REMACVOPT4GRP 254	SAMEENCAP 203
REMACVOPT4SER 255	SAMEGROUP 55
REMOTE 376, 527	SAMEPOLICY 255
REMOVED 420, 538	SAMEPROTO 9
REMOVEDIF 187	SAMEVARIANT 255
REMOVEPOLICY 255	SANITYCHK 352
REMOVINGIF 188	SAPGNSPACKPERITER 220
REPLY 349	SAPPACKPERITER 220
REPUNRESOLVE 206	SARACKERR 26
RESERVEDIF 202	SARCHKSUMERR 26
RESET_TMR 173	SARCHKSUMTIMEOUT 27
RESETTMRFAIL 212, 226	SARDOWNLOAD 27
RESTART_TIMER_FAILED 442	SARERRO 27
REUSEBELOW 44, 55	SARERR1 27
RINGGONE 340	SARERR10 30
RIPEXPDSTEXIST 330	SARERR2 28
RIPIMPSRCIDEXIST 330	SARERR3 28
RIPPACKPERITER 220	SARERR4 28
RIPREQPACKPERITER 220	SARERR5 28
RLATTACHED 203	SARERR6 29
RMON_DISABLED 429	SARERR7 29
RMON_ENABLED 428	SARERR8 29
RMON_MEM 397, 429	SARERR9 29
RMON_RX 483	SARFILENAMEUNKNOWN 30
RMON_TX 235, 483	SARFILEOPENFAILED 30
RMONENABLED 280	SARFILEREADFAILED 30
RMPORTS 538	SARLOADFAILEDNOMEM 31
ROUTEADDED 206	SARPOSTTIMEOUT 31
ROUTEDELETED 206	SARSIZEUNKNOWN 31
ROUTEEXISTS 212, 449	SARTIMEOUT 31
ROUTENOTFOUND 449	SAVED 100

SCRGRTRPCR 31	SPCFYFLOWFIELDS 346
SEARCH 107	SPLITHOSTS 256
SEMAPHORE 123	SPURIOUSINT 442
SEND_ARP 562	SRCFILE 502
SEND_VRRP 562	SRCFLTROVFL 14
SENDFAIL 218	SRCIDEXIST 14
SENDMSG 516	SRCNETWORKNOTSPCFYD 346
SENT_TRAP 428	SRCNOTFOUND 14
SERVICEACL 9	SRCOVFL 14
SERVICENONFR 519	SRVDEFNAMENOTFOUND 32
SERVICENONPPP 519	SRVDEFOPENREF 32
SESSIONDENIED 527	SSOCKOPTFAIL 162
SESSIONENDED 527	ST_CONFLICT 235, 239
SET_TEG_FLAG 281	ST_PORT_SYNC 235
SETDSTIME 501	ST_STATUS 235
SETSOCK 563	START 152, 277
SETTEGFAIL 212, 226	START RAT FULL 563
SETTIME 179, 295, 501	START_TIMER_FAILED 442
SETVARIANT 246	START_TMR 173, 239
SGWAYEXISTS 388	START_WARMUP 552
SGWAYOVFL 388	STARTCMD 563
SHOSTEXISTS 308	STARTED 119, 166
SHOSTNOTFOUND 308	STARTED DVMRP 119
SHOSTOVFL 308	STARTED_ALRDY DVMRP 120
SLAVECPU 475	STARTID_TOOBIG 549
SLOT_TEMPOKAY 440	STARTINTF 141
SLOT_TEMPTOOHIGH 442	STATE 552
SLOTEMP 275	STATESETCANTDELLG 462
SMT_CONN_POL 137	STATESETCANTDELMLP 462
SMT_STAT_RPT_POL 138	STATION_MOVE 236
SMT_T_NOTIFY 138	STATUS 371, 420
SMT_TRACE_MAX_EXP 138	STCR 271
SMT_USER_DATA 138	STD_DEF 394
SMTIMERCREATEERR 32	STD_DEL_DEF 394
SNGLGWAYIFEXISTS 450	STD_NON_DEF 394
SNMPEVTNOTIFY 161	STD_INGN_BER 331
SNMPIFINUSE 161	STLCLEXSITS 275
SNMPOFF 398	STLCLGBL 276
SNMPRSPNOTIFY 161	STNOTFOUND 203, 239, 426, 463, 549
SNMPTMO 161	STOP 277
SNOOP_STARTED 183	STOP_TIMER_FAILED 443
SNOOP_STOPPED 183	STOP_TMR 173
SOCK 376	STOPINTF 142
SOCKET_OPEN_FAILED 516	STOPPED 166
SOCKETSETTYPEMISMATCH 502	STOPTIMER 431
SOCKETSETT FEMISMATCH 302 SOCKETSETUPRCHNLSYNCFAIL 502	STP_VERSION 452
SONET APSPROTONLY 436	STP_VERSION 432 STPRT 276
SONET NOMEM 437	STPSETCANTDELLG 463
SONET_NOMEM 437 SONET_ONLY 96	STPSETCANTDELLG 403 STPSETCANTDELMLP 463
SONETAPS SWITCH 433	STRATIJM 296
	VI I I V (2) I V / I V / 2 V /

STRINGTOOBIG 256	TSKDELETED 55, 162, 309, 382, 389
STRM 271	TTLEXP 214
STRNG 276	TXFR 376
STRNGMAX 276	\mathbf{U}
STRTTIMER 463	UNABLETOSETSTATE 464
SUBNETEXISTS 204	UNKNOWN_MODE 502
SUNI_CSR_TEST 113	UNKNOWN_SERV 376
SVRLIST_EXISTS 569	UNKNOWNCMD 33
SYNCINPROG 178	UNKNOWNURL 503
SYNCTIMERCVD 176	UNKNWNERR 125, 126, 127, 128
SYNTAX_ERR 401	UNKNWNMSG 180
SYSERR 266	UNKWNHOST 294, 296, 503, 516, 530
SYSIMGTOBACKUP 476	UNMAPDERR 125, 126, 127, 128
SYSTEM 122	UNREACH 376
T	UNREACHDECAY 44, 55
TASKENDED 527	UNREG_MCAST 171
TBL_MISMATCH 236	UP 291
TEMPFANSFAIL 513	UPDATE 277
TEMPOKAY 475, 476	USER_LIST 566
TERMINATED DVMRP 119	USESAMERANGE 256
TGWAYEXISTS 389	V
TGWAYOVFL 389	
TIMEOUTIGNORED 421	VALUE_TOO_LONG 437
TIMER 181, 426, 463, 563	VC_DOWN 292
TIMER_FAIL 281	VC_RANGE_DOWN 292
TIMER_SET 148	VC_RANGE_UP 292
TIMESYNC 293	VC_UP 292
TMR_BIND 401	VCALREADYEXIST 522
TMR_MISSING 555	VCCLOSEERR 33
	VCCLOSETIMEOUT 33
TMRCREATFAIL 59, 241, 333 TMRSTARTFAIL 60, 182, 242, 334	VCDISCREPENCY 33
	VCIOUTOFRANGE 34
TOOLONG 107	VCLALREADYOPEN 18
TOOMANYACLS 215, 269	VCLBADMUX 36
TOOMANYACLS 315, 368	VCLHASSRVDEF 34
TOOMANYINTES 145	VCLMAXEXCEEDED 34
TOOMANYIVES 22	VCLNOTINSERTED 34
TOOMANYVUS 32	VCLOUTOFRANGE 35
TOOMANYVIF 122	VCMODIFYSARERR 35
TRAFFICTYPEBAD 33	VCNOTALLOWED 342, 347
TRANS 371	VCOPENNOMEM 35
TRANS_APPLETALK_ARP 139	VCOPENTIMEOUT 35
TRANS_IPX 139	VCPRI 464
TRANSAREANOTFOUND 309	VCRANGEBAD 81
TRAP 432	VCSTATEBAD 36
TRAP_DISABLED 432	VERSION 296
TRUNK_PORT 168	VERSMISMATCH 178
TSHP_CSR_TEST 114	VFSBADINUSECNT 503
TSHP_END_TEST 114	VFSBADVERSION 504
TSHP_SAR_TEST 114, 115	VFSCORRUPT 504
TSHP TEST 115	VESDISKCREATE 504

VFSDISKOPEN 504	WAN_CREATE_FAILED 188
VFSDISKREAD 504	WAN FRVLAN 418
VFSDISKWRITE 505	WAN_NEGATE_FAILED 189, 540
VFSENTRYFREED 505	WAN_NO_MEM 418
VFSFILECLOSE 505	WAN_ONLY 97
VFSFILESYSFULL 505	WAN_PPP_BCAST_ASSUMED 188
VFSINTFLASHBAD 505	WAN_PPP_BCAST_IGNORED 189
VFSMODECONFLICT 506	WAN_PPPVLAN 418
VIPPORTUSED 256	WAN_SYNCH_SUCCESS 476
VIPRANGENAMEUSED 257	WAN_TOD_RECEIVE_FAIL 484
vlan 236	WAN_TOD_RECVQ_FAIL 484
VLAN_ADD_PORT 168	WAN_TOD_SEND_FAIL 484
VLAN_BOUND 171	WAN_TOD_TMR_FAIL 484
VLAN_CREATE 166	WAN_TOD_WAIT_FAIL 485
VLAN_CREATE_ERROR 171	WAN_VLAN_EXIST 189
VLAN_CREATED 355	WANEEPTFAIL 464
VLAN DELETED 355	WANFAIL 188
VLAN L4BDG 168	WANNOTALLOWED 236, 240
VLAN_NOTEXISTS 168	WANONLY 81
VLAN_PORTS 169	WANPORTOUTOFRANGE 485
VLAN_REMOVE_ERROR 171	WARMUP 554
VLAN REMOVE PORT 169	WFQNOTENABLED 347
VLAN_REMOVE_FORT 109 VLAN_REMOVED 167	WFQVALUESINCORRECT 347
VLAN_STATIC 169	WILDCARD 100
VLANADDFAIL 520	WORK_CREATED 278
VLANID 236	WRITE 377
VLANIFTYPENOTSUPP 204	WRITECONFIG 432
VLANNOTL4BDG 368	WRITEFAIL 162
VLINKEXISTS 309	WRITTEN 101
VLINKIDEXISTS 309	WRKINPROGRESS 56
VLINKNOTFOUND 310	WRONG_RATE 369
VLINKOVFL 310	WRONGACL 9
VNAMINVALID 464	WRONGPORTTYPE 37
VPIOUTOFRANGE 36	WRONGPRIOVALUE 347
VPLBADMUX 36	WRONGPROTOCOL 10
VPLHASSRVDEF 37	X
VPLMAXEXCEEDED 37	XBARTMOUT 506
VPLNOTCLOSED 37	XFERBACKUP 506
VPNDEST 247	XFERRATE 371, 525
VPORT 267	XMTQFULL 149, 180, 426, 465
VR_CREATED 552	Y
VR_IPADDED 553	YORK FILE 139
VR_IPREMOVED 553	YORK PROGRAM 139
VR_REMOVE_DONE 553	\mathbf{Z}
VR_STARTED 553	ZEROAREAS 310
VR_STOPPED 554	ZEROGRPCFGED 56
VRL_EXISTS 368	ZEROINTFS 310
W	ZEROPEERS 56
WAIT_TEG_EVENTS 443	ZEROPEERS 30 ZEROPORTSINIF 189, 204
WAITTEGFAIL 212, 227	ZEROFORTSIMI 109, 204